



Field Station NPL-632

Instruction Manual

Version A1.1.0
May 2006

Contact Information

Trimble Navigation Limited
Engineering and Construction Division
5475 Kellenburger Road
Dayton, Ohio 45424-1099
USA
800-538-7800 (toll free in USA)
+1-937-245-5600 Phone
+1-937-233-9004 Fax
www.trimble.com

Copyright and Trademarks

© 2006, Nikon-Trimble Co. Limited. All rights reserved.

Microsoft, Windows, and ActiveSync are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

All trademarks are the property of their respective owners.

It is prohibited to alter this manual in part or whole without express permission.

The contents of this manual are subject to change without notice. Although every effort has been made to ensure the accuracy of this manual, please contact your dealer if you find anything in it that is incorrect or unclear.

Release Notice

This is the May 2006 release (revision A) of the *Field Station NPL-632 Instruction Manual*. It applies to software release version 1.10 for the field station NPL-632.

Notices

USA

FCC 15B Class B satisfied.

This equipment has been tested and found to comply with the limits for a Class B personal computer and peripherals, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.



Warning – This equipment has been certified to comply with the limits for a Class B personal computer and peripherals, pursuant to Subpart B of Part 15 of FCC Rules. Only peripherals (computer input/output devices, terminals, printers, etc.) certified to comply with the Class B limits may be attached to this equipment. Operation with non-certified personal computer and/or peripherals is likely to result in interference to radio and TV reception. The connection of a non-shielded equipment interface cable to this equipment will invalidate the FCC Certification of this device and may cause interference levels which exceed the limits established by the FCC for this equipment.

You are cautioned that changes or modifications not expressly approved by the party responsible for compliance could void your authority to operate the equipment.

European Union

EU EMC Directive satisfied.



Canada

This Class B digital apparatus meets all requirements of the Canadian Interference-Causing Equipment Regulations.

Cet appareil numérique de la Class B respecte toutes les exigences du Règlement sur le matériel brouilleur du Canada.

Taiwan

Battery recycling requirements

The product contains a removable battery. Taiwanese regulations require that waste batteries are recycled.



「廢電池請回收」

Notice to Our European Union Customers

For product recycling instructions and more information, please go to:

www.trimble.com/environment/summary.html

Recycling in Europe

To recycle Trimble WEEE,
call: +31 497 53 2430,
and ask for the “WEEE associate,”
or mail a request for recycling instructions to:
Trimble Europe BV
c/o Menlo Worldwide Logistics
Meerheide 45
5521 DZ Eersel, NL



Contents

	Safety 11	
	Introduction	12
	Laser Safety	12
	Warnings and Cautions	13
	Warnings	13
	Cautions	14
1	Introduction	1
	Welcome	2
	Parts of the Instrument	3
	Maintenance	5
2	Preparation	7
	Unpacking and Packing the Instrument	8
	Unpacking	8
	Packing	8
	Charging the Battery Pack	8
	Detaching and Re-Attaching the Battery Pack	10
	Using the CompactFlash (CF) Card	11
	Inserting a CF card into the card slot	12
	Removing a CF card from the card slot	13
	Using the USB Memory Stick	13
	Inserting the USB memory stick into the connector slot	14
	Transferring files from the instrument to an office computer using USB	14
	Setting Up the Tripod	15
	Centering Using the Optical Plummet	15
	Leveling	17
	Sighting	17
	Setting the Measurement Mode and Preparing the Target	18
	Measurement with a prism	18
	Measurement in Reflectorless mode	19
	Preparing the Reflector Sheet	21
	Setting Up the Prism Reflector	22
	Adjusting the height of the tribrach adapter	22
	Changing the direction of the prism	23
	Setting the prism constant	23
	Setting the position of the target plate	24
	Carrying the Instrument Case	24
	Face-1/Face-2 Measurements	26
3	Getting Started	27
	Turning the Instrument On and Off	28
	Turning on the instrument	28
	Turning off the instrument	28
	Selecting a Language	29
	Changing Regional Configuration Pre-sets	30
	Display and Key Functions	31
	Status bar	33

Adjusting lighting and sound levels.	.35
[DSP] key	.36
[MODE] key.	.37
[COD] key	.38
[HOT] key	.39
Bubble indicator	.41
[LG] key	.42
[USR] keys	.42
[DAT] key.	.43
List Display.	.44
Inputting Data	.44
Entering a point name or number	.44
Entering a code	.48
<i>Advanced feature: Searching for a code by using the first character</i>	<i>49</i>
Entering values in feet and inches	.50
Jobs	.51
Creating a new job	.51
Measuring Distances.	.52
Sighting a prism reflector	.52
Measuring distances.	.53
Measurement settings	.53
4 Applications	55
HA Reset and Angle Operations.	.56
Setting the horizontal angle to 0	.56
Entering the horizontal angle	.56
Recording a foresight point after repeat angle measurement	.56
Face-1/Face-2 measurement	.57
Horizontal angle hold	.58
Station Setup	.58
Setting up a station with known coordinates or azimuth.	.58
<i>Advanced feature: Measuring F1 and F2</i>	<i>60</i>
Setting up a station using multiple point resection	.61
<i>Advanced feature: Viewing and deleting a measurement in resection</i>	<i>64</i>
Setting up the station quickly without coordinates	.64
Determining station elevation	.65
Checking and resetting the backsight direction	.66
Two-point resection along a known line	.67
Stakeout	.69
Specifying the stakeout point by angle and distance	.69
Specifying the stakeout point by coordinates	.71
<i>Advanced feature: Specifying a stakeout list by range input</i>	<i>73</i>
DivLine S-O	.73
RefLine S-O	.74
Program Key	.76
Measuring distance and offset values along a specified line	.76
Measuring distance and offset values on the arc-curve	.78
Remote distance measurement.	.80

Measuring remote elevation	.82
Measuring distance and offset values on the vertical plane	.83
Measuring distance and offset values on the slope	.85
Recording Measurement Data.	.86
Recording data from any observation screen	.86
Outputting data to the COM port	.87
Measuring Offsets	.88
Measuring taped offsets	.88
Measuring angle offsets	.89
Two-prism pole	.89
Extending a line by horizontal angle offset	.90
Entering a horizontal distance after an angle-only shot	.92
Calculating a corner point	.92
Measuring circle offsets	.94
Extending the slope distance.	.95
5 Menu Key.	.97
Introduction.	.98
Job Manager	.98
Opening an existing job	.98
Creating a new job	.99
Deleting a job	100
Setting the control job	100
Displaying job Information	101
Importing a job.	102
Exporting a job.	103
Cogo	104
Calculating angle and distance between two coordinates	104
Calculating and manually inputting coordinates	106
Calculating area and perimeter	108
<i>Advanced feature: Entering a range of points</i> 109	
Calculating coordinates from line and offset	110
Calculating coordinates using intersection functions	111
<i>Advanced feature: Entering angle and distance offsets</i> 115	
Settings.	115
Angle	116
Distance	116
Coordinate	118
Power saving.	118
Communications	118
Stakeout.	118
Unit	119
Recording.	120
Others settings	120
Data	121
Viewing records	121
Deleting records	125
Editing records.	126

Searching records	129
Entering coordinates	131
Point name list and code list	132
Communication	135
Downloading data	135
Uploading coordinate data	136
<i>Advanced feature: Editing the data order for upload</i>	137
Uploading a point name list or code list	138
1sec-Keys	138
[MSR] key settings	138
[DSP] key settings	139
[USR] key settings	139
[S-O] key settings	140
[DAT] key settings	140
Calibration	140
Time	141
Removable Memory (External Memory)	142
Displaying the external memory files	142
Renaming a job or file on the removable memory	142
Deleting a job of file from the removable memory	143
Coping a job from the removable device	144
Changing the list view of files on the removable memory	144
6 Checking and Adjustment	145
Checking and Adjusting the Plate Level	146
Checking and Adjusting the Circular Level	146
Checking and Adjusting the Optical Plummet	147
Zero Point Errors of Vertical Scale and Horizontal Angle Corrections	148
Checking	148
Adjusting	148
Checking the Instrument Constant	152
7 Specifications	155
Main Body	156
Telescope	156
EDM	156
Dual-axis tilt sensor	157
Angle measurement	157
Precision	157
Measurement intervals	158
Lumi-guide	158
Clamps/tangent screws	158
Tribrach	158
Level vial sensitivity	158
Optical plummet	158
Display and keypad	159
Connections in the base of instrument	159
Battery pack BC-80	159
Environmental performance	159

	Dimensions	159
	Weight	159
	CompactFlash card	160
	USB Connecters	160
	Standard Components	160
	External Device Connector	161
8	System Diagrams	163
	System Components	164
9	Communications	167
	Uploading Coordinate Data	168
	Settings	168
	Record format	168
	Uploading Point Lists and Code Lists	170
	Settings	170
	File format	170
	Downloading Data	172
	Settings	172
	Nikon raw record formats	172
	SDR2x and SDR33 record formats	175
	Data examples	179
10	Error Messages	183
	Angle	184
	Cogo	184
	Communications	184
	Data	185
	Job Manager	186
	Programs	186
	Recording Data	187
	Searching	188
	Settings.	188
	Stakeout	188
	Station Setup	189
	Removable Memory Devices	190
	System Error	191

Safety

In this chapter:

- [Introduction](#)
- [Laser Safety](#)
- [Warnings and Cautions](#)

Introduction

For your safety, read this instruction manual carefully and thoroughly before using the NPL-632 instrument. Although Nikon products are designed for maximum safety, using them incorrectly or disregarding the instructions can cause personal injury or property damage.

Also read the instruction manual for the battery charger, and the documentation for any other equipment that you use with a NPL-632 instrument.

Note – Always keep the manual near the instrument for easy reference.

Laser Safety

The NPL-632 is a Class 1 laser instrument. Class 1 laser instruments do not require any special precautions, signage, or training for laser safety.



WARNING – The laser beam is hazardous to the eyes and the body. Do not sight the instrument on the face or body of a person.

Table 1.1 Specifications for laser emission

Wave length	870 nm
Drive method	Pulse repetitive drive
Output power	<6.4 W
Pulse width	<5 ns

Table 1.2 Specifications for LED emission for Lumi-Guide

Wave length	670 nm
Drive method	1 Hz and CW drive

Table 1.3 Safety class

E.U.	EN60825-1/Am.2:2001 (IEC60825-1/Am.2:2001), class 1
U.S.A.	FDA21CFR, Part 1040, Sections 1040.10 and 1040.11 (except for deviations pursuant to Laser Notice No. 50, dated July 26, 2001), class 1



Complies with 21 CFR 1040.10 and 1040.11
except for deviations pursuant to
Laser Notice No. 50, dated July 26, 2001
MADE IN JAPAN

NIKON-TRIMBLE CO., LTD.
16-2, MINAMIKAMATA 2-CHOME,
OTA-KU, TOKYO, JAPAN

Warnings and Cautions

The following conventions are used to indicate safety instructions:



WARNING – Warnings alert you to situations that could cause death or serious injury.



CAUTION – Cautions alert you to situations that could cause injury or property damage.

Always read and follow the instructions carefully.

Warnings

Before using the instrument, read the following warnings and follow the instructions that they provide:



WARNING – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.



WARNING – The NPL-632 instrument is not designed to be explosion-proof. Do not use the instrument in coal mines, in areas contaminated with coal dust, or near other flammable substances.



WARNING – The NPL-632 total station is a Class 1 laser instrument. The laser beam is hazardous to the eyes and the body. Do not sight the instrument on the face or body of a person. If you suspect an injury caused by exposure to the laser beam, seek medical advice immediately. If the instrument housing is open and the instrument is turned on, the laser emits a beam stronger than the Class 1 safety level.



WARNING – Never disassemble, modify, or repair the instrument yourself. If you do, you may receive electric shocks or burns, or the instrument may catch fire. You may also impair the accuracy of the instrument.



WARNING – Use ONLY the battery charger that is attached to the instrument to charge the battery pack (P/N BC-80). Do NOT use any chargers other than the enclosed model. Using other chargers may cause the battery pack to catch fire or rupture. You cannot use the old Nikon chargers, models Q7U/E or Q-7C, to charge the BC-80.



WARNING – Do not cover the battery charger while the battery pack is being recharged. The charger must be able to dissipate heat adequately. Coverings such as blankets or clothing can cause the charger to overheat.



WARNING – Avoid recharging the battery pack in humid or dusty places, in direct sunlight, or near heat sources. Do not recharge the battery pack when it is wet. If you do, you may receive electric shocks or burns, or the battery pack may overheat or catch fire.



WARNING – Although the battery pack (P/N BC-80) has an auto-reset circuit breaker, you should take care not to short circuit the contacts. Short circuits can cause the battery pack to catch fire or burn you.



WARNING – Never burn or heat the battery. Doing so may cause the battery to leak or rupture. A leaking or ruptured battery can cause serious injury.



WARNING – Before storing the battery pack or battery charger, cover the contact points with insulation tape. If you do not cover the contact points, the battery pack or charger may short circuit, causing fire, burns, or damage to the instrument.

Cautions

Before using the instrument, read the following cautions and follow the instructions that they provide:



CAUTION – Use of controls, adjustments, or performance of procedures other than those specified herein may result in hazardous radiation exposure.



CAUTION – The tips of the tripod ferrules are very sharp. When handling or carrying the tripod, take care to avoid injuring yourself on the ferrules.



CAUTION – Although a Class 1 laser is regarded as safe under normal operating conditions, it is recommended that you cap the objective when the instrument is not in use in order to avoid laser emissions. Do NOT look into the laser.



CAUTION – Before carrying the tripod or the instrument in the carrying case, check the shoulder strap and its clasp. If the strap is damaged or the clasp is not securely fastened, the carrying case may fall, causing personal injury or instrument damage.



CAUTION – Before setting up the tripod, make sure that no-one's hands or feet are underneath it. When the legs of the tripod are being driven into the ground, they could pierce hands or feet.



CAUTION – After mounting the instrument on the tripod, securely fasten the thumb screws on the tripod legs. If the thumb screws are not securely fastened, the tripod may collapse, causing personal injury or instrument damage.



CAUTION – After mounting the instrument on the tripod, securely fasten the clamp screw on the tripod. If the clamp screw is not securely fastened, the instrument may fall off the tripod, causing personal injury or instrument damage.



CAUTION – Securely fasten the tribrach clamp knob. If the knob is not securely fastened, the tribrach may come loose or fall off when you lift the instrument, causing personal injury or instrument damage.



CAUTION – Before you pick up the instrument by the carrying handle, make sure that the battery pack is clamped securely in place, and that the battery mounting buttons are set in the vertical (LOCK) position. If the battery pack is not securely fastened, the main unit may come loose or fall off when you lift the instrument, causing personal injury or instrument damage.



CAUTION – Do not stack objects on the plastic carrying case, or use it as a stool. The plastic carrying case is unstable and its surface is slippery. Stacking objects on the carrying case or sitting on it may cause personal injury or instrument damage.

Introduction

In this chapter:

- [Welcome](#)
- [Parts of the Instrument](#)
- [Maintenance](#)

Welcome

Thank you for purchasing this Nikon product.

This instruction manual was written for the users of a Field Station NPL-632 instrument. Before you operate a NPL-632 instrument, read this manual carefully. In particular, pay attention to the warnings and cautions that appear in the Safety section at the front of the manual. Before you begin, you should also read the maintenance instructions. For more information, see [Maintenance, page 5](#).

Parts of the Instrument

Figure 1.1, Figure 1.2, and Figure 1.3 show the main parts of the NPL-632 instrument.

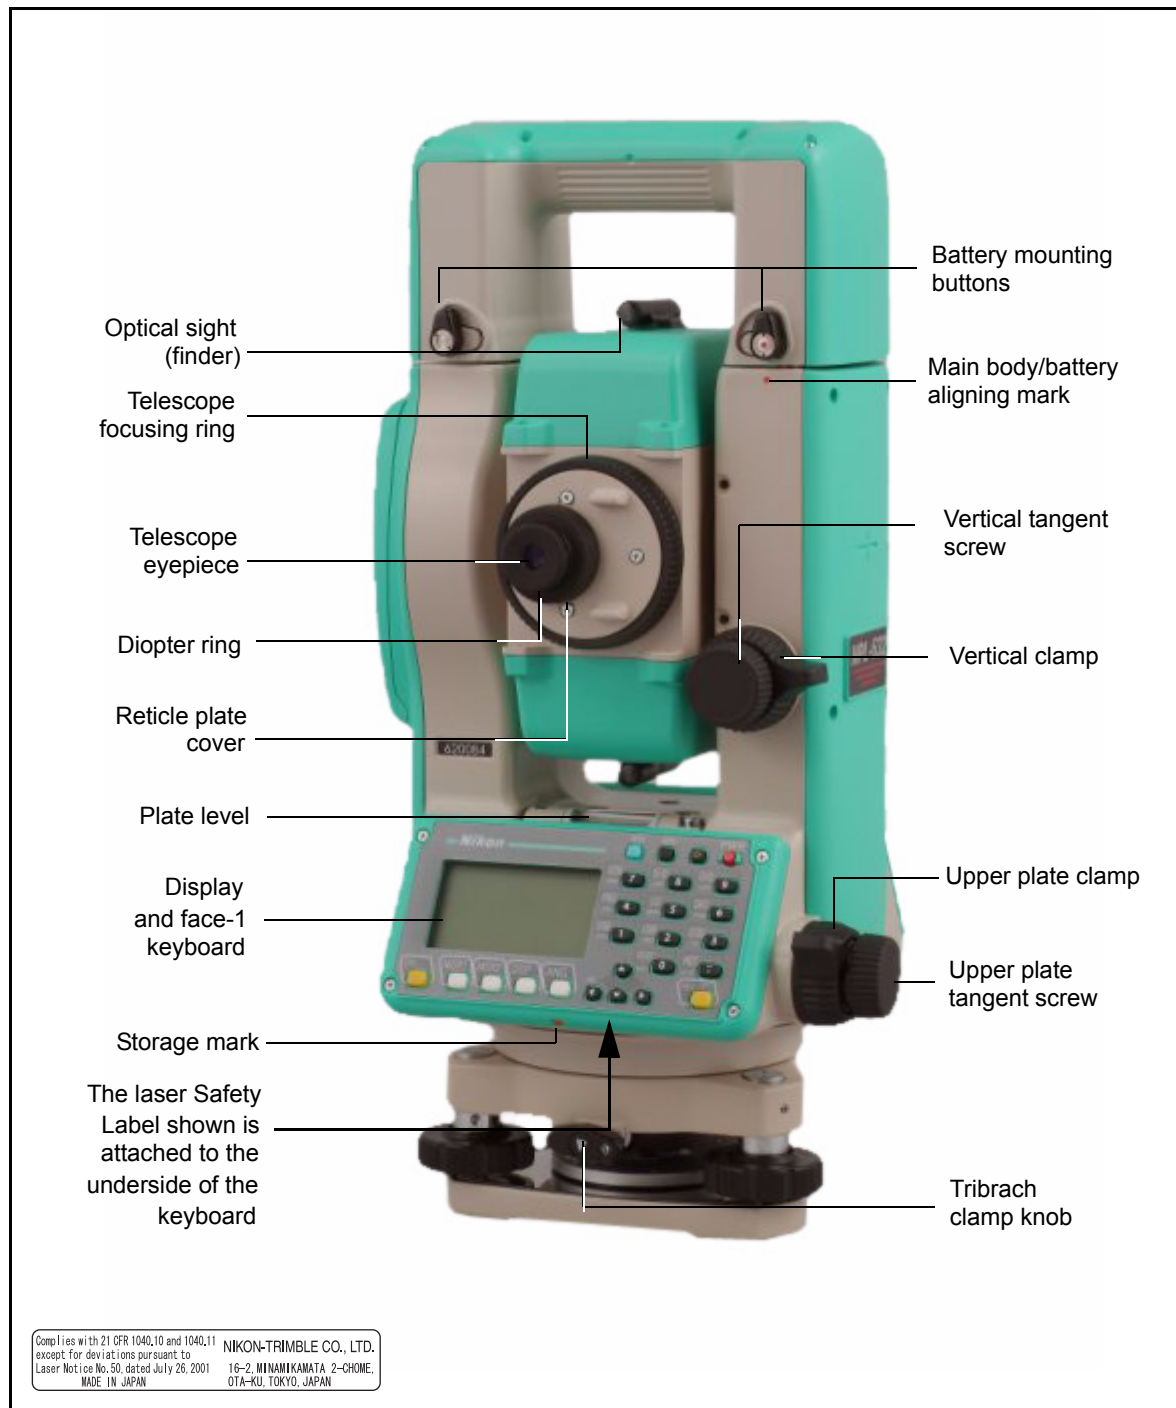


Figure 1.1 Field Station NPL-632 – Face-1

The Laser Class Label shown below is attached to the telescope.

クラス1レーザー製品
CLASS 1 LASER PRODUCT

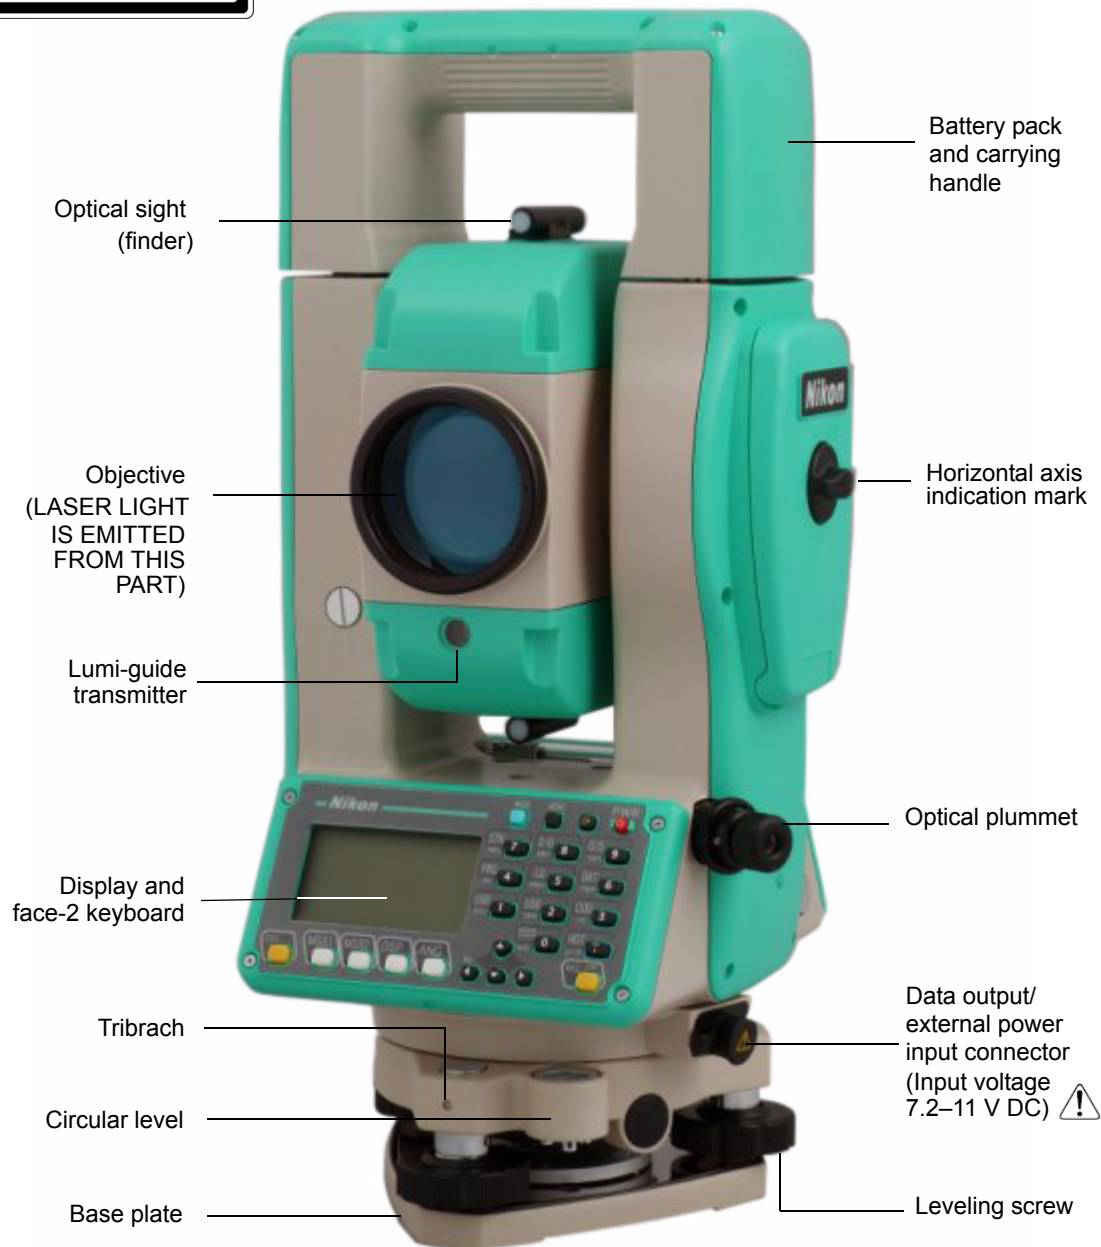


Figure 1.2 Field Station NPL-632 – Face-2

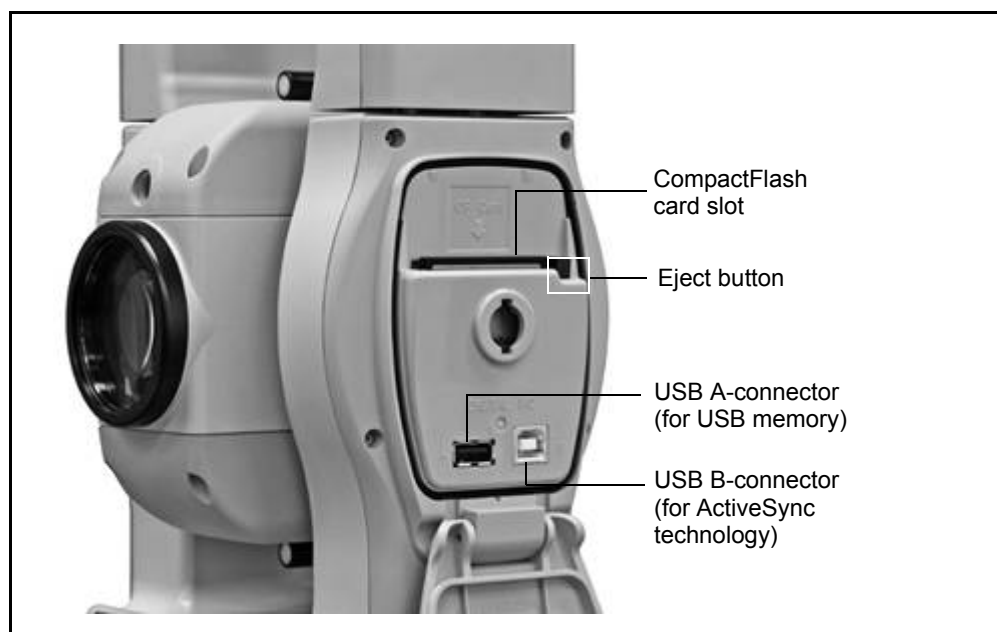



Figure 1.3 CompactFlash and USB ports

Maintenance

Before using the instrument, read and follow the following maintenance instructions:

- Do not leave the instrument in direct sunlight or in a closed vehicle for prolonged periods. Overheating the instrument may reduce its efficiency.
- If the NPL-632 instrument has been used in wet conditions, immediately wipe off any moisture and dry the instrument completely before returning the instrument to the carrying case. The instrument contains sensitive electronic assemblies which have been well protected against dust and moisture. However, if dust or moisture gets into the instrument, severe damage could result.
- In the field, make sure that the cap and cover are firmly closed. If you open the connector cap and/or the card slot cover in the field you cannot ensure the required waterproof and dust-proof standards (IP 54).
- Before you open the connector cap or the card slot cover, wipe off all moisture. If you open the cap/cover while it is wet, it might result in malfunction.
- Sudden changes in temperature may cloud the lenses and drastically reduce the measurable distance, or cause an electrical system failure. If there has been a sudden change in temperature, leave the instrument in a closed carrying case in a warm location until the instrument returns to room temperature.

- Do not store the NPL-632 instrument in hot or humid locations. In particular, you must store the battery pack in a dry location at a temperature of less than 30 °C (86 °F). High temperature or excessive humidity can cause mold to grow on the lenses. It can also cause the electronic assemblies to deteriorate, and so lead to instrument failure.
- Store the battery pack with the battery discharged.
- When storing the instrument in areas subject to extremely low temperatures, leave the carrying case open.
- Do not overtighten any of the clamp screws.
- When adjusting the vertical tangent screws, upper plate tangent screws, or leveling screws, stay as close as possible to the center of each screw's range. The center is indicated by a line on the screw. For final adjustment of tangent screws, rotate the screw clockwise.
- If the tribrach will not be used for an extended period, lock down the tribrach clamp knob and tighten its safety screw.
- Do not use organic solvents (such as ether or paint thinner) to clean the non-metallic parts of the instrument (such as the keyboard) or the painted or printed surfaces. Doing so could result in discoloration of the surface, or in peeling of printed characters. Clean these parts only with a soft cloth or a tissue, lightly moistened with water or a mild detergent.
- To clean the optical lenses, lightly wipe them with a soft cloth or a lens tissue that is moistened with alcohol.
- The reticle plate cover has been correctly mounted. Do not release it or subject it to excessive force to make it watertight.
- Press the cap that covers the data output/external power input connector terminal until it clicks into place. The instrument is not watertight if the cap is not attached securely, or when the data output/external power input connector is used.
- The carrying case is designed to be watertight, but you should not leave it exposed to rain for an extended period. If exposure to rain is unavoidable, make sure that the carrying case is placed with the Nikon nameplate facing upward.
- The BC-80 battery pack contains a Ni-MH battery. When disposing of the battery pack, follow the laws or rules of your municipal waste system.
- The instrument can be damaged by static electricity from the human body discharged through the data output/external power input connector. Before handling the instrument, touch any other conductive material once to remove static electricity.

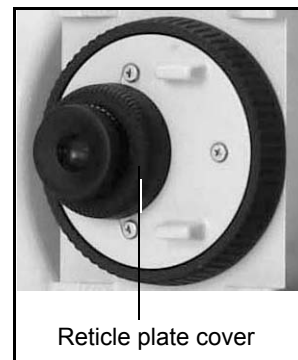

Preparation

In this chapter:


- Unpacking and Packing the Instrument
- Charging the Battery Pack
- Detaching and Re-Attaching the Battery Pack
- Using the CompactFlash (CF) Card
- Using the USB Memory Stick
- Setting Up the Tripod
- Centering Using the Optical Plummet
- Leveling
- Sighting
- Setting the Measurement Mode and Preparing the Target
- Preparing the Reflector Sheet
- Setting Up the Prism Reflector
- Carrying the Instrument Case
- Face-1/Face-2 Measurements

Unpacking and Packing the Instrument

Note – Handle the NPL-632 instrument gently to protect it from shocks and excessive vibration.

Unpacking

To unpack the instrument, grip the carrying handle and gently remove the instrument from the carrying case.

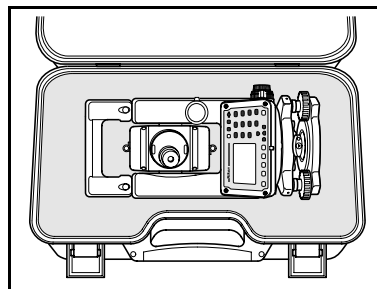


Packing

Note – Store the instrument with the battery pack attached.

To pack the instrument into the carrying case:

1. Set the telescope in the horizontal face-1 position.
2. Align the ● storage mark on the bottom of the face-1 keyboard with ▼ the mark on the tribrach clamp knob.
3. Lightly fasten the clamp knobs.
4. Place the instrument in the carrying case.

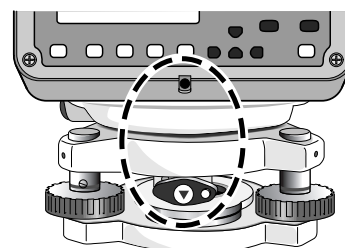

Charging the Battery Pack

Before charging the battery pack, read the warnings (also listed in the Safety section at the front of this manual) and the following notes.



WARNING – Use ONLY the battery charger that is attached to the instrument to charge the battery pack (P/N BC-80). Do NOT use any chargers other than the enclosed model. Using other chargers may cause the battery pack to catch fire or rupture. You cannot use the old Nikon chargers, models Q7U/E or Q-7C, to charge the BC-80 battery pack.



WARNING – Do not cover the battery charger while the battery pack is being recharged. The charger must be able to dissipate heat adequately. Coverings such as blankets or clothing can cause the charger to overheat.



WARNING – Avoid recharging the battery pack in humid or dusty places, in direct sunlight, or near heat sources. Do not recharge the battery pack when it is wet. If you do, you may receive electric shocks or burns, or the battery pack may overheat or catch fire.



WARNING – Although the battery pack (P/N BC-80) has an auto-reset circuit breaker, you should take care not to short circuit the contacts. Short circuits can cause the battery pack to catch fire or burn you.



WARNING – Never burn or heat the battery. Doing so may cause the battery to leak or rupture. A leaking or ruptured battery can cause serious injury.



WARNING – Before storing the battery pack or battery charger, cover the contact points with insulation tape. If you do not cover the contact points, the battery pack or charger may short circuit, causing fire, burns, or damage to the instrument.

Important notes


- Charge the battery pack indoors when the ambient temperature is between 10 °C and 40 °C (between 50 °F and 104 °F). If you try to charge the battery when the ambient temperature is outside this range, the protective circuit will activate and prevent it from being charged normally.
- After charging the battery pack, do not recharge it until it has been fully discharged. Recharging a fully charged battery pack lowers its performance.
- To prevent malfunction, keep the charging plug clean.
- If the charger indicator LED2 blinks orange and green after charging is started, there may be a problem in the battery pack. Do NOT use or charge the battery pack any further. Please contact your dealer.
- If the ambient temperature drops below 10 °C (50 °F) while the battery pack is charging, charging stops. When the ambient temperature rises above 10 °C (50 °F), charging resumes.
- If both the charger indicators LED1 and LED2 remain orange for more than three hours while the ambient temperature is in the normal range (10 °C through 40 °C or 50 °F through 104 °F), there may be a problem with the battery pack. Do NOT use or charge the battery pack any further. Please contact your dealer.
- During the charge, the battery pack and charger will become warm. This is normal.
- If the battery pack is used at temperatures below -20 °C (-4 °F), the battery capacity will be reduced and result in less operation time than if the battery pack is used at room temperature.
- If a battery pack is not used for a long period, it can never be charged to its full capacity again.

Charging the battery pack

1. Connect the power plug on the charger to an AC power outlet.
2. Connect the charging plug on the charger cable to the charging connector on the battery pack.

Both indicators LED1 and LED2 on the charger light up orange and charging starts automatically.

When the battery pack is fully charged, LED2 changes to green.

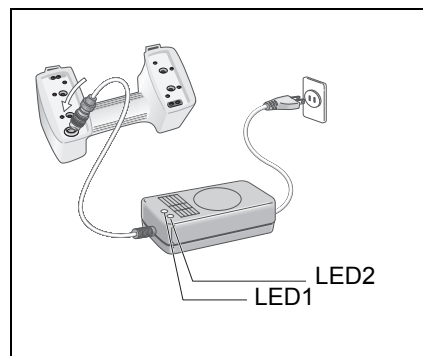


Detaching and Re-Attaching the Battery Pack

Detaching the BC-80 battery pack



CAUTION – Avoid touching the contacts on the battery pack.

1. If the instrument is turned on, press **[PWR]** to turn it off.
2. Set the battery mounting buttons in the horizontal (UNLOCK) position. To do this, turn each button inward.
3. While pressing both battery mounting buttons, lift the battery pack off the main body of the instrument.

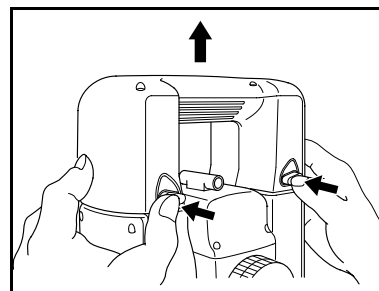


Attaching the BC-80 battery pack




CAUTION – Before you pick up the instrument by the carrying handle, make sure that the battery pack is clamped securely in place, and that the battery mounting buttons are set in the vertical (LOCK) position. If the battery pack is not securely fastened, the main unit may come loose or fall off when you lift the instrument, causing personal injury or instrument damage.

1. Make sure that the battery mounting buttons are in the horizontal (UNLOCK) position.
2. Align the ● mark on the right battery mounting button with the ● mark on the main body of the instrument.
3. While pressing the battery mounting buttons, lower the battery pack onto the connecting pins on the top of the instrument.
4. When the battery pack is in position, release the battery mounting buttons.

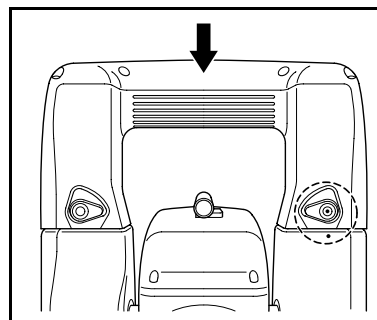

5. Set the battery mounting buttons in the vertical (LOCK) position to lock the battery pack into place. To do this, turn the mounting buttons outward.

When the battery pack is correctly mounted and locked, there is a slight gap between the battery pack and the main body of the instrument. This is a normal part of the instrument's design.

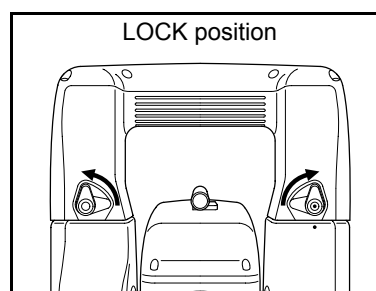

Note – An external battery is available as an optional accessory for the NPL-632 instrument. When the external battery is connected and the BC-80 battery pack is mounted on the instrument, the instrument automatically uses the power source that has the most available power.

Using the CompactFlash (CF) Card

Note – CompactFlash is a trademark of SanDisk Corporation.



CAUTION – To ensure that the instrument and card remains waterproof and dust-proof, close the cover and lock it firmly.



CAUTION – Before you open the card slot cover, wipe off all moisture. If you open the cap or cover while they are wet, it may result in malfunction.



CAUTION – While the system is writing data to the CF card or deleting data in the CF card, **do not** carry out the following actions as this may result in data corruption or card malfunction:

- Remove the CF card
- Remove the battery pack
- Turn off the instrument



CAUTION – Before removing the CF card from the instrument, turn off the instrument. If you remove the card while the instrument is ON, it might result in card malfunction.



CAUTION – Nikon recommends that you use the authorized CF card (P/N HXA20657). Although it may be possible to use other CF cards, the performance and reliability are unknown and cannot be guaranteed.

Inserting a CF card into the card slot


1. To open the card slot cover, rotate the knob clockwise by 90 degrees so that the protrusion on the knob is set to the OPEN position.

Note – Do NOT rotate the knob on the slot cover beyond the limit as this may damage the knob.



2. Place the CF card with its blank side facing outward, and with the connector-side facing down, and then insert the card into the slot.

Note – Make sure that you place the card correctly in relation to the slot before you push the card into the slot. If the card is not placed correctly and you then push it too hard in the wrong direction it may malfunction.

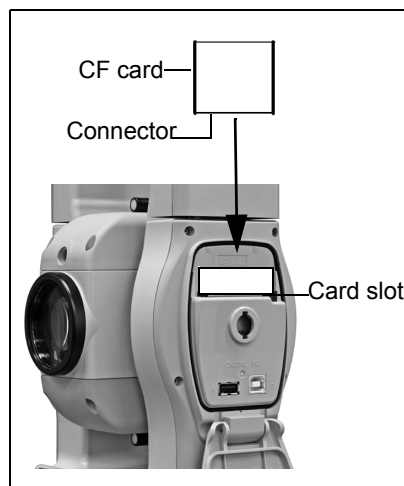

3. Make sure that the protrusion on the knob is set to the OPEN (vertical) position and then close the cover.






CAUTION – If you force the cover closed when the protrusion on the knob cover is set to the LOCK (horizontal) position, you may damage the cover.

4. Rotate the knob counter-clockwise until the protrusion on the knob is set to the LOCK position.

Note – To ensure that the cover is firmly locked, the cover remains slightly open if you do not rotate the knob correctly so that the protrusion points to the LOCK position. Make sure that the cover is firmly closed.

Removing a CF card from the card slot

1. Open the card slot cover by rotating the knob clockwise until the protrusion on the knob is set to the OPEN position.
2. To remove the CF card, press the eject button.

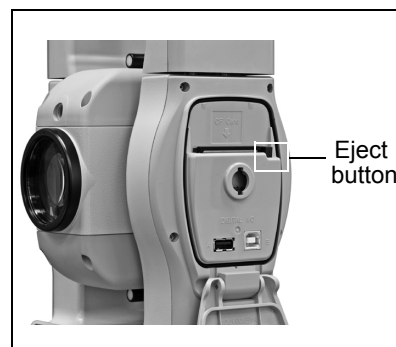

Using the USB Memory Stick



CAUTION – Before you open the card slot cover, wipe off all moisture. If you open the cap or cover while they are wet, it may result in malfunction.



CAUTION – Nikon recommends that you format the USB memory stick on your office computer before you use it for the first time.



CAUTION – While the system is writing data to the USB memory or deleting data in the USB memory, do NOT carry out the following actions as this may result in data corruption or card malfunction:

- Remove the USB memory stick
- Remove the battery pack
- Turn off the instrument



CAUTION – Before removing the USB memory stick from the instrument, turn off the instrument. If you remove the USB memory while the instrument is ON, it may result in memory malfunction.



CAUTION – **Do not** place too much stress on the USB memory stick.



CAUTION – **Do not** bend, drop or shock the USB memory stick.



CAUTION – When you use or store the USB memory stick, avoid heat, moisture, and direct sunlight.



CAUTION – Do not attempt to close the card slot cover with a USB memory stick still in the instrument.

Inserting the USB memory stick into the connector slot

1. Open the card slot cover. See [Inserting a CF card into the card slot, page 12, Step 1](#).

***Note** – Do NOT rotate the knob on the slot cover beyond the limit as this may damage the knob.*

2. Check the shape of the USB connector and insert it correctly into the instrument. See [USB Connectors, page 160](#).

***Note** – Carefully support the instrument when you insert/remove the USB memory stick to/from the instrument.*

3. Make sure that the protrusion on the knob is set to the OPEN (vertical) position and then close the cover.



CAUTION – If you force the cover closed with the protrusion on the knob cover set to the LOCK (horizontal) position, you may damage the cover.

4. Rotate the knob counter-clockwise until the protrusion on the knob is set to the LOCK position.

***Note** – To ensure that the cover is firmly locked, the cover remains slightly open if you do not rotate the knob correctly so that the protrusion points to the LOCK position. Make sure that the cover is firmly closed.*

Transferring files from the instrument to an office computer using USB

If you have installed Microsoft® ActiveSync® technology on your office computer, you can use the Microsoft Windows® Explorer to:

- Export files from your office computer to the instrument.
- Import recorded job files from the instrument to your office computer.

To connect the USB memory stick to the office computer using the connecting cable:

1. Insert the large connector of the connecting cable into the correct slot on your computer.
2. Open the slot cover of the instrument. See [Inserting a CF card into the card slot, page 12, Step 1](#).
3. Insert the smaller connector of the connecting cable into the USB-B connector slot on the instrument. See [USB Connectors, page 160](#).

On your office computer, you can now browse to the Mobile Device from where you can view, copy, or move job files between the office computer and the instrument.

Note – Before you can use the ActiveSync technology, you need to install the USB driver software. Download the driver software from the Drivers folder on the CD-ROM provided with the instrument.

Setting Up the Tripod



CAUTION – The tips of the tripod ferrules are very sharp. When handling or carrying the tripod, take care to avoid injuring yourself on the ferrules.

Note – Do not carry the instrument while it is attached to a tripod.

1. Open the tripod legs enough to for the instrument to be stable.
2. Locate the tripod directly over the station point. To check the tripod's position, look through the center hole in the tripod head.
3. Firmly press the tripod ferrules into the ground.
4. Level the top surface of the tripod head.

Note – If you want to use the plumb bob to center the instrument (see [Centering Using the Optical Plummet, page 15](#)), you must level the tripod head precisely.

5. Securely fasten the thumb screws on the tripod legs.
6. Place the instrument on the tripod head.
7. Insert the tripod mounting screw into the center hole of the base plate of the instrument.
8. Tighten the tripod mounting screw.


Centering Using the Optical Plummet

When you center the instrument, you align its central axis precisely over the station point.

Note – If you require high accuracy, check and adjust the optical plummet before you center the instrument. For detailed instructions, see [Checking and Adjusting the Optical Plummet, page 147](#).

To center the instrument using the optical plummet:

1. Set up the instrument on the tripod. For detailed instructions, see [Setting Up the Tripod, page 15](#).
2. While looking through the optical plummet, align the reticle with the station point. To do this, turn the leveling screws until the center mark © of the reticle is directly over the image of the station point.
3. While supporting the tripod head with one hand, loosen the tripod leg clamps and adjust the lengths of the legs until the air bubble is in the center of the circular level.
4. Tighten the tripod leg clamps.
5. Use the plate level to level the instrument. For detailed instructions, see [Leveling, page 17](#).
6. Look through the optical plummet to check that the image of the station point is still in the center of the reticle mark.
7. If the station point is off center, do one of the following:
 - If the station point is slightly off center, loosen the tripod mounting screw and then center the instrument on the tripod. Use only direct movement to center the instrument. Do not rotate it.
 - When the instrument is centered, tighten the mounting screw.

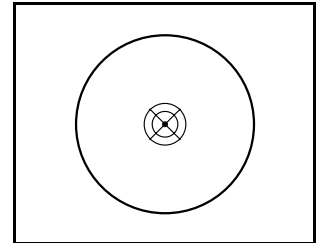


If the displacement of the station point is major, repeat this procedure from [Step 2](#).

Leveling


When you level the instrument, you make the vertical axis of the instrument exactly vertical. To level the instrument, use the plate level.

To level the instrument:

1. Loosen the upper plate clamp.
2. Rotate the alidade until the plate level is parallel with any two of the leveling screws (B and C).
3. Use leveling screws B and C to move the bubble into the center of the level.
4. Rotate the alidade approximately 90°.

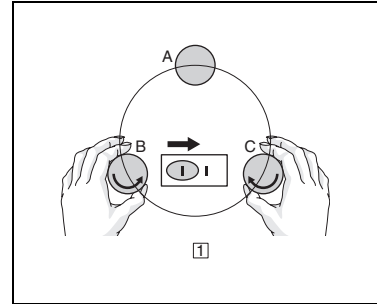

5. Use leveling screw A to move the bubble into the center of the level.
6. Repeat Step 1 through Step 5 to center the bubble in both positions.
7. Rotate the alidade 180°.
8. If the bubble in the plate level remains centered, the instrument is level. If the bubble moves off center, adjust the plate level. For detailed instructions, see [Checking and Adjusting the Plate Level, page 146](#).

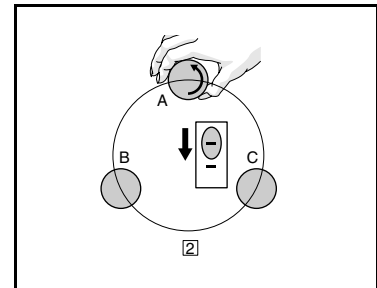


Sighting

When you sight the instrument, you aim the telescope at the target, bring the target image into focus, and align the image with the center crosshairs of the reticle.


To sight the instrument:

1. Adjust the diopter:
 - a. Aim the telescope at a blank area, such as the sky or a piece of paper.

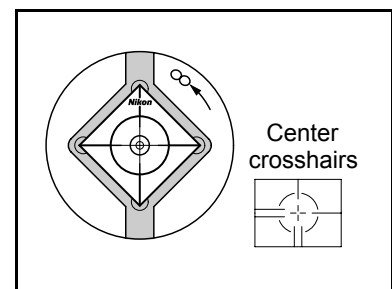

WARNING – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.


- b. Looking through the eyepiece, rotate the diopter ring until the reticle crosshairs are in sharp focus.
 2. Eliminate parallax:
 - a. Aim the telescope at the target image.
 - b. Rotate the focusing ring until the target image is in sharp focus on the reticle crosshairs.
 - c. Move your eye vertically and laterally to check whether the target image moves relative to the reticle crosshairs.
3. Rotate the tangent screw:
 - The final turn of the tangent screw should be in a **clockwise** direction, to align the target accurately on the center crosshairs.

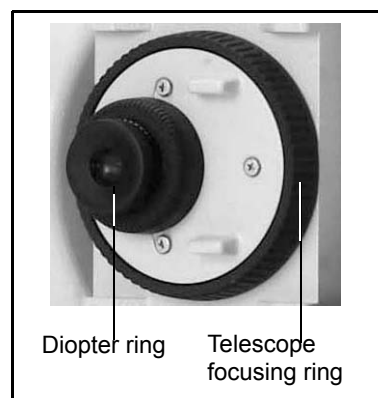

If the target image does not move, there is no parallax.

Setting the Measurement Mode and Preparing the Target

The NPL-632 instrument has two measurement modes: Prism mode (Prism) and Reflectorless mode (N-Prism). These modes can be changed at any time by holding down the **[MSR1]** or **[MSR2]** key for one second. For more information, see, [page 53](#).

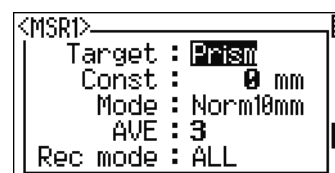

The following table describes how to set the measurement mode depending on the target you want to measure.

Target	Target setting
Prism, reflector sheet	Prism (Prism mode)
Other (reflective materials)	N-Prism (Reflectorless mode)


In some cases, you can measure another target that is not appropriate to the set measurement mode.

Measurement with a prism


As the NPL-632 is extremely sensitive, multiple reflections on the prism surface can sometimes cause a significant loss in accuracy.

To maintain the accuracy of your measurements:

- **Do not** use a prism with scratches, a dirty surface, or a chipped center. Prisms with thin edges are recommended.

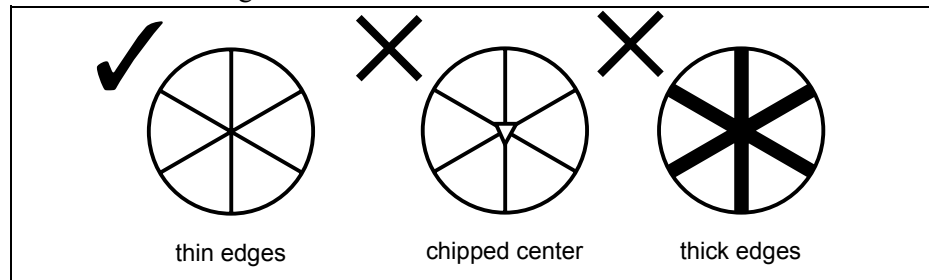

- When using a reflector sheet, take measurements longer than 5 meters.
- When using a mini or standard prism, take measurements longer than 10 meters.
- When measuring a short distance, incline the prism slightly so that the EDM can ignore unnecessary reflections on the prism surface, as shown below.

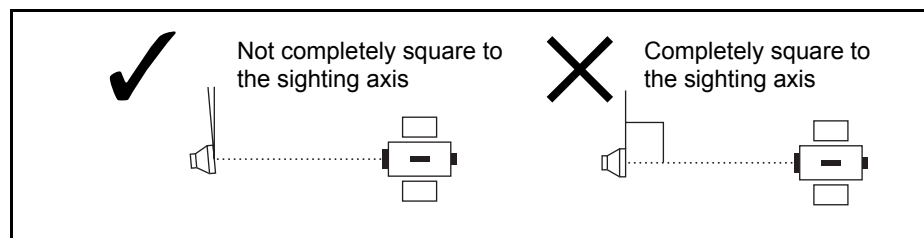

Hold the prism securely in place and do not move while taking measurements.

In Prism mode, in order to avoid false measurements on objects other than the prism or reflector-sheet, targets that are less reflective than the prism or reflector sheet are not measured. Even if you start a measurement, measured values are not displayed. To measure less reflective objects, use the N-prism (reflectorless) mode.

Measurement in Reflectorless mode

The intensity of the reflection from the target determines the distance the NPL-632 can measure in this mode. The color and condition of the target surface also affect the measurable distance, even if the targeted objects are the same. Some less-reflective targets may not be measured.

The following table describes some examples of targets and approximate measurable distances.

Target	You can measure approximately...
Traffic signs, reflectors	500 meters (1640 feet)
Paper (white), veneer (new)	210 meters (700 feet)
Wall (brightly painted), brick	50 to 100 meters (160 to 330 feet)


Measurable distances may be shorter or measurement intervals may be longer in the following cases:

- the angle of the laser against the target is small
- the surface of the target is wet

In direct sunlight, the measurable distance may be shorter. In this case, try to throw a shadow on the target.


Targets with completely flat surfaces, such as mirrors, cannot be measured unless the beam and the target are perpendicular to each other.

Sighting a prism in Reflectorless mode may cause an excessive signal error. In this case, change the (MSR1) or (MSR2) key Target setting to Prism.

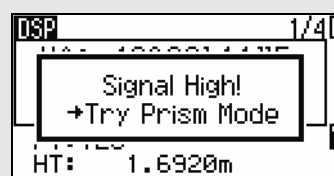

In the Reflectorless mode, the beam passing area is shown by a circle in crosshairs on the telescope reticle.

If the target is smaller than the circle and there is something highly reflective in the background, the measured data may be affected by these adverse conditions.

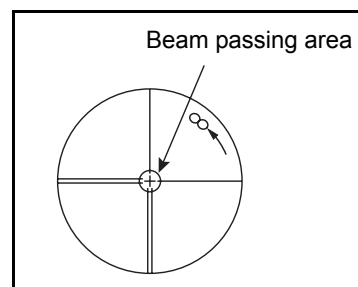

When an obstacle momentarily passes through the beam between the instrument and the target (for example, passing cars on the road), the false data (short distance) is deleted automatically. However, if the amount of reflection is almost the same and the difference in distances between the correct and the false data is less than two meters, it may cause an error in measurements.

Make sure there are no obstacles between the instrument and the target when taking measurements.

When you need to take measurements across a road or a place where vehicles or other objects are frequently moving, take several measurements to a target for the best result.

Preparing the Reflector Sheet

The reflector sheet can be used for measurements in Prism mode. Assemble the reflector sheet as shown in [Figure 2.1](#).

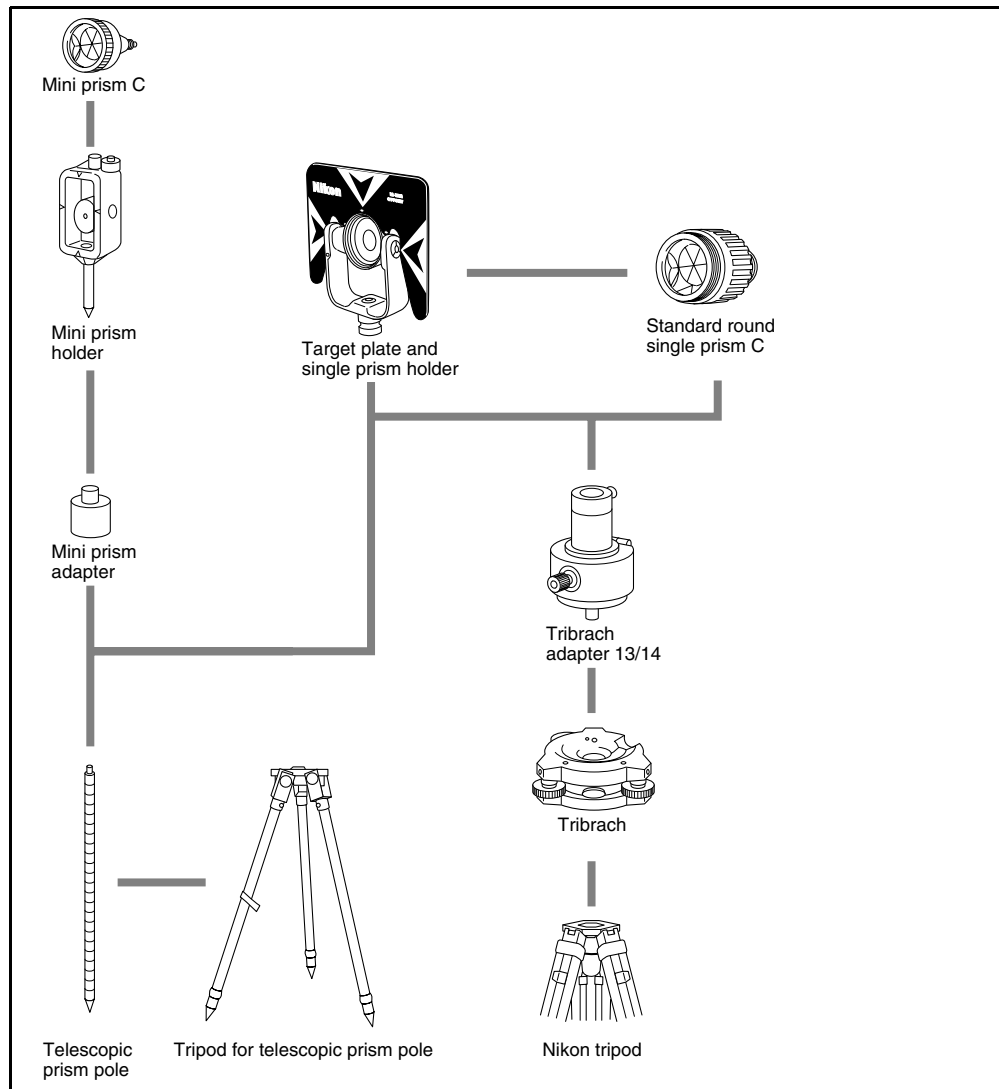


Figure 2.1 Reflector sheet assembly.

Setting Up the Prism Reflector

1. Assemble the prism reflector as shown in [Figure 2.2](#).

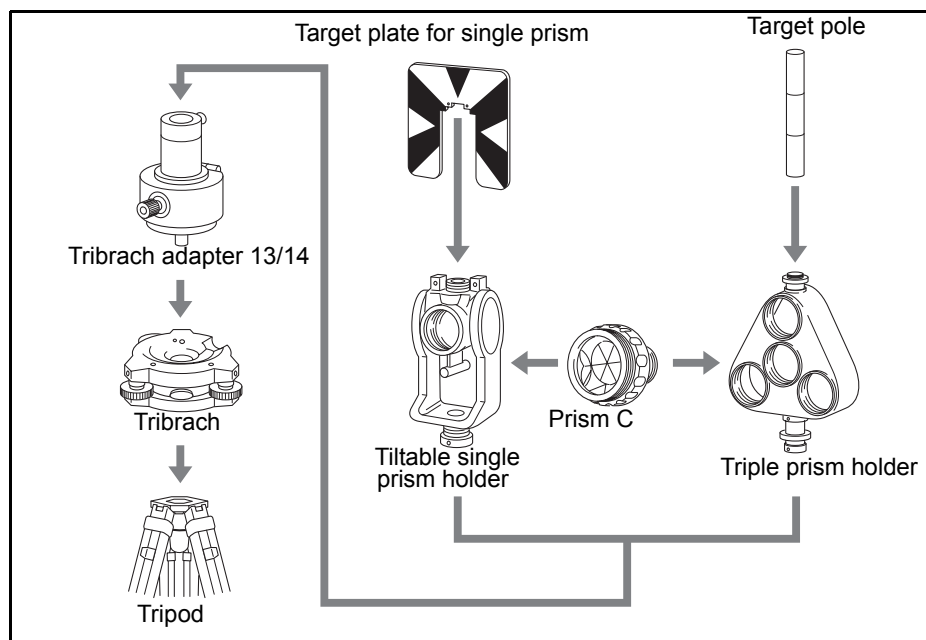


Figure 2.2 Assembling the prism reflector

2. Adjust the height of the tribrach adapter (see [page 22](#)).
3. If necessary, change the direction of the prism (see [page 23](#)).
4. Set the prism constant (see [page 23](#)).
5. If you are using a single prism holder, set the position of the target plate (see [page 24](#)).


Detailed instructions for [Step 2](#) through [Step 5](#) are provided on the following pages.

Adjusting the height of the tribrach adapter

The tribrach adapter has two height settings. To use the prism reflector with a NPL-632 instrument, use the lower height setting.

To adjust the height of the tribrach adapter:

1. Remove the height adjustment screw from the tribrach adapter.
2. Slide the tribrach adapter up or down the prism holder mount until the height adjustment screw holes on the prism holder mount and on the tribrach adapter are aligned.

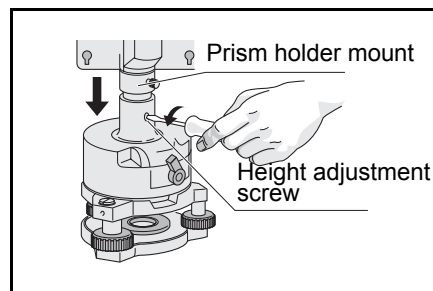


3. Replace and tighten the adjustment screw.

Changing the direction of the prism

The prism mounted on the tribrach adapter can be rotated to face in any direction.

To change the direction of the prism:

1. Release the rotation clamp. To do this, turn the clamp lever counterclockwise.
2. Turn the upper plate of the tribrach adapter until the prism is facing in the required direction.
3. Fasten the rotation clamp. To do this, turn the clamp lever clockwise.

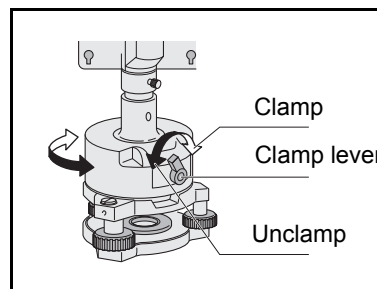

Setting the prism constant


1. Attach the prism to the single prism holder or triple prism holder.



Tip -To use a triple prism holder as a single prism holder, attach the prism to the center thread of the prism holder.

2. Set the prism constant. To do this, hold down **MSR1** or **MSR2** for one second. For more information, see [Measurement settings, page 53](#).

Note – The prism constant of a Nikon prism is always 0, whether it is attached to a single prism holder or a triple prism holder.

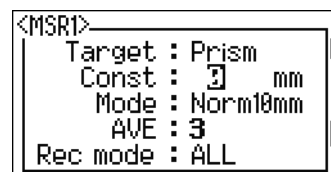

If your prism constant is not 0mm, then directly enter the prism constant value in the *Const* field. For example, if your prism constant is 30mm, enter 30mm in the *Const* field on the instrument.

Setting the position of the target plate




Tip – When using a prism at a short distance, set the prism at a slight angle to the sighting axis rather than completely square.

If using a single prism, make sure that the target plate is aligned with the tribrach adapter and the prism.

To set the position of the target plate:

1. Use the two set screws supplied to attach the target plate to the single prism holder.
2. Move the target plate within the screw holes until the apex of the wedge pattern is aligned with the vertical axis of the prism and the tribrach adapter.

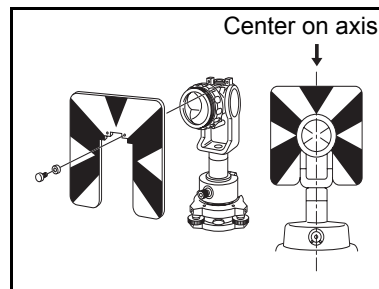

Carrying the Instrument Case

Two belts are provided to assist you in carrying the instrument in its case safely and comfortably:

- To carry the case over your shoulder, attach one belt to the case on the side of handle.
- To carry the case as a backpack, attach two belts to the case on the side that displays the Nikon sticker side.

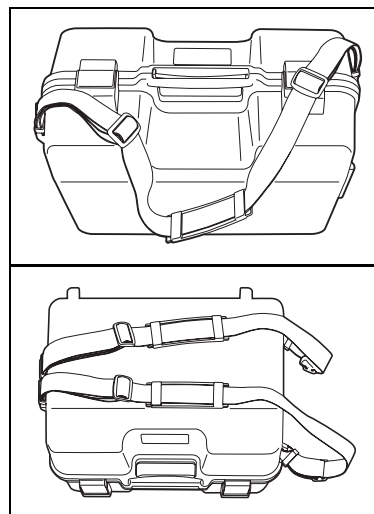


Figure 2.3 on page 25 shows how to attach the belt to the instrument correctly.

To ensure that the edge of the belt is enclosed properly:

1. Set up the belt and parts attached to the belt for use as either a shoulderstrap or backpack straps, as described on [page 24](#).
2. Take the edge of the belt and insert it through the parts, in the order shown below.

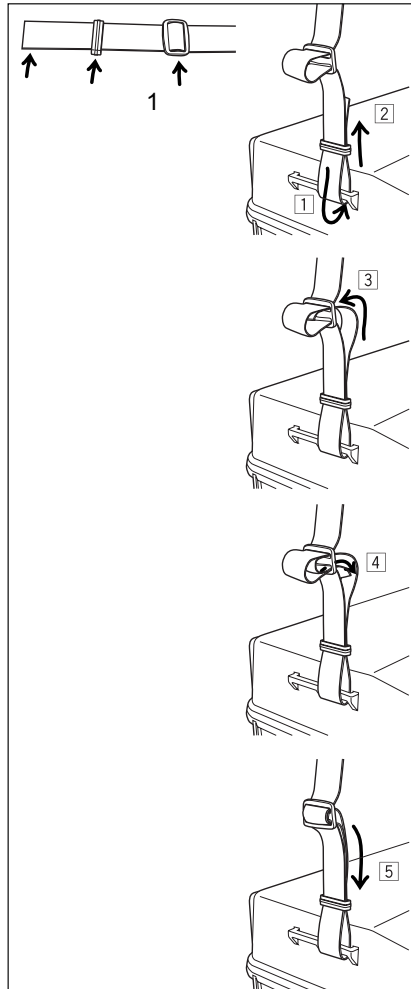


Figure 2.3 Attaching the belt to the instrument case

Face-1/Face-2 Measurements


You can take a measurement from either face of the instrument. To change the face, rotate the instrument 180° on its base, and rotate the telescope 180° within the standard.

By averaging the Face-1 and Face-2 measurement values, you can cancel out most constant mechanical errors. Some errors, such as vertical axis error, cannot be cancelled out by averaging Face-1 and Face-2 measurements.



CAUTION – When rotating the telescope, take care not to catch your finger in the gap between the instrument's standard and the telescope.

A Face-1 measurement is made with the vertical circle positioned to the left of the telescope eyepiece. A Face-2 measurement is made with the vertical circle positioned to the right of the telescope eyepiece.

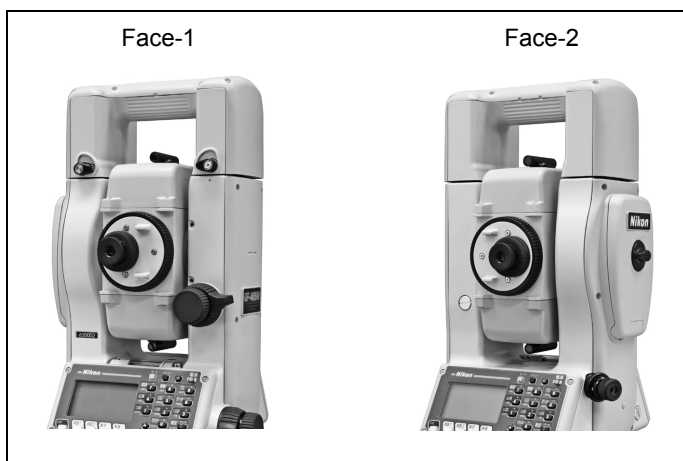

Getting Started

In this chapter:

- [Turning the Instrument On and Off](#)
- [Selecting a Language](#)
- [Changing Regional Configuration Pre-sets](#)
- [Display and Key Functions](#)
- [List Display](#)
- [Inputting Data](#)
- [Jobs](#)
- [Measuring Distances](#)

Turning the Instrument On and Off

Turning on the instrument

1. To turn on the instrument, press **[PWR]**. The start-up screen appears. It shows the current temperature, pressure, date, and time.
2. To change the temperature or pressure value, use **[^]** or **[v]** to move the cursor to the field that you want to change. Then press **[ENT]**.
3. If you want to initialize the horizontal angle, rotate the alidade.
4. Tilt the telescope until it passes the horizontal position on Face-1.

```

TILT TELESCOPE
>Temp 20°C
Press 1013hPa
2001/10/21 13:54:18
  
```

```

TILT TELESCOPE
>Temp 20°C
Press 1013hPa
2001/10/21 13:54:18
  
```

```

HA INITIALIZED
>Temp 20°C
Press 1013hPa
2001/10/21 13:54:18
  
```

If you have entered your name or your company's name in the Owner's detail field, the text from this field appears on the start-up screen. To set the Owner's detail field, go to **MENU > Settings > Other**. For more information, see [page 120](#).

```

NIKON-TRIMBLE CO.LTD
TILT TELESCOPE
>Temp 84°F
Press 29.9 inHg
2003/08/27 11:20:55
  
```

Once you start to use an initialized HA, you must rotate the alidade to initialize the HA every time you turn on the instrument. If you do this, you can maintain a fixed HA orientation even if the instrument has moved while it is turned off.

If you tilt the telescope before you rotate the alidade, the horizontal angle is not initialized, and the instrument uses the previous HA reading.

Turning off the instrument

To turn the instrument off, press **[PWR]** and **[ENT]**.

```

Press ENT -> OFF
Reset Sleep
  
```

Then do one of the following:


Press ...	To ...
[ENT] again	turn off the instrument
the Reset softkey	reboot the program and re-start the instrument

Press ...	To ...
the Sleep softkey	put the instrument into power-saving mode
ESC	cancel the power-off process and return to the previous screen

If you press the **Reset** softkey, the software is rebooted and the Basic Measurement Screen (BMS) appears without an open job.

Sleep mode

If you press the **Sleep** softkey in the Press **ENT** → OFF screen, or enable the Power Save setting (see [Power saving, page 118](#)), the instrument goes into sleep mode.

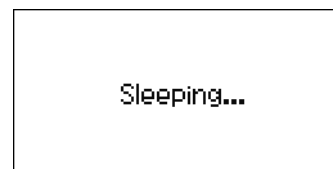

When the instrument is in sleep mode, it wakes up if any of the following occurs:

- You press a key
- The instrument receives a remote control command
- You rotate the alidade
- You tilt the telescope

Selecting a Language

The NPL-632 instrument also supports Chinese. To select a different language:

1. Turn on the instrument and press **ESC** and **3** at the Tilt Telescope screen.

The Select Language screen appears. The screen shows which languages are currently available on the instrument.

The current language selection is highlighted.

2. Press **▲** or **▼** to highlight the required language and then press **ENT**.

The instrument reboots and displays the start-up Tilt Telescope screen in the selected language.



Changing Regional Configuration Pre-sets

To provide easier configuration for common regional settings, you can quickly configure the Nikon total station to a pre-set combination of default regional settings. The Regional Configuration screen appears only after the language configuration is complete, the instrument has rebooted, and the telescope has been tilted. To change the regional configuration pre-sets:

1. Follow the steps in [Selecting a Language, page 29](#).

Once the instrument reboots and the telescope is tilted, the Regional Configuration screen appears.



2. Press **▲** or **▼** to highlight the required regional settings and then press **ENT**.
3. If you do not want to change the current settings, press **ESC** and quit. The instrument will continue to use the last configured settings that were configured.

The settings affected by the Regional Configuration screen are shown below:

Category	Setting	Europe	International	United States
Angle	VA zero	Zenith	Zenith	Zenith
	Resolution	1" (see note)	1" (see note)	1" (see note)
	HA corr.	On	On	On
	HA	Azimuth	Azimuth	Azimuth
Distance	Scale	1.000000	1.000000	1.000000
	T-P corr.	On	On	On
	Sea Level	Off	Off	Off
	C&R corr.	0.132	0.132	0.132
Coordinates	Order	ENZ	ENZ	NEZ
	Label	ENZ	ENZ	NEZ
	AZ zero	North	North	North
Power Save	Main Unit	Off	Off	Off
	EDM Unit	3 minutes	3 minutes	3 minutes
	Sleep	5 minutes	5 minutes	5 minutes
Communication	Ext. Comm	Nikon	Nikon	Nikon
	Baud	4800	4800	4800
	Length	8	8	8
	Parity	None	None	None
	Stop bit	1	1	1
Stakeout	Add PT	1000	1000	1000
	LG Dist	1.00 feet (0.30m)	1.00 feet (0.30m)	1.00 feet (0.30m)

Category	Setting	Europe	International	United States
Units	Angle	GON	DEG	DEG
	Distance	meters	meters	US-ft
	Temp	°C	°C	°F
	Press	mm Hg	mm Hg	In Hg
Rec	Store DB	RAW&XYZ	RAW&XYZ	RAW&XYZ
	Rec LG	On	On	On
	Data Rec	Internal	Internal	Internal
Others	XYZ disp	Fast	Fast	Fast
	2nd Unit	None	None	None
	Sig Beep	On	On	On
	Split ST	No	No	No
	CD Input	<ABC>	<ABC>	<ABC>
	Owner's Detail	Blank	Blank	Blank

The default regional configuration pre-set is “International” settings. For more information, see [Settings, page 115](#).

Display and Key Functions



The functions of the NPL-632 keys are described below.


Key	Function	Details
	Turns the instrument on or off.	page 28
	Illumination key. Turns the backlight on or off. Provides access to the 4-switch window if held down for one second.	page 35
	Displays the MENU screen.	page 97
	Changes the key input mode between alphanumeric and numeric if pressed when you are in a PT or CD field. Activates Qcode mode if pressed when you are In the Basic Measurement Screen (BMS).	page 37

Key	Function	Details
	Records measured data, moves on to the next screen, or confirms and accepts the entered data in input mode. You have the option to record the measurement as a CP record instead of an SS record, if you hold this key down for one second in the Basic Measurement Screen (BMS). The instrument outputs the current measurement data (PT, HA, VA, and SD) on the COM port if you press this key in the BMS or in a Stakeout observation screen. (The Data Rec settings must be set to COM.)	page 86
	Returns to the previous screen. In numeric or alphanumeric mode, deletes input.	
	Starts distance measurement, using the measure mode settings for the MSR1 key. Displays measurement mode settings, if held down for one second.	page 52
	Starts distance measurement, using the measure mode settings for the MSR2 key. Displays measurement mode settings, if held down for one second.	page 52
	Moves to the next available display screen. Changes the fields that appear on the DSP1, DSP2, and DSP3 screens, if held down for one second.	page 54
	Displays the Angle menu.	page 56
	Displays the Station Setup menu. In numeric mode, enters 7. In alphanumeric mode, enters A, B, C, or 7.	page 58
	Displays the Stakeout menu. Shows stakeout settings, if held down for one second. In numeric mode, enters 8. In alphanumeric mode, enters D, E, F, or 8.	page 69
	Displays the Offset Point Measurement menu. In numeric mode, enters 9. In alphanumeric mode, enters G, H, I, or 9.	page 88
	Displays the Programs menu, which contains additional measuring programs. In numeric mode, enters 4. In alphanumeric mode, enters J, K, L, or 4.	page 76
	Turns the Lumi-guide on or off. In numeric mode, enters 5. In alphanumeric mode, enters M, N, O, or 5.	page 42
	Displays RAW, XYZ, or STN data, depending on your setting. In numeric mode, enters 6. In alphanumeric mode, enters P, Q, R, or 6.	page 43

Key	Function	Details
	Executes the function that is assigned to the USR1 key. In numeric mode, enters 1. In alphanumeric mode, enters S, T, U, or 1.	page 42
	Executes the function that is assigned to the USR2 key. In numeric mode, enters 2. In alphanumeric mode, enters V, W, X, or 2.	
	Opens a window where you can enter a code. The default code value is the last code entered. In numeric mode, enters 3. In alphanumeric mode, enters Y, Z, a space, or 3.	page 38
	Displays the (HOT) menu, which includes Height of Target, Temp-Press, Target, Note recording, and Default PT settings. In numeric mode, enters – (minus). In alphanumeric mode, enters (period), – (minus), or + (plus).	page 39
	Displays the Bubble indicator. In numeric mode, enters 0. In alphanumeric mode, enters *, /, =, or 0.	page 41

Status bar

The status bar appears on the right side of every screen. It contains icons that indicate the status of various system functions.

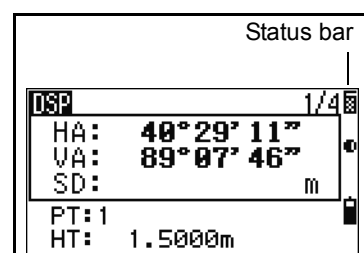

Signal indicator

The signal indicator shows the reflected light intensity:

-  Level 4 (maximum)
-  Level 3
-  Level 2
-  Level 1 (minimum)
-  If this icon is blinking, the signal is flickering.
-  If this icon is blinking rapidly, the signal is low.
-  If this icon is blinking slowly, there is no signal.
-  If there is no icon, analog power for EDM is off.

Input mode indicator

The Input mode indicator only appears when you are entering points or coordinates. It shows the data input mode:

-  Input mode is numeric. Press a key on the number pad to enter the number printed on the key.
-  Input mode is alphabetic. Press a key on the number pad to enter the first letter printed beside the key. Press the key repeatedly to cycle through all the letters assigned to that key.
For example, to enter the letter O in alphabetic mode, press  three times.

Lumi-guide indicator

The Lumi-guide indicator shows the status of the Lumi-guide tracking light.

-  Lumi-guide tracking light is on.
If there is no icon, the Lumi-guide tracking light is turned off.

EDM measurement status

When you are taking measurements, the EDM measurement status shows the mode that is being used.

When you display observation data, the EDM measurement status shows the mode that was used when the data was collected.


-  Reflectorless mode
If there is no icon, Prism mode is being used.

Battery indicator

The battery indicator shows the battery voltage level:

-  Level 4 (Full)
-  Level 3
-  Level 2
-  Level 1
-  Battery low

If the battery level is critically low, the following message appears:

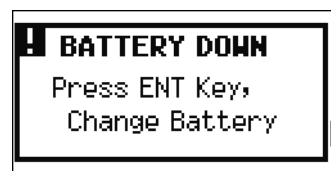

Adjusting lighting and sound levels

LCD backlight

To turn the LCD backlight on or off, press the illumination key . To adjust the backlight level, use the 4-switch window described below.


4-switch window

Use the 4-switch window to adjust lighting and sound settings for the instrument.

To open the 4-switch window from any screen, hold down the Illumination key for one second.

To cycle through the settings for a switch, press the number beside that switch. For example, to turn the backlight on or off, press **1**.

Alternatively, to highlight the switch that you want to set, press **▲** or **▼**. Then press **ENT** to cycle through the settings for that switch. For example, to adjust the reticle light brightness, press **▲** or **▼** repeatedly until the reticle light switch is highlighted. Then press **ENT** repeatedly until the required brightness level is reached.

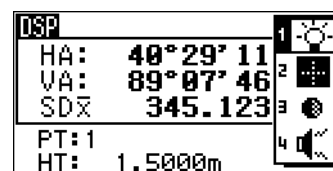

Switch 1 (backlight)



LCD backlight is on.



LCD backlight is off.

Switch 2 (reticle light)



Reticle light is on the maximum setting.



Reticle light is on the medium setting.



Reticle light is on the minimum setting.



Reticle light is off.

Switch 3 (Lumi-guide)



Lumi-guide tracking light is on.



Lumi-guide tracking light is off.

Switch 4 (Sound)


Sound is on.



Sound is off.

Contrast adjustment window

When the 4-switch window is open, press $\leftarrow$ or $\rightarrow$ to display the contrast adjustment window. Then press $\uparrow$ or $\downarrow$ to change the contrast level. The arrow indicates the current contrast level. To return to the 4-switch window, press $\leftarrow$ or $\rightarrow$.

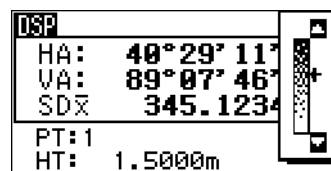


When you have finished changing display light and sound settings, press **[ESC]** to close the 4-switch or contrast adjustment window.

****[DSP]** key**


Use the key to change the current display screen or to change display settings.

Switching between display screens


When several display screens are available, the **DSP** indicator appears at the top left of the screen, and the screen indicator (for example, 1/4) appears at the top right.

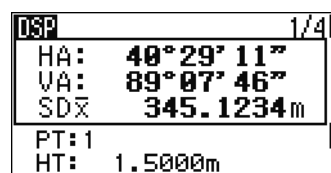

To move to the next available screen, press **[DSP]**.

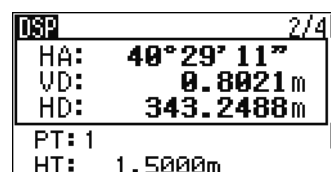


For example, if the DSP2 screen is currently displayed, press **[DSP]** to move to the DSP3 screen. The screen indicator changes from 2/4 to 3/4.

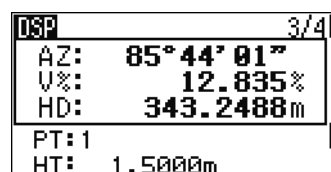

When the secondary distance unit is set, an additional screen is available. It shows the HD, VD, and SD values. For information on setting the secondary distance unit, see [page 120](#).

The smallest unit of display for distances measured in feet-and-inches is 1/16 in. Smaller units are impractical in the field. When the actual value is greater than 9999'11"15/16, the ">" symbol is shown. If the actual distance is less than -9999'11"15/16, the "▶" (solid triangle) symbol is shown. This does not affect calculations. The precise value is used internally in all cases.

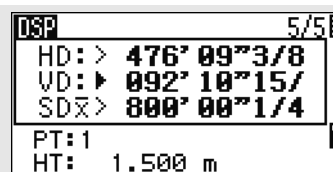


Customizing items in the Basic Measurement Screen (BMS)

To customize the items that are displayed on the DSP1, DSP2, and DSP3 screens:

1. Hold down **[DSP]** for one second.
2. Use the arrow keys **[↑]**, **[↓]**, **[←]**, and **[→]** to highlight the item that you want to change.
3. Use the **[↵]** and **[⇐]** softkeys to scroll through the list of items that can be displayed for this item.

The items that you can choose from are HA, AZ, HL, VA, V%, SD, VD, HD, Z, and (none).

4. To save your changes, press the **Save** softkey. Alternatively, highlight the last item for DSP3 and press **[ENT]**. The DSP screens show the items you have selected.

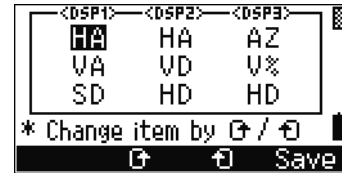


Except for the (none) item, you cannot display the same item on more than one line of the same screen. The items displayed in the DSP1, DSP2, DSP3, and DSP4 screens are also used in the corresponding Stakeout screens (SO2, SO3, SO4, and SO5).

You can also customize the displayed items in Stakeout.

Header characters

The following header characters can be used in DSP screens:

- A colon (:) indicates that tilt correction is applied to the value.
- A hash symbol (#) indicates that tilt correction is off.
- An underscore (_) under the tilt correction character indicates that Sea Level Correction or Scale factor is applied.

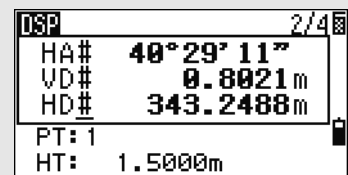



[MODE] key

Use the **[MODE]** key to change the keyboard mode for the current screen.

Changing input mode while entering points or codes

When the cursor is in a point (PT) or code (CD) field, press **[MODE]** to change the input mode between alphanumeric (A) and numeric (1).


The input mode indicator in the status bar changes to show the current input mode.

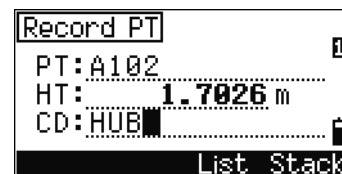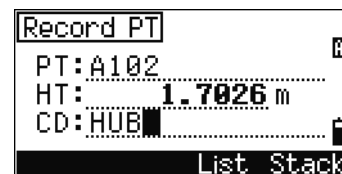

When the cursor is in a height (HT) field, only numeric input mode is available. Pressing **[MODE]** has no effect when the cursor is in a HT field.

Quick code measurement mode

1. To activate Quick code measurement mode, press **[MODE]** in the BMS.

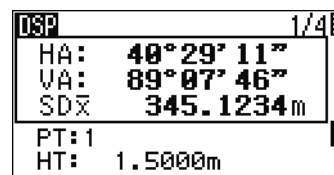


The PT field shows the default point name.

2. Press any numeric key (**[0]** through **[9]**) to start measuring and recording points.

A list of the numeric keys and their assigned feature codes appears on the right side of the screen.



For example, when you press **[6]**, the code assigned to 6 is selected, and the instrument starts a measurement.

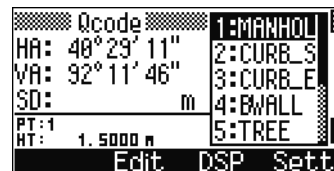

3. If you have set the record mode to Confirm (see [Measurement settings, page 53](#)), the Record PT screen appears after each measurement.

Do one of the following:

- To record the point, press **[ENT]**.
- To return to the BMS, press **[ESC]**.

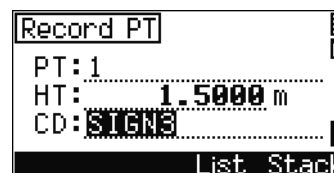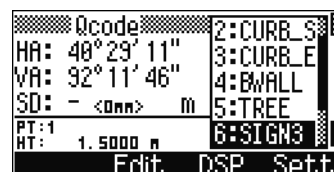

To assign a new feature code to a numeric key, press **[^]** or **[v]** to highlight the code that you want to change. Then press the **Edit** softkey.

You can use the **DSP** softkey to change the values shown in the measurement box, in the same way as you use the **[DSP]** key in the Basic Measurement Screen (BMS).

4. To return to the BMS from the Qcode screen, press **[MODE]** or **[ESC]**.


[COD] key

In the BMS, press **[COD]** to change the default feature code that will appear in the CD field when you record a point.

Setting the default code

When you press **[COD]** in the BMS, a window for entering the feature code appears.

You can use the **List** and **Stack** softkeys to enter the code.


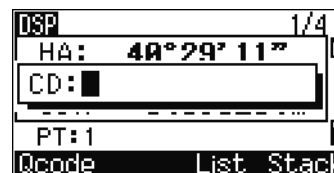


Qcode observations

To enter the Quick code observation routine, press the **Qcode** softkey.

In this function, you can use the ten numeric keys to both select a feature code and shoot a point.

To change the measurement mode for the Quick code observation, press the **Sett** softkey.

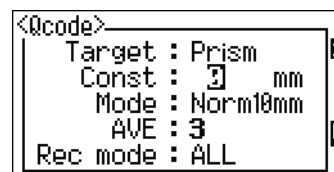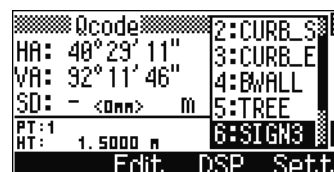

In Quick code measurement, the Rec mode can only be set to Confirm or ALL.

HOT key


The HOT key menu is available on any observation screen. To display the HOT key menu, press **HOT**.



Changing the height of the target


To change the height of the target, press **HOT** to display the HOT menu. Then either press **1** or select HT and press **ENT**.

Enter the height of the target, or press the **Stack** softkey to display the HT stack. The HT stack stores the last 20 HT values entered.

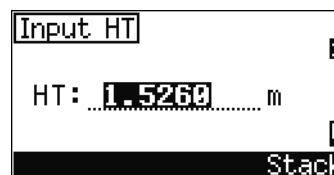

Setting the temperature and pressure

To set the current temperature and pressure, press **HOT** to display the HOT menu. Then either press **2** or select Temp-Press and press **ENT**. Enter the ambient temperature and pressure. The ppm value is updated automatically.

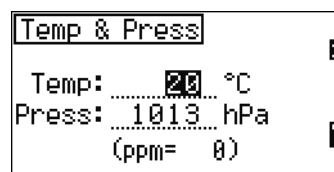

Selecting the target set

A target set specifies settings for the target type, the prism constant, and height of target. When you change the selected target set, all three settings are changed. You can use this function to quickly switch between two types of target. You can prepare up to five target sets.

1. Prism	0	-
2. N-Pri	0	-
3. Prism	30	4.2081
4. Prism	-18	1.2503
5. N-Pri	0	1.0100
Edit		Set

Press **[HOT]** to display the HOT menu. Then either press **[3]**, or select **Target** and press **[ENT]**. A list of the five target sets appears. To select a target set, either press the corresponding numeric key (**[1]** through **[5]**), or use **[^]** or **[v]** to highlight the target set in the list and press **[ENT]**.

To change the settings defined in a target set, highlight the target set in the list. Then press the **Edit** softkey.

Type	Prism / N-Prism
Const	-999 to 999 mm
HT	-9.9900 to 99.9900 m

<TGT1>

Type: Prism

Const: 0 mm

HT:m

HT can be left blank in the target set. If you leave it blank, the current HT value is always applied to the measurement.

When a target set is selected, the Type and Const values are copied to both **[MSR1]** and **[MSR2]** settings, and to the measurements in Qcode. If you have specified a value for HT, this value is also copied to the current HT.

Entering a field note

To enter a field note, press **[HOT]** to display the HOT menu. Then either press **[4]**, or select **Note** and press **[ENT]**.

This function can be used at any time on any observation screen.

Each note can be up to 50 characters.

The note is stored as a CO record in the raw data.

To display a list of previously used notes, press the **Stack** softkey. The stack stores the last 20 notes.

Use **[^]** or **[v]** to highlight a note in the list. Then press **[ENT]** to select the note.

Input Note

FINISHED.....

Stack

Input Note

FINISHED.....

Stack

IN TOLERANCE

OUT OF TOLERANCE

GO NEXT SITE

CONTINUE TOMORROW



Setting the default point name

To change the default point name, press **[HOT]** to display the HOT menu. Then press **[5]**, or select **Default PT** and press **[ENT]**.

This function is available from any observation screen.

Modify the default point name for the next record.

Press **[ENT]** to confirm the new default point name. The new point name is appears as the default PT name on the input screen.

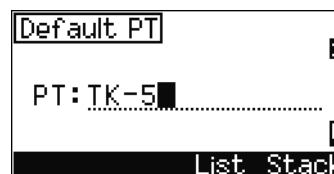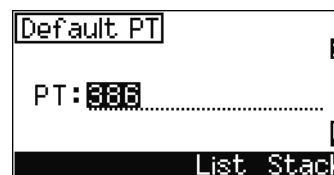


Bubble indicator

The bubble indicator is automatically displayed if the instrument goes out of level while the compensators are turned on.


To display the bubble indicator in an observation screen, press **[Envelope]**.

To turn the leveling compensators on or off, press **[<]** or **[>]**. When the leveling compensators are turned off, the text **OFF** appears on the screen.

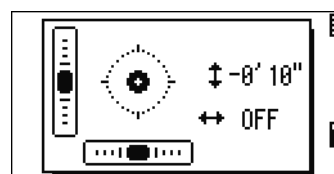

If the instrument is more than $\pm 3'30''$ out of level, the text **OVER** appears on the screen.

To return to the observation screen, press **[ESC]** or **[ENT]**.

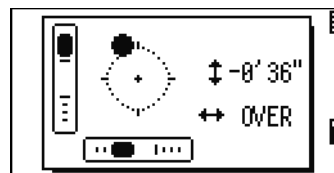


The current setting of leveling compensators is indicated by header characters (:, #, $\pm$, and $\#$) after field labels (such as HA, VA, SD, and HD) in observation screens. For more information, see [Header characters, page 37](#).

[LG] key

To turn the Lumi-guide tracking light on or off, press [LG] in the Basic Measurement Screen (BMS) or in any other measurement screen.

The Lumi-guide icon in the status bar shows whether the Lumi-guide tracking light is turned on or off. For more information, see [Status bar, page 33](#).

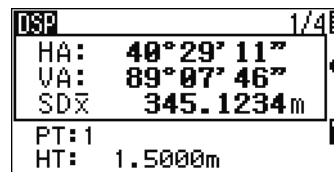**[USR] keys**

If you use a function frequently in the field, you can assign it to the [USR1] or [USR2] key. Whenever you press a [USR] key, the function that is assigned to that key is activated directly.

The following functions can be assigned to the [USR] keys:



- Input HT
- BS Check
- Base XYZ
- Default PT
- Select Target
- Input Temp-Press
- Input Note
- The following menus, or a single function from one of these menus:
 - Cogo
 - O/S
 - PRG

By default, Input HT is assigned to [USR1], and no function is assigned to [USR2].

Hold down the [USR] key for one second to display the list of functions that can be assigned to the key. The currently assigned function is indicated by an asterisk (*) beside the function name.

To change the function that assigned to the key, press [▲] or [▼] to highlight the function. Then press [ENT].



If an item on the list has an arrow (→) beside it, this item is a menu. If you highlight a menu item and then press [ENT], a sub-menu appears.

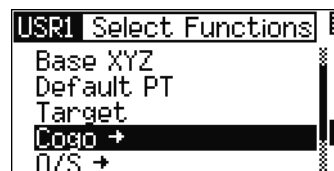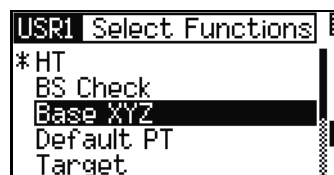


The first item on the sub-menu ends with the text [MENU]. If you select this item, the whole menu is assigned to the [USR] key.

To assign a specific function from the sub-menu, press $\uparrow$ or $\downarrow$ to highlight the function. Then press [ENT].

Once you have assigned a function to a [USR] key, it is called directly whenever you press that [USR] key in the BMS.

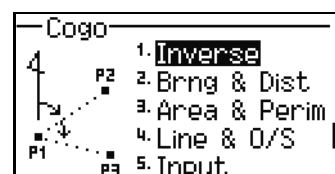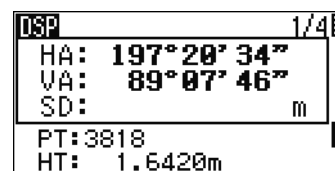

To change the type of data that is assigned to the [USR] keys in MENU > 1sec-Keys > [USR]. For more information, see [\[USR\] key settings](#), page 139.

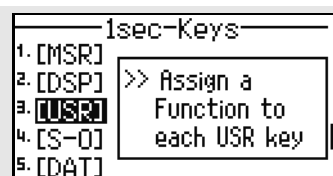


[DAT] key

Use the [DAT] key to quickly access data in the current job from observation screens.

When you press [DAT] in the BMS or in observation screens in functions such as Stakeout, 2Pt RefLine, and Arc RefLine, the assigned data in the current job appears.



Hold down [DAT] for one second in the BMS or an observation screen to display the Select Format screen. Use this screen to change the type of data that is assigned to [DAT]. Press $\uparrow$ or select DAT [MENU] to display the Data menu whenever you press [DAT].

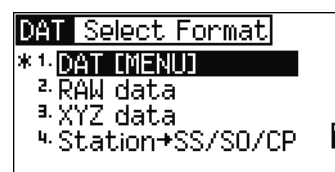

When you select an option from this screen, the change is applied immediately, and the selected data type appears.



Press [ESC] to return to the previous observation screen.

To change the type of data that is assigned to [DAT], go to MENU > 1sec-Keys > [DAT]. For more information, see [\[DAT\] key settings, page 140](#).



List Display

Available jobs or data appear in a list display when you do any of the following:

- view or edit data (MENU > Data)
- open the code list, point list, or Job Manager (MENU > Job)
- search for points or codes

In the list, the current cursor position is shown in reverse video (it appears as white text on a black background).

Press $\uparrow$ or $\downarrow$ move the cursor one line up or down.



If the Page Up icon $\blacktriangle$ appears, there are more pages before the current page. Press $\leftarrow$ to move up one page.

If the Page Down icon $\blacktriangledown$ appears, there are more pages after the current page. Press $\rightarrow$ to move down one page.

To select an item from the list, move the cursor onto the item and press [ENT].

Inputting Data

Entering a point name or number

You can use numeric or alphanumeric names up to 16 characters long to identify points.

The default name for a new point is the last point name entered, with the last digit incremented. For example, if the last point name was A100, the default name for the next point is A101.

If the last character of the previous point name is alphabetic, the default point name is the last point name.

When the cursor is in a PT (point) field, there are several ways to specify a point, or input coordinates.

Entering an existing point

When you enter a known point name or number, the coordinates of that point are displayed briefly. A short beep sounds before the next screen appears or the next field is selected.

Input Station

ST: A100

HI: 0.0000 m

CD: .

List Stack

PT: A100

CD: FENCE

N: 479561.340

E: -10300.506

Z: 82.076

To adjust the duration of the coordinate window display, go to MENU > Settings > Others. To leave the window open until you press **ENT**, set the XYZ disp field to +ENT. For more information, see [page 120](#).

<Others>

XYZ disp: +ENT

2nd Unit: US-Ft

Sig Beep: ON

Split ST: Yes

CD Input: <123>

Entering a new point

When you input a new point name or number, a coordinate input screen appears. Enter the point's coordinates in NE, NEZ, or elevation-only (Z) format.

Press **ENT** on the last line (the CD field) to store the point in the current job.

X: 102.0155

Y:

Z:

PT: 102

CD: CURB

List Stack

X: 102.0155

Y: 184.1729

Z: 70.4480

PT: 102

CD: CURB

List Stack

Using a point without coordinates

To use a point without recording the coordinates, press **ENT** in a PT field, without entering a point name.

Input P1

P1:

P2:

MsrPT

List Stack

X:

Y:

Z:

* This PT will not be recorded

The input coordinates are used in the calculation. They are not saved in the database.




Specifying a wildcard (*)

If you include an asterisk (*) when you enter a point or code name, a list of points that match the entered text appears.

Use $\uparrow$ or $\downarrow$ to move the cursor to the point that you want to use. Then press $\boxed{\text{ENT}}$.

If the Page Up $\uparrow$ or Page Down $\downarrow$ icons are displayed, use $\boxed{\leftarrow}$ or $\boxed{\rightarrow}$ to page up or page down the list.

When you select a point from the list, its coordinates are displayed and a beep sounds.

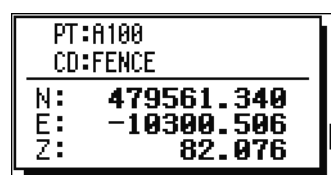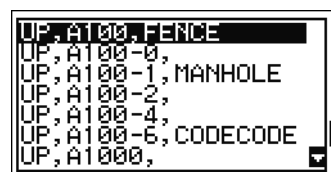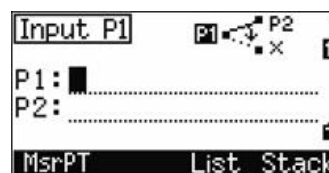

Recording an instant measurement




You can also input a point by recording an instant measurement. To do this, press the $\boxed{\text{MSR PT}}$ softkey.

An observation screen appears.

Press $\boxed{\text{MSR1}}$ or $\boxed{\text{MSR2}}$ to start a measurement. To change the height of the target, press the $\boxed{\text{HT}}$ softkey.

To go to the point recording screen when you have finished the measurement, press $\boxed{\text{ENT}}$.

Enter the point or code name. Press $\boxed{\text{ENT}}$.

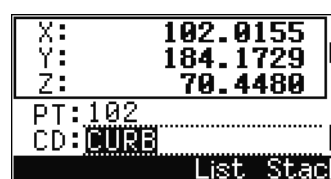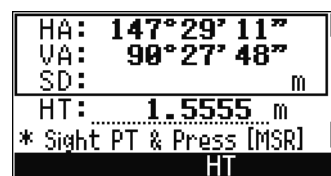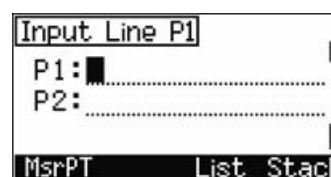

When you move the cursor to a field, the current or default value appears in inverted text (this is the default “Replace All” input mode).

Press **[>]** to change the input mode to Overwrite mode and highlight the first character. Press **[<]** to move the cursor the end of the string.

Entering a point from the stack

The point stack is a list of recently used points. To display the stack, press the **Stack** softkey when the cursor is in the PT field.

Use **[^]** or **[v]** to move the cursor to the point that you want to use. Then press **[ENT]**.

When you return to the point input screen, the selected point name is entered in the PT field, incremented by one. For example, if you selected the A101 point, A102 appears in the PT field.

The stack shows the last 20 point names used, in chronological order from last used to first used.

Entering a point from the point list

To display a list of existing points, press the **List** softkey when the cursor is in the PT field.

Use **[^]** or **[v]** to move the cursor to the point that you want to use. Then press **[ENT]**.

When you return to the point input screen, the selected point name is entered in the PT field. You can add digits or alphabetic characters if required.


Entering a code

The CD (Code) field always defaults to the last code used. You can change the selected code on the input point screen, or you can press **[COD]** in the BMS. For more information, see [\[COD\] key, page 38](#).

You can use numeric or alphanumeric names up to 16 characters long to identify codes.

Entering a code directly

To enter a code directly, press **[MODE]** to change the input mode to alphanumeric or numeric mode. Then use the keypad to enter the code.

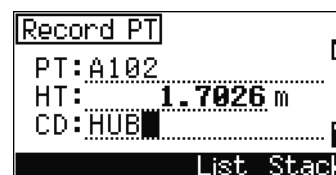


Entering a code from the stack

The code stack is a list of recently used codes. The stack may contain up to 20 codes.

To display the stack, press the **Stack** softkey when the cursor is in the CD field.

Use **[^]** or **[v]** to move the cursor to the code that you want to use. Then press **[ENT]**.

The selected code is copied to the CD field.

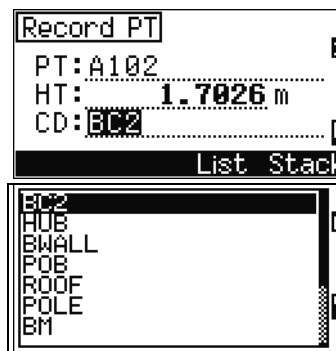

When the instrument is rebooted, the code stack is cleared.

Entering a code from the code list

To display a list of existing codes, press the **List** softkey when the cursor is in the CD field.


To edit the code list, go to **MENU > Data > Code List**. For more information, see [Editing an item in the point list or code list, page 133](#).

Use **[^]** or **[v]** to highlight the feature code that you want to use. Then press **[ENT]**.



A layer has an arrow at the end of the code label. If you highlight a layer in the list and then press **ENT**, the codes and layers in that layer are displayed.

When you return to the input screen, the selected code is entered in the CD field.

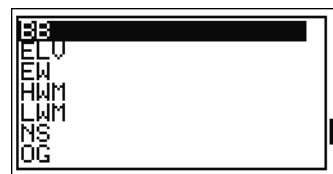


Items are shown in alphabetic order.

You can also use the first character search to quickly find a code. For more information, see [Advanced feature: Searching for a code by using the first character](#), page 49.


Advanced feature: Searching for a code by using the first character

To find a code quickly when the code list appears, use the first-character search.

For example, to see feature codes that begin with T, use the keypad to enter the letter T. To do this, press **T** twice.

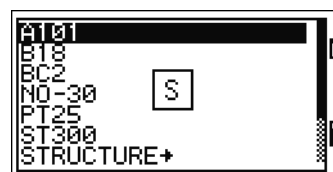


After each press of the key, the input mode field displays the selected letter. For example, if you press **T**, S appears. If you quickly press **T** again, T appears. If you do not press the **T** key again, the letter T is selected.

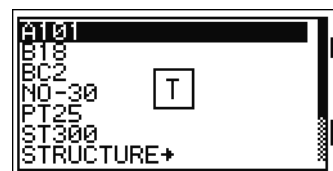


Once you have selected a letter, the cursor moves to the feature code beginning with that letter.

If there is no code beginning with that letter, the cursor moves to the next available letter.

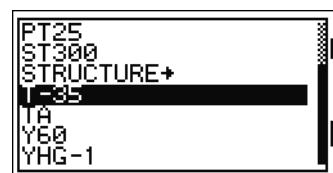

Qcodes

Quick codes (Qcodes) let you shoot and record many points with feature codes in the field. You can register up to ten Quick codes. To register Qcodes, press the **Edit** softkey. For more information, see [Quick code measurement mode](#), page 38.

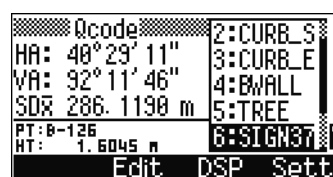

Press **MODE** to switch Qcodes on or off.

Press the **Edit** softkey to change the Qcode. You can edit the entire code, or just the number at the end of the code.

You can still use **DSP** to change the background displays.

Entering values in feet and inches

When either US Survey Feet (US-Ft) or International Feet (I-Ft) is selected as the distance unit, you can enter and display distances, HIs, HTs, and coordinate values either in decimal feet, or in feet and inches. For more information, see [Unit, page 119](#), and [Others settings, page 120](#).

To enter values in feet and inches in an input screen, enter the elements, separated by periods (.), in the following format:



<Feet> [] <Inches> [] <Numerator> [] <Denominator> [] **ENT**
 (0–11) (0–15) (0–99)

The default denominator is 16. If the denominator is 16, you do not have to enter it, and it is not displayed on the screen.

For example, if you enter

2 [] 0 [] 8 [] . [] 5 [] **ENT**, it appears as 2' 08" 5/ (2 feet, 8 and 5/16ths inches).

The following examples show how various values are entered:

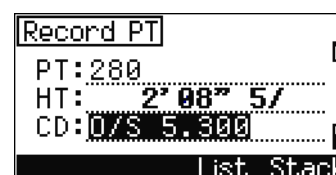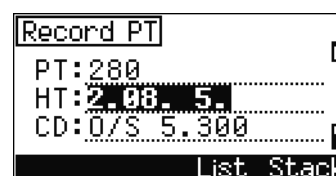

To enter ...	Type ...
65' 5 3/8"	6 5 . 5 . 3 . 8 ENT
65'	6 5 ENT
65' 5"	6 5 . 5 ENT
65' 5 3/8"	6 5 . 5 . 6 ENT
5 3/8"	0 . 5 . 3 . 8 ENT or 0 . 5 . 6 ENT

The numerator and denominator that you enter are automatically converted to the closest value from the following list: 0, 1/8, 1/4, 3/8, 1/2, 5/8, 3/4, 7/8, 1/16, 3/16, 5/16, 7/16, 9/16, 11/16, 13/16, 15/16. If the denominator is 16, it is not shown on the screen.

Jobs



To record data on the instrument, you must create or open a job.



CAUTION – Before you use the instrument for the first time, check the job settings.

Creating a new job

1. Press **MENU** to open the MENU screen.
2. Press **1** to open the Job Manager.
3. Press the **Creat** softkey to open the Create Job screen.
4. Enter the job name.
5. Press the **Sett** softkey to check the job settings. You cannot change a job's settings once you have created the job.
6. Press **ENT** in the last field of the Job Sett screen to create the new job.

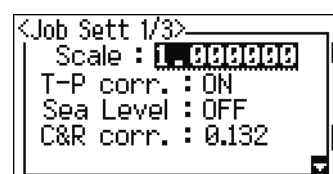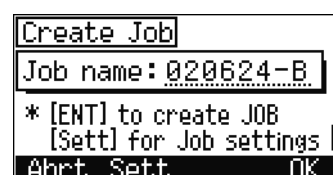

If either of the messages MAX 32JOBS or Data Full appears, delete at least one existing job to free space. You cannot free space by deleting records in an existing job.

Creating a control job


A control job, or common file, stores coordinate data that is used by several field jobs. You can create a control job in the office.

1. Press **MENU** to open the MENU screen.
2. Press **1** or select **Job** to open the Job Manager.
3. Move the cursor to the job that you want to use as the control job.
4. Press the **FNC** softkey.



5. Press **[F1]** to open the Control Job screen.
6. Press the **Yes** softkey.

For more information, see [Creating a control job](#), page 51.

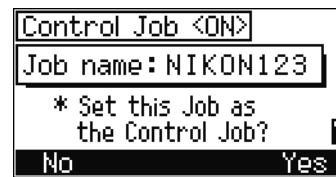

When you enter a point name or number, the system searches in the current job first. If the point is not found in the current job, the search is automatically extended to the control job. If the point is found in the control job, the selected point is copied to the current job as a UP record.

Measuring Distances


Sighting a prism reflector



WARNING – Never look at the sun through the telescope. If you do, you may damage or lose your eyesight.

For information on how to assemble the prism reflector, see [Setting Up the Prism Reflector](#), page 22.

Sight the telescope to see crosshairs at the center of the prism reflector.

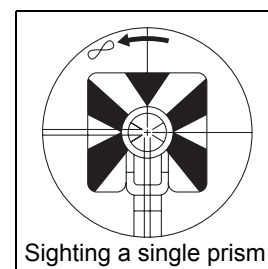


When a reflected lightwave is detected, the signal level is indicated.




Measuring distances


To take a distance measurement, press **[MSR1]** or **[MSR2]** in the Basic Measurement Screen (BMS) or in any observation screen.

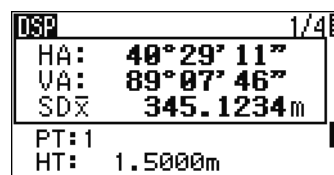

While the instrument is taking a measurement, the prism constant appears in a small font.

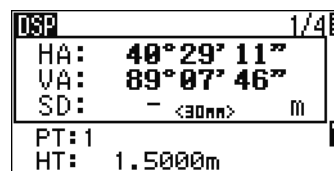

If the average count is set to 0, measurements are taken continuously until you press **[MSR1]**, **[MSR2]**, or **[ESC]**. Each time a measurement is taken, the distance is updated.

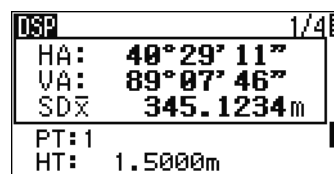

If the average count is set to a value from 1 to 99, the averaged distance appears after the last shot. The field name SD changes to SDx to indicate the averaged data.


If the signal level is insufficient to take a measurement, the signal icon flashes on and off. For more information, see [Status bar, page 33](#).

To change the height of target (HT), temperature, or pressure, press **[HOT]**. For more information, see [\[HOT\] key, page 39](#).



Settings that relate to corrections


(T-P corr, Sea Level, C&R corr., and Map projection) are included in the job settings. These settings are job-specific. If you need to change any of these settings, you must create a new job. For more information, see [Job settings, page 99](#), and [Settings, page 115](#).

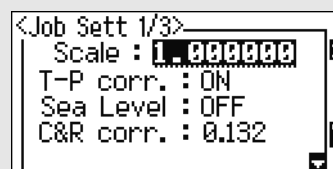

Measurement settings

To view the measurement settings, hold down **[MSR1]** or **[MSR2]** for one second.

Use **[↑]** or **[↓]** to move the cursor between the fields. Use **[←]** or **[→]** to change the value in the selected field.

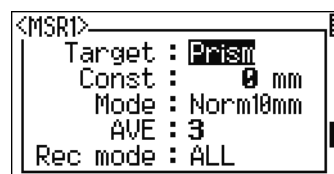

Field	Values
Target	- Prism - N-Prism
Const (prism constant)	-999 mm through 999 mm


Field	Values
Mode	- Prec0.1mm - Prec1mm - Normal1mm - Normal10mm
AVE (Average count)	0 (continuous) through 99
Rec mode	One of the following: - MSR only - Confirm - ALL

Target field

If the measurement is started with the Target field set to **Prism**, there is a dash “—” in front of the prism constant.

If the measurement is started with the Target field set to **N-Prism**, there is a right bracket “]” in front of the prism constant.

The symbol then constantly runs from left to right over the prism constant in the display.

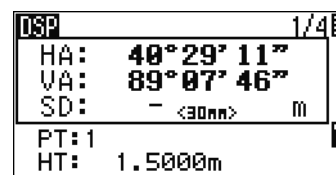

The Target setting is used to apply better cyclic-error adjustment in distance measurement. It efficiently eliminates multipath reflection.

Rec mode field

The Rec mode setting controls how the **MSR1** and **MSR2** keys operate in the BMS.

The **MSR only** setting is the default measurement mode. After a measurement, the instrument stops in the BMS and waits for you to press **ENT** before recording the point.

The **Confirm** setting displays the Record PT screen before data is recorded.

The **ALL** setting is a quick shooting and recording mode. The instrument automatically records the point using the default PT/CD. The instrument then returns to the BMS for the next measurement.


Applications

In this chapter:

- [HA Reset and Angle Operations](#)
- [Station Setup](#)
- [Stakeout](#)
- [Program Key](#)
- [Recording Measurement Data](#)
- [Measuring Offsets](#)

HA Reset and Angle Operations

To open the Angle menu, press **[ANG]** in the BMS. To select a command from this menu, either press the corresponding number key, or press **[←]** or **[→]** to highlight the command and then press **[ENT]**.

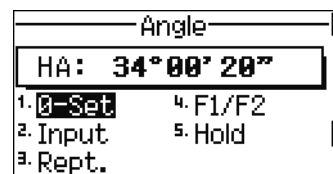

Setting the horizontal angle to 0

To reset the horizontal angle to 0, press **[1]** or select **0-Set** in the Angle menu. The display returns to the Basic Measurement Screen (BMS).

Entering the horizontal angle

To display the HA Input screen, press **[2]** or select **Input** in the Angle menu. Use the numeric keys to enter the horizontal angle. Then press **[ENT]**.



To enter 123°45'50", type **[1][2][3][.][4][5][5][0]**.

The displayed value is rounded to the minimum angle increment.

Recording a foresight point after repeat angle measurement

- To activate repeat angle measurement, press **[3]** or select **Rept.** in the Angle menu.

HR=0 appears.




- Sight the backsight and press **[ENT]**.

- Sight the foresight and press **[ENT]**.

The horizontal angle is accumulated and the value is held again.

- To end repeat angle measurement, press **[ESC]**.

- When you have accumulated enough horizontal angle between the backsight and the foresight, press **[MSR1]** or **[MSR2]** to take a measurement to the foresight.

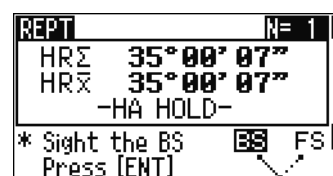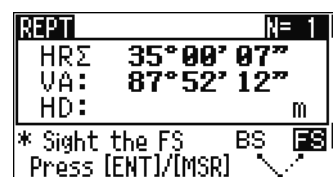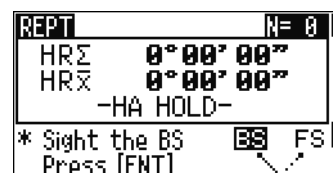

The averaged horizontal angle appears. This value is fixed until the process is finished or cancelled.

$$HR\bar{x} = HR\Sigma + N$$

$$HA = BSAz + HR\bar{x} \text{ (normalized)}$$

$HR\bar{x}$ is not updated even if the instrument is moved.

6. Press **[ENT]** to store the foresight as a CP record. Check the PT, HT, and CD values. Then press **[ENT]** to record.

REPT N= 5

HRx	35°00'06"
HA:	64°01'10"
HD:	180.2346m

* Press [ENT] to store Foresight as a CP record

Record PT

PT:	A100
HT:	1.7026 m
CD:	EDGE1

List Stack

In repeat angle measurement, the HA is replaced by $HR\Sigma$. The number of repeat angles appears at the top of the screen (for example, N= 5).

Horizontal angles can be measured up to 1999°59'59"5.

This function stores both raw and XYZ data as CP records, regardless of the Store DB setting.

Face-1/Face-2 measurement

Use Face-1/Face-2 (F1/F2) measurements to obtain maximum accuracy for measuring angles. Using F1/F2 measurements effectively cancels out mechanical constant error, except for some special errors such as the vertical axis error. For more information, see [Face-1/Face-2 Measurements, page 26](#).

To take F1/F2 data without taking a distance measurement, press **[4]** or select F1/F2 in the Angle menu.

Angle

HA: 34°00'20"	
1. 0-Set	4. F1/F2
2. Input	5. Hold
3. Rept.	

If you have already taken a distance measurement to the target, you can initiate F1/F2 averaging by flipping the telescope to the other face.

DSP 1/4

HA: 40°29'11"	
Turn to F2	
PT: 1	
HT: 1.5000m	

For the HA to be adjusted from a F1/F2 measurement, the Backsight must also have been measured in F1/F2 during the station setup.

! STN Setup has to be in F1/F2


* Press any key

Horizontal angle hold

To hold the horizontal angle to the current value, press **[5]** or select **Hold** in the Angle menu.

To set the horizontal angle to the displayed value, press **[ENT]** or the **Set** softkey.

To cancel the process and return to the Basic Measurement Screen (BMS), press **[ESC]** or the **Abt** softkey.


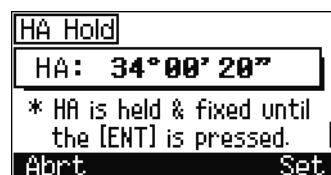


Station Setup

To open the Stn Setup menu, press **[STN]** in the BMS.



To select a command from this menu, press the corresponding number key. Alternatively, press **[<]** or **[>]** to highlight the command and then press **[ENT]**. Press **[^]** or **[v]** to move up or down one page.

The last function used is highlighted.

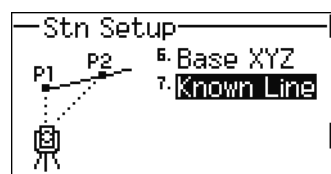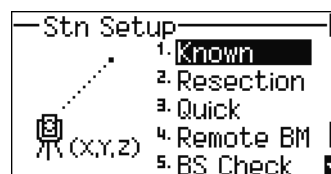


Setting up a station with known coordinates or azimuth

1. Press **[1]** or select **Known** in the Stn Setup menu.
2. Enter a point name or number in the ST field.
 - If the input point number or name is an existing point, its coordinates are displayed and the cursor moves to the HI (Height of instrument) field.
 - If the point is new, a coordinate input screen appears. Enter the coordinates for the point. Press **[ENT]** after each field. When you press **[ENT]** in the CD field, the new point is stored.
 - If the specified point has a code, the code appears in the CD field.
3. Enter the instrument height in the HI field and then press **[ENT]**.

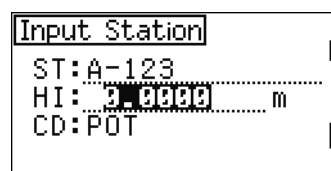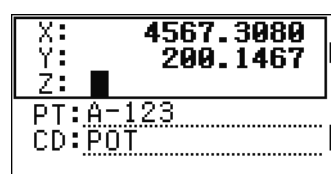


The Backsight screen appears.





4. Select an input method for defining the backsight point.
 - To sight the backsight by entering coordinates, see the following section.
 - To sight the backsight by entering the azimuth and angle, see [page 60](#).

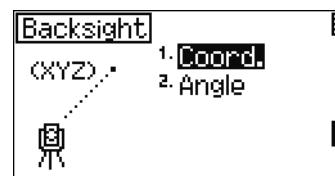


Sighting the backsight by entering coordinates

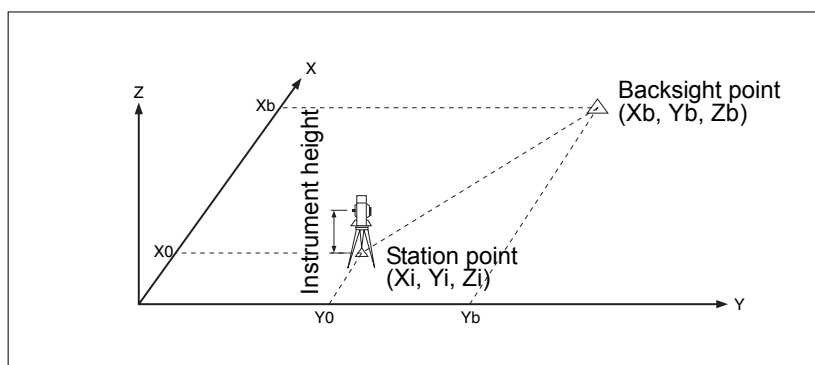

1. To enter coordinates for the backsight point (BS), press **[1]** or select **Coord** in the Backsight screen.
2. Enter the point name. If the point exists in the job, its coordinates are shown.
3. If you intend to take a distance measurement to the BS, enter the height of target in the HT field.
4. Sight the BS on Face-1 (F1). Press **[ENT]** to complete the setup.
 - To record a full shot (with HA, VA, and SD values) to the BS, press **[MSR1]** or **[MSR2]**.
- AZ Azimuth calculated by coordinates
 - If you are measuring to a known coordinate BS, press **[DSP]** to display a QA screen. The QA screen shows the dHD and dVD values, which indicate the difference between the measured distance and the distance calculated from the known coordinates.
5. To record the station, press **[ENT]**.

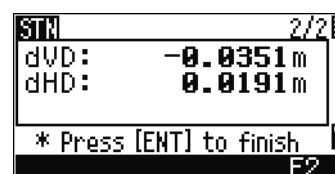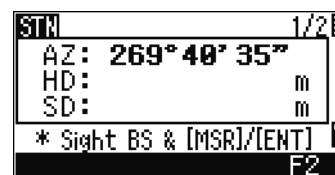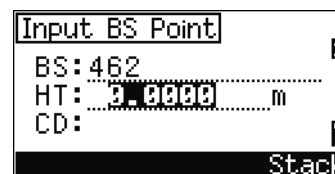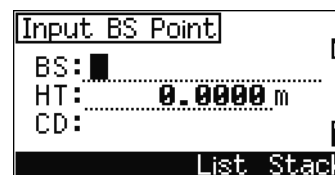


- To finish the station setup after taking a distance measurement, press **[ENT]**. ST and F1 records are stored to the current job.

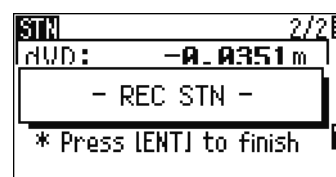


Advanced feature: Measuring F1 and F2

To take an angle shot and proceed to the next measurement on Face-2, press the **F2** softkey.

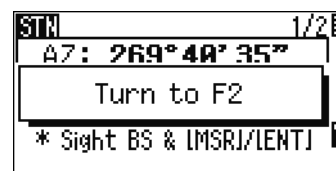


To go directly to the Face-2 measurement after taking a distance measurement to the BS on Face-1, flip the telescope. The instrument automatically detects F1/F2.

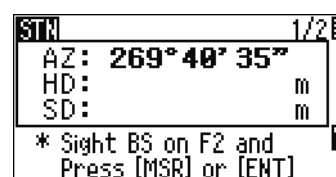


Press **[ENT]** on Face-2. The delta screen appears.


To record a CP record which stores the averaged HA, VA, and SD from the F1/F2 data, press the **CP** softkey. To record only the ST and F1/F2 records, without a CP record, press the **OK** softkey.

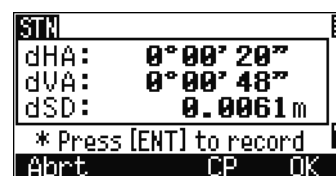

Sighting the backsight by entering the azimuth angle

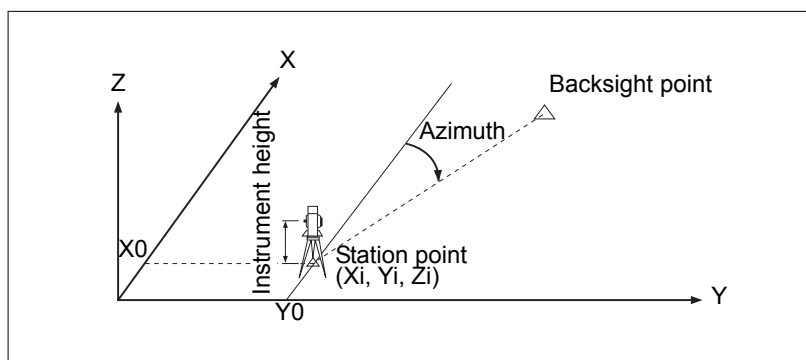

- To enter the azimuth angle to the backsight point, press **[2]** or select **Angle** in the Backsight screen.

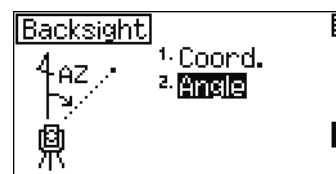

2. If there is no point name for the BS, press **[ENT]** on the BS field.

Input BS Point	
BS:	
HT:	0.0000 m
CD:	
List Stack	

3. In the AZ field, enter the azimuth angle to the BS point.

Input BS Angle	
AZ:	269.4035

If you press **[ENT]** without entering a value in the AZ field, the azimuth is automatically set to 0°00'00".


4. Sight the BS point and press **[ENT]**. ST and F1 records are stored in the job.

STN	1/2
AZ:	269°40'35"
HD:	m
SD:	m
* Sight BS & [MSR]/[ENT]	
F2	

You can also use the F2 softkey for F1/F2 measurements. See [Advanced feature: Measuring F1 and F2](#), page 60.

Setting up a station using multiple point resection

A resection sets the station using angle/distance measurements to known points.







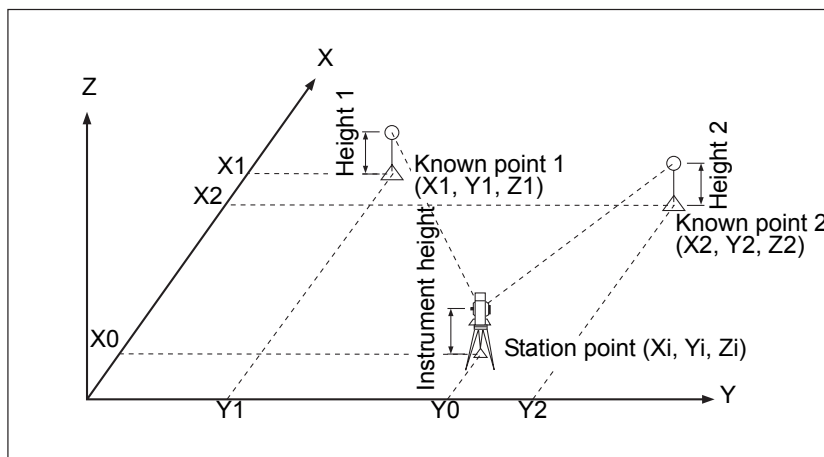


You can use a maximum of 10 points in a resection. Measurements can be distance and angle, or angle only. Calculation starts automatically when enough measurements are taken.

You can delete poor observations and recalculate if necessary. You can also select the BS point.

If the angle between known point 1 and known point 2 (measured from the station point) is extremely acute or extremely oblique, the resulting solution will be less reliable geometrically. For geometric reliability, select known point locations (or station point locations) that are widely spaced.

1. To start the resection, press **[2]** or select **Resection** in the Stn Setup menu.
2. Enter the point name for the first observation point (PT1).
3. Enter the target height and press **[ENT]**.
4. Sight PT1 and press **[MSR1]** or **[MSR2]**.
To use the **F2** softkey for F1/F2 measurements, see [Advanced feature: Measuring F1 and F2](#), page 60.
5. To proceed to the next point, press **[ENT]**.
6. Enter the second point (PT2) and its height of target.
7. Measure to PT2 and press **[ENT]**.
When the instrument has enough data, it calculates the station (STN) coordinates.

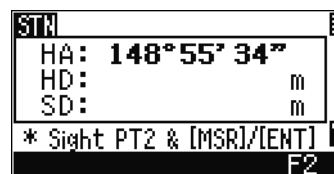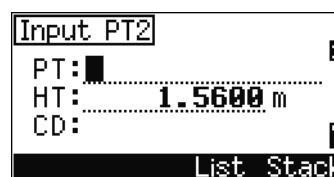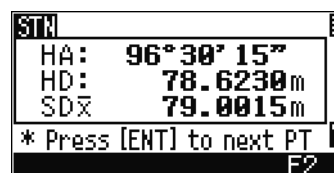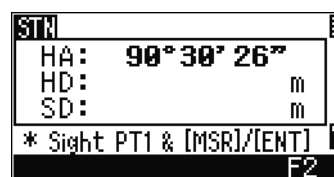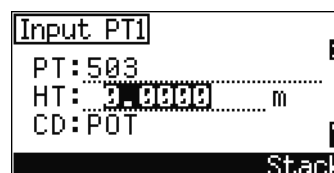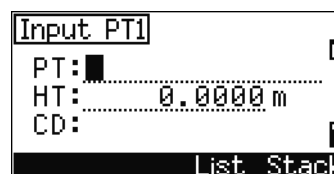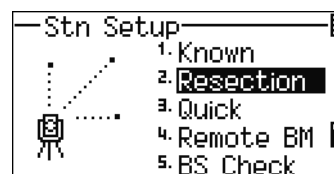

- If more than the minimum required data is available, a standard deviation screen appears.
 - To take measurements to strengthen geometry of the resection, press the Add softkey. For information about the View softkey, see [Advanced feature: Viewing and deleting a measurement in resection](#), page 64.
8. When the results are satisfactory, record the station. To do this, press **[ENT]** or the REC softkey.
 9. Enter the height of instrument, if required. Press **[ENT]**. The ST field defaults to the last recorded PT + 1.
 10. To change the station name, move to the ST field and edit or replace the text.

STN 1/2

σN : 0.0193
 σE : 0.0084
 σZ : 0.0227

* Press [REC] to finish

Add View DSP REC

STN 2/2

N: 200.4651
E: 100.0126
Z: 64.4160

* Press [Add] for next PT

Add View DSP REC

ST: 9005
HI: 1.2345 m
CD:
BS: 9000
* Input Height of Inst.

Add View DSP REC

If you have set Split ST to Yes, the ST field defaults to the last recorded ST value + 1. For more information, see [Others settings](#), page 120.

- BS defaults to the first observed point.
11. To change the BS, press the Change softkey.
 12. Select the BS point that you want to use and press **[ENT]**.
 13. To finish the resection setup, move the cursor to the BS field and press **[ENT]**.

ST: 9005
HI: 1.2345m
CD: MANHOLE-7
BS: 9000
* Select Backsight PT

Change

Select BS point

9000
200, MANHOLE
30-A, N-POLE
201,

Add View DSP REC


ST: 9005
HI: 1.2345m
- REC STN -
* Select Backsight PT

Add View DSP REC


The minimum data required for a resection is either three angle shots, or one angle shot and one distance shot. If you use a distance shot, the distance between the target points must be greater than the measured distance. Stn-Z is calculated from distance-measured data. If no distances are measured, then Stn-Z is calculated using angle-only measurements to points with 3D coordinates.

Advanced feature: Viewing and deleting a measurement in resection

To check the measurements to each known point, press the **View** softkey on the calculated STN (sigma or coordinate) screen.

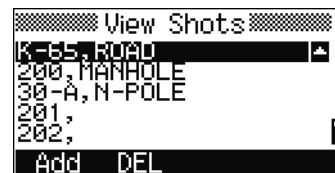

dHA	Distributed HA errors in each direction
dVD	VD errors between measured distance and calculated distance
dHD	HD errors between measured distance and calculated distance

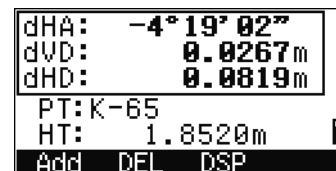


To delete a measurement (because of large sigma values, for example), highlight the measurement data or display the detail screen for the measurement. Then press the **DEL** softkey. The STN coordinates are automatically recalculated.

To continue resection observations, press the **Add** softkey. The input screen for the next PT appears.


**Setting up the station quickly without coordinates**

The station point (ST) in this function defaults to a new point number. For the new point, MP (0, 0, 0) is stored as the coordinates. When the ST is manually changed to a known point name, the station is set up on the coordinates of the known point.


- To enter Quick Station setup, press **3** or select **Quick** in the Stn Setup menu.

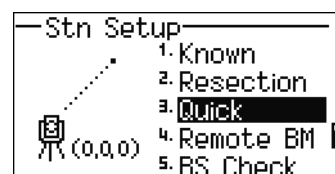

ST	Station point (defaults to the last recorded PT + 1, or ST + 1, depending on the Split ST setting)
HI	Height of instrument
BS	Backsight point (blank)
AZ	Backsight azimuth (defaults to zero)

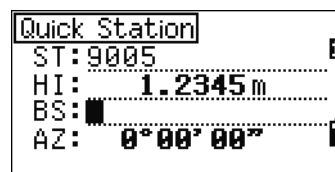

2. No default PT is assigned to the BS. Leave this field blank, or enter a BS point name.
3. The backsight azimuth (AZ) defaults to zero, but you can change this.
4. To complete the station setup, sight the BS and press **[ENT]**.




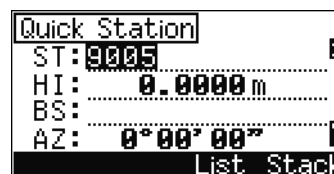


When you press **[ENT]** in the AZ field, both HA and AZ are reset to the value you have entered.

Even if both ST and BS are known points, this function does not calculate the backsight angle (AZ) automatically. To calculate the AZ between two known points (ST and BS), use **Station Setup > Known**. For more information, see [Setting up a station with known coordinates or azimuth, page 58](#).


Determining station elevation

1. Press **[4]** or select **Remote BM** in the **Stn Setup** menu.
2. Enter the BM point and press **[ENT]**. When the point is found, it appears briefly. The cursor then moves to the HT field.
3. Enter the HT and press **[ENT]**.
4. Sight the BM point and press **[MSR1]** or **[MSR2]**.
5. To take an F1/F2 measurement, press the **F2** softkey or flip the telescope to Face-2 after a distance measurement.

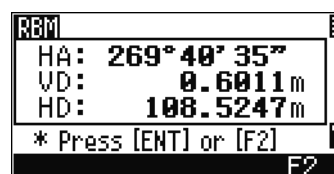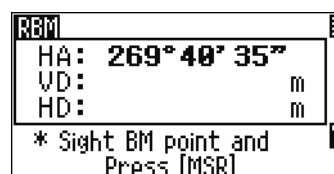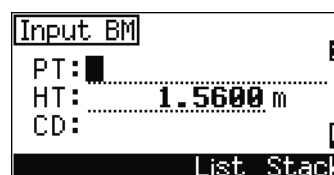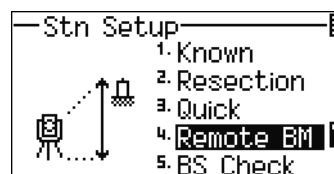

The updated station coordinates are displayed. You can change the HI in this screen.

6. To record the updated STN, press **[ENT]**.

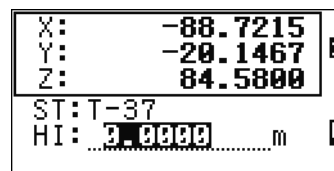


When the HI is changed, the Z coordinate is updated before the station is recorded. You must complete a station setup before you use the Remote Benchmark function.

Checking and resetting the backsight direction


You must complete a station setup before you use the BS check function.

This function always refers to the backsight point from the last ST record stored in the current open job.

1. To enter the backsight (BS) check function, press **[5]** or select **BS Check** in the Stn Setup menu.

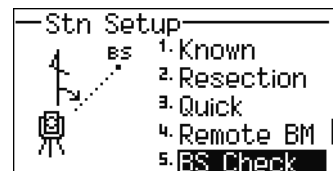

- HA Current HA reading
 BS The HA to the BS in the last station setup.
 Enter station coordinates for observations
 without recording data

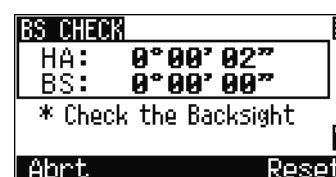

2. Do one of the following:
 - To reset the horizontal angle to the HA set in the last station setup sight the BS and press the **Reset** softkey or press **[ENT]**.
 - To cancel the process and return to the BMS, press the **Abt** softkey or press **[ESC]**.


Base XYZ function

Base XYZ does not store a ST record, so the BS Check cannot check the backsight when you enter a station using Base XYZ.


To store raw data, use one of the other functions in the Stn Setup menu. This function does not store an ST record in the job.

You can use this function without an open job. If there is an open job when you use this function, a CO record is stored to indicate that the instrument's base coordinates have changed.

1. To enter the Base XYZ function, press **[6]** or select **Base XYZ** in the Stn Setup menu.

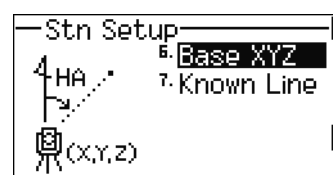

The current instrument XYZ values are shown as the default.

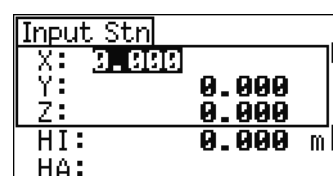

2. Enter the new instrument XYZ values and press **[ENT]**.

3. Do one of the following:

- To reset the horizontal angle, enter a value in the HA field and press **[ENT]**.
- If you do not need to reset the HA, leave the HA field blank and press **[ENT]**.

The display returns to the BMS.

Input Stn	
X:	500.000
Y:	600.000
Z:	0.000
HI:	1.836 m
HA:	

Two-point resection along a known line

1. To enter the Known Line function, press **[7]** or select **Known Line** in the Stn Setup menu.

Stn Setup	
P1	P2
5. Base XYZ	
7. Known Line	

2. Enter a known point as P1.

If you enter a new point name, a coordinate input screen appears.

Input P1	
P1:	
HT:	0.000 m
CD:	
List Stack	

Sight P1 and press **[MSR1]** or **[MSR2]** to take a measurement. Press **[ENT]**.

STN	
HA:	96°30'15"
HD:	78.623 m
SD:	79.001 m
* Press [ENT] to next PT	
F2	

3. Choose how you want to define a known line:

- To define the line by entering P2 coordinates, press **[1]** or select **By Coord.**
- To define the line by entering the azimuth, press **[2]** or select **By Angle.**

Input P2	
4. AZ	1. By Coord.
P2	2. By Angle

4. If you select **By Angle**, the azimuth input screen appears. Enter the angle value and press **[ENT]**.

Input Angle	
AZ:	269.4035
* Azimuth of P1-P2 Line	

A measurement screen appears.

5. Sight P2 and then press **[MSR1]** or **[MSR2]** to take a measurement. Press **[ENT]**.

STN	
HA:	148°55'34"
HD:	m
SD:	m
* Sight PT2 & Press [MSR]	
F2	

After the measurement to P2 is completed, the coordinates of the station are calculated.

6. To record the station, press **[ENT]** or the **REC** softkey.
7. To check your measurement, press the **DSP** softkey. If you defined the line by entering its azimuth, HD and VD between P1 and P2 are displayed.

If you defined the line by entering the P2 coordinates, the difference of HD (dHD) and VD (dZ) between your measurement data and input coordinate data are displayed.

8. Enter the station name, the height of instrument (HI), and a feature code (CD) if required. The station name defaults to the last recorded PT + 1, or last recorded ST + 1, depending on the Split ST setting.
9. Backsight (BS) defaults to the first point (P1). To change it, highlight the BS field and then press the **Change** softkey.
10. To finish the setup and record the station, press **[ENT]** in the BS field.

STN 1/2

X: 200.465
Y: 100.012
Z: 64.416

* Press [ENT] to finish

DSP REC

STN 2/2

HD: 182.035 m
VD: 0.648 m

* Press [ENT] to finish

DSP REC

ST: 9005

HI: 1.2345m

CD:
BS: 9000

* Input ST name

List Stack

ST: 9005

HI: 1.2345m

CD: MANHOLE-7

BS: 9000

* Select Backsight PT

Change

ST: 9005

HI: 1.2345m

BS: [highlighted]

- REC STN -

* Select Backsight PT

Sample records

CO, Temperature:20C Pressure:1013hPa Prism:0 ...


ST,9005, ,265, ,1.2350,150.40300,150.40300

F1,265,1.6040,79.0010,90.30150,89.35260,


F1,200,1.4590,50.2300,269.4035,93.50110,

CO, P1-P2 HD=122.0350 VD=0.5600

Stakeout

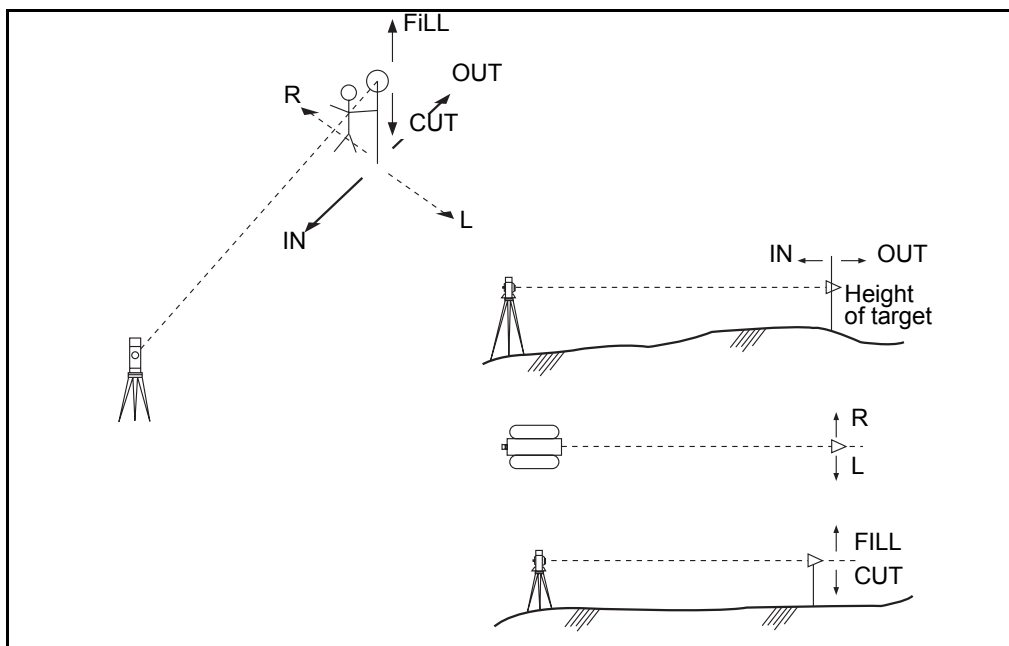


To display the Stakeout menu, press **[S-O]**.

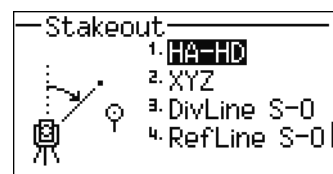

Specifying the stakeout point by angle and distance

1. To display the input screen for the distance and angle to the target, press **[1]** or select **HA-HD** in the Stakeout menu.
2. Enter the values and press **[ENT]**.

HD Horizontal distance from station point to stakeout point
 dVD Vertical distance from station point to stakeout point
 HA Horizontal angle to stakeout point.


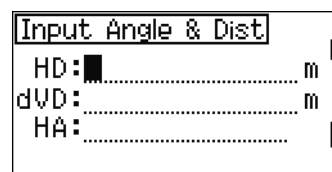


If you press **[ENT]** without entering HA, the current HA is used.

3. Rotate the instrument until the dHA is close to 0°00'00".
4. Sight the target and press [MSR1] or [MSR2].


When the measurement is completed, the differences between the target position and the stakeout point are displayed.

dHA Difference in horizontal angle to the target point
 R/L Right/Left (Lateral error)
 IN/OUT In/Out (Longitudinal error)
 CUT/FIL Cut/Fill

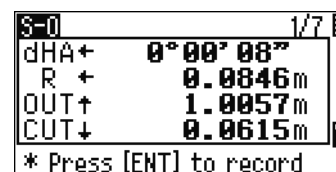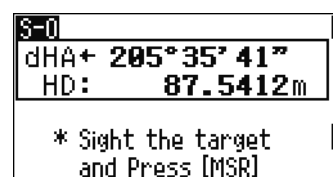

Once a measurement is taken, the Cut/Fill value and Z coordinate are updated as the VA is changed.

If you press [HOT] in any observation screen, the HOT key menu appears. You can use this menu at any time to change HT and T-P.

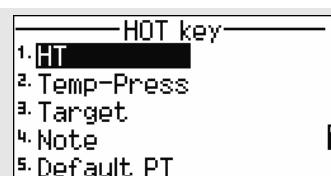

Using [DSP] to switch between display screens

Press [DSP] to switch between the Stakeout display screens. The following screens are available:

S-01 	S-02 	S-03 	S-04
S-05 	S-06 	S-07 	S-08

The S-08 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 120](#).

Every time you press [DSP], the next screen appears. If you press [DSP] in the last screen (S-07, or S-08 if the secondary distance unit is set), the S-01 screen appears.

To customize the S-02, S-03, and S-04 screens, hold down [DSP] for one second. For more information, see [Customizing items in the Basic Measurement Screen \(BMS\), page 37](#).

To record the stakeout point, press **[ENT]**. PT defaults to the last recorded PT+1.

Press **[ENT]** to record the point.

After recording the point, it returns to the observation screen. You can continue observation, or press **[ESC]** to input another angle and distance for stakeout.

Specifying the stakeout point by coordinates

- To start a stakeout by coordinates, press **[2]** or select XYZ in the Stakeout menu.

- Enter the point name that you want to stake and press **[ENT]**.

You can also specify the point by code or radius from the instrument.

If several points are found, they are displayed in a list. Use **[↑]** or **[↓]** to move up and down the list. Use **[←]** or **[→]** to move up or down one page.

- Highlight a point in the list and press **[ENT]**.


The delta angle and the distance to the target are shown.

dHA Difference in horizontal angel to the target point.
HD Distance to the target point

- Rotate the instrument until the dHA is close to 0°00'00". Press **[MSR1]** or **[MSR2]**.

- Ask the rodman to adjust the target position. When the target is on the intended position, the displayed errors become 0.0000 m (or 0.0000 ft).

dHZ Difference in horizontal angle to the target point.
 R/L Right/Left (Lateral error)
 IN/OUT In/Out (Longitudinal error)
 CUT/FIL Cut/Fill

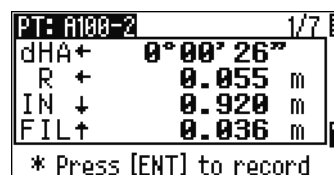


To switch between display screens, press **[DSP]**. This function works as in the angle-distance stakeout, except that the screen counter (for example, S-O1/8) is not displayed. For more information, see [Using **\[DSP\]** to switch between display screens](#), page 70.

During observation, you can use the flashing Lumi-guide to indicate distance.


To set the tolerance for the Lumi-guide flash speed, press **[S-O]** in any observation screen. For more information, see [Stakeout](#), page 118.

Once a measurement is taken, the Cut/Fill value and Z coordinate are updated as the VA is changed.


- To record the point, press **[ENT]**. PT defaults to the specified PT + 1000.

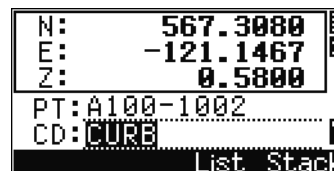


Use the Add Constant field in **MENU > Settings > Stakeout** to specify an integer that is added to the point number being staked to generate a new number for recording the staked point. The default value is 1000. For example, when you stake out PT3 with an Add Constant of 1000, the default number for SO record is 1003. For more information, see [Stakeout](#), page 118.

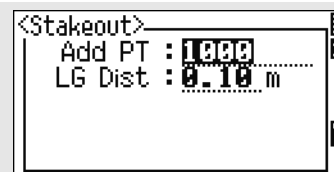

After recording the point, the display returns to the observation screen. When you press **[ESC]**, the display returns to the PT/CD/R input screen. If you entered the stakeout point using a single point name, the PT defaults to the last PT + 1.

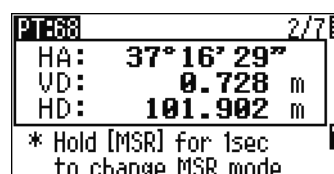

If you selected a point from the list, the display returns to the list, unless all points have been selected. Press **[ESC]** to return to the point input screen.

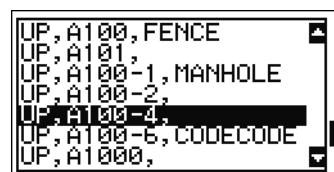

Advanced feature: Specifying a stakeout list by range input

1. To input points by range, press the Fr/To softkey in the PT field.
2. Enter the start point (Fr) and the end point (To). The range between Fr and To must be less than 1001 points.

If existing points are found between Fr and To, a point list appears.

To highlight a point, press $\uparrow$ or $\downarrow$. To go to the stakeout observation screen, press ENT .

If you have assigned a control job, and additional points are found in the control job, the Ctrl softkey appears under the list.

DivLine S-O

This function divides the line between the instrument and the first target by an input span number. It then guides you to stake out the points, one by one.

1. Press 3 or select DivLine S-O in the Stakeout menu.
2. Set up the baseline. To do this, sight the target on the line (the end point) and press MSR1 or MSR2 .
3. Enter the total stake number in the Span total field.

The observation screen for the first stake (from the instrument) appears.


4. Sight the prism and then press [MSR1] or [MSR2].
5. Use [▲] or [▼] to change the guide point. You can calculate and guide up to double the number of the stakes.
6. To record the point as an SO record, press [ENT].

```
LineS-0 <1/4>
HD: 10.0650m
L + 0.1564m
In + 0.3408m
* [↓] = Go to next nail
[↑] = Back to prev nail
```

```
LineS-0 <2/4>
HD: 20.1300m
L + 0.1502m
Out + 10.4058m
* [↓] → Go to next nail
[↑] → Back to prev nail
```

```
X: 102.0155
Y: 184.1729
Z: 70.4480
PT: 102
CD: CURB
List Stack
```

For example, if you measure to the end point at 100 m from the instrument and set the span total to 2, the following four points are calculated and can be staked:

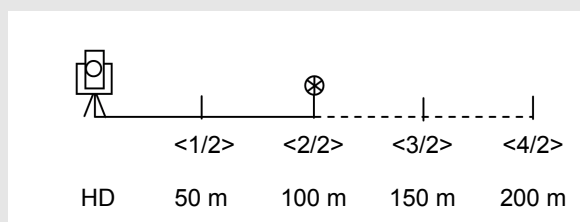

RefLine S-O

This function allows you to stake out a point based on the Sta, O/S, and dZ to a specified line.

1. Press [4] or select RefLine S-O in the Stakeout menu.

```
Stakeout
1. HA-HD
2. XYZ
3. DivLine S-O
4. RefLine S-O
```

2. Enter the first point (P1) of the line.

```
Input Line P1
P1: 
P2: 
MsrPT List Stack
```

If you press **[ENT]** without entering a PT name, you can enter temporary coordinates which are not recorded in the job.

Alternatively, press the **Msr PT** softkey to measure a point.

```

N: 200.3080
E: -100.5520
Z: 69.520
* This PT will not
  be recorded
  
```

3. Enter the second point (P2) of the line.

```

Input Line P2
P1: <Keyed-in XYZ>
P2: 
MsrPT List Stack
  
```

4. Enter offsets to the line.

Press **[ENT]** in a blank field to enter the value 0.0000.

Sta Distance from P1 along the line
 O/S Distance perpendicular to the line
 (+) Right side of the P1-P2 line
 (-) Left side of the P1-P2 line
 dZ Difference in height from the line

```

Input offsets
Sta: 40.3500m
O/S: 3.5500m
dZ: 
  
```

5. Rotate the instrument until the dHA is close to 0°00'00".
6. Sight the target and press **[MSR1]** or **[MSR2]**.

```

REF S-0
dHA: 205°35'41"
HD: 87.5412m
* Sight the target
  and Press [MSR]
  
```

When a distance measurement is taken, the difference from the design point appears.

7. To record the point as an SO record, press **[ENT]**.

```

REF S-0 1/7
dHA: 0°00'00"
R: 0.0846m
OUT: 1.0057m
CUT: 0.0615m
* Press [ENT] to record
  
```

Using **[DSP]** to switch between display screens



You can use **[DSP]** to switch between display screens. This function works as in the angle-distance stakeout. For more information, see [Using **\[DSP\]** to switch between display screens, page 70.](#)

Program Key

To display the Programs menu, press **[PRG]**.


Measuring distance and offset values along a specified line

1. Press **[F1]** or select 2Pt RefLine in the Programs menu.
2. Enter the first point for the reference line. Alternatively (to enter the point by measuring), press the MsrPT softkey.


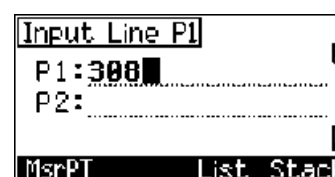
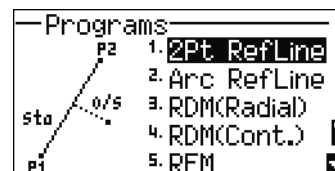


Direct Measurement screen

- Press the MsrPT softkey to display a direct measurement screen.
- Sight the target and then press **[MSR1]** or **[MSR2]**. The Record PT screen appears.
- If you press **[ESC]** in the Record PT screen, the measured point is used but not recorded in the job.

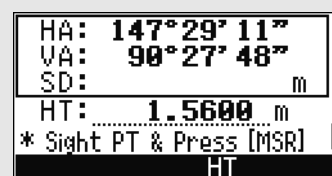

3. Enter the second point for the reference line.
4. Enter an asterisk (*) in the PT field to perform a wildcard search. A list of matching points appears. Highlight a point in the list and then press **[ENT]**.

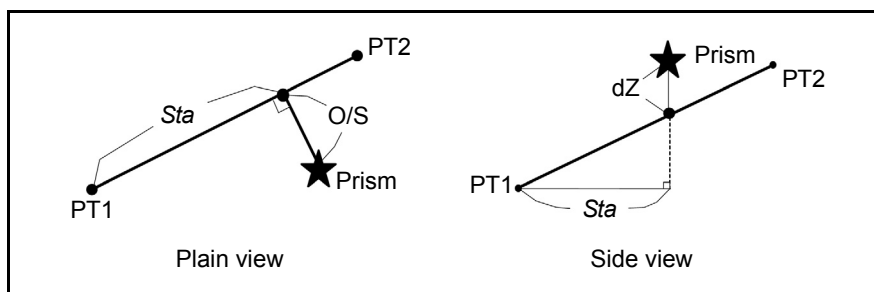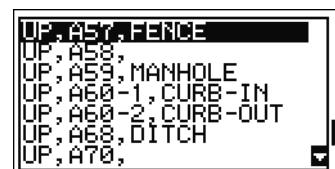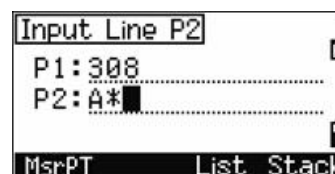

5. Sight the prism or reflective sheet and then press [MSR1] or [MSR2].

Sta Horizontal distance from P1 to the measure point along the P1-P2 line

O/S Horizontal offset from the P1-P2 line to the measured point

dZ Vertical offset from the P1-P2 line to the measured point

REF	1/4
Sta:	-0.2146m
O/S:	3.5021m
dZ:	0.0207m
* Press [ENT] to record	

Using [DSP] to switch between display screens

Press [DSP] to switch between the Stakeout display screens. The following screens are available:

REF1

Sta
O/S
dZ

REF2

X
Y
Z

REF3

HA
VA
SD

REF4

HA
VD
HD

REF5

HD
VD
SD

The REF5 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 120](#).

Every time you press [DSP], the next screen appears. If you press [DSP] in the last screen (REF4 or REF5), the REF1 screen appears.

To store the point and its offset distance information, press [ENT].

Enter the point name and feature code.

You can also use this screen to change the HT value.

Record PT	1
PT: A102	
HT: 1.7026 m	
CD: HUB	
List Stack	

Sample records




CO, 2pt-Ref Pt:16 & Pt:13 Az:311.2932

CO, Sta= -12.6876 Offset= 1.3721 dZ= 0.0971


SS,17,1.0000,6.9202,18.4700,80.3120,15:48:48,2REF-LINE

Measuring distance and offset values on the arc-curve




1. Press **[2]** or select **Arc RefLine** in the Programs menu.
2. Enter the start of the curve point (P1) and the azimuth of its tangent line (AZ1).
3. To enter P1 by direct measurement, press the **MsrPT** softkey.
4. Choose a method to define the arc.

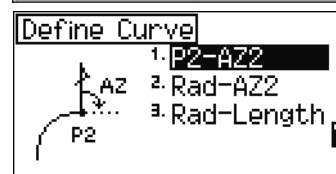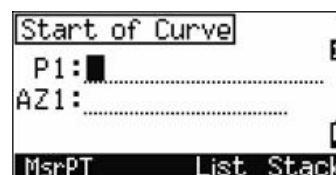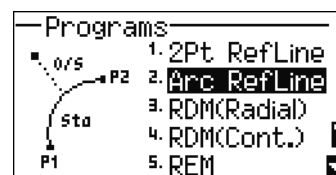

P2 can be any point on the tangent line that is to exit the curve.

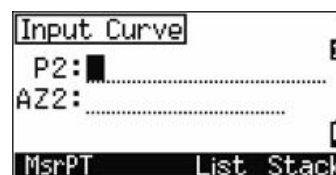

5. In the radius (Rad) field, enter a positive value for a clockwise curve. Enter a negative value for a counterclockwise curve.

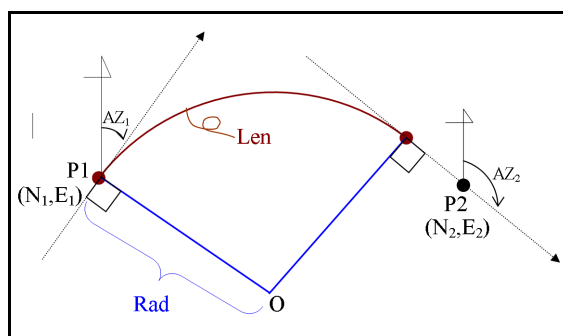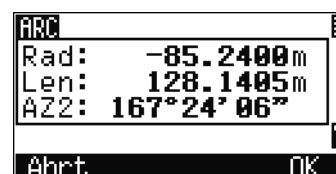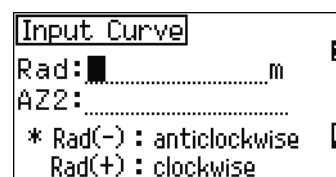

When all factors have been entered, the instrument calculates the curve.

If the curve length (Len) is too large for a circle of the given radius, it is shortened.

ARC1/4

Sta: -0.2146m

O/S: 3.5021m

dZ: 0.0207m

* Press [ENT] to record

To ...	Press ...
switch between display screens	[DSP]
change HT	[HOT]
record points	[ENT]

Using [DSP] to switch between display screens

Press [DSP] to switch between the Stakeout display screens. The following screens are available:

ARC1

Sta

O/S

dZ

ARC2

X

Y

Z

ARC3

HA

VA

SD

ARC4

HA

VD

HD

ARC5

HD

VD

SD

The ARC5 screen is only available if the secondary distance unit is set. For more information, see [Others settings, page 120](#).

Every time you press [DSP], the next screen appears. If you press [DSP] in the last screen (ARC4 or ARC5), the ARC1 screen appears.

To record the point, press [ENT] on any observation screen. The arc is stored in comment records.

Record PT

PT: 208

HT: 1.7026 m

CD: HUB


List Stack

Sample records

CO,Arc P1:583 AZ1=0.0000 P2:102
CO, AZ2=311.2932 Radius=50.0000 Length=125.6637
CO, Sta= -12.6876 Offset= 1.3721 dZ= 0.0971
SS,17,1.0000,6.9202,18.4700,80.3120,15:48:48,2REF-LINE

Remote distance measurement


This function measures the horizontal distance, vertical distance, and slope distance between two points.

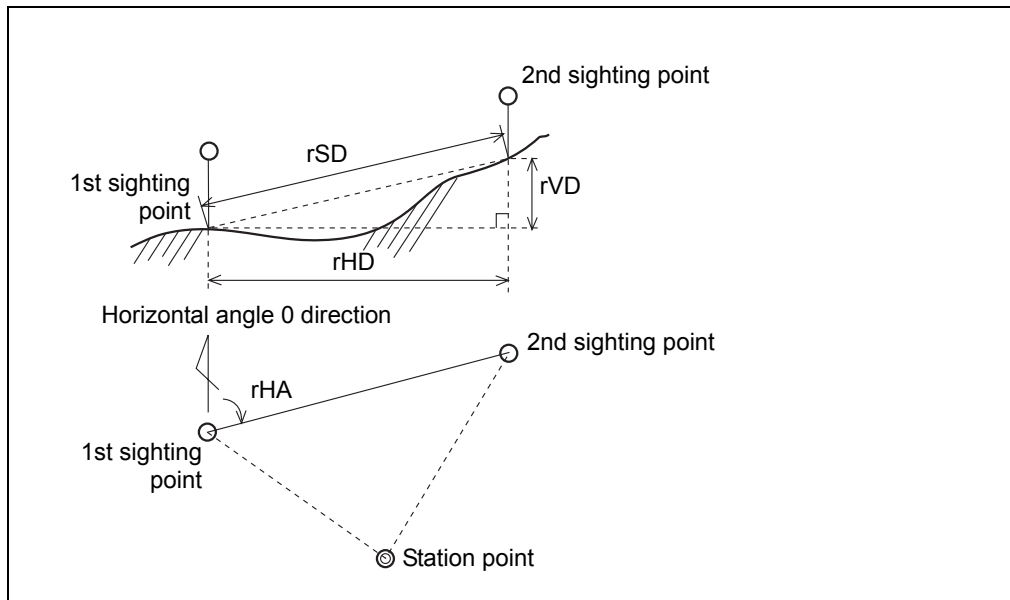


rSD	Slope distance between two points
rHD	Horizontal distance between two points
rVD	Vertical distance between two points
rV%	Percentage of grade $(rVD/rHD) \times 100\%$
rGD	Vertical grade $(rHD/rVD) : 1$
rAZ	rAZ Azimuth from first point to second point

Measuring between the current point and the first point measured

- To enter the RDM (Radial) function, press [3] or select RDM(Radial) in the Programs menu.
- Sight the first point and press [MSR1] or [MSR2].

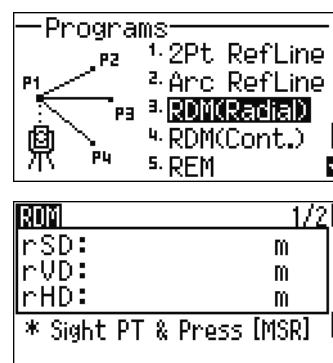

The distance from the station point to the first point appears.

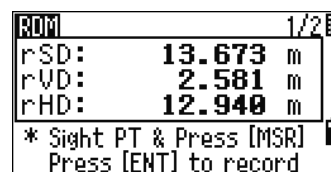


3. Sight the second point and press [MSR1] or [MSR2]. The distances between the first and second point are displayed


rSD Slope distance between two points
 rVD rVD Vertical distance between two points
 rHD rHD Horizontal distance between two points

4. To change display screens, press [DSP].


rAZ Azimuth from first point to second point
 rV% Percentage of grade (rVD/rHD) × 100%
 rGD rGD Vertical grade (rHD/rVD): 1

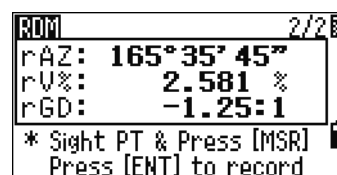

5. To record the distance and angle information as a comment record, press [ENT] in the 1/2 or 2/2 observation screen.

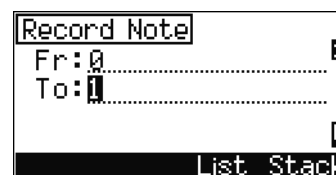



Default point numbers are displayed. You can change these point numbers. To record a note, press [ENT] in the To field.

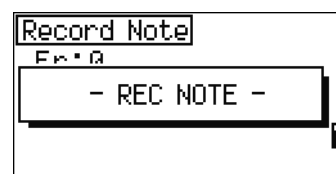


Data that you save in RDM functions is stored in RM records. For more information, see [RM records, page 123](#). When you download data in Nikon RAW format, they are output as comment (CO) records.

Measuring between the current point and the immediately preceding point



1. To enter the RDM (Continuous) function, press **[4]** or select **RDM(Cont.)** in the Programs menu.
2. Follow the procedure as for a radial RDM measurement. For more information, see [Measuring between the current point and the first point measured, page 80.](#)

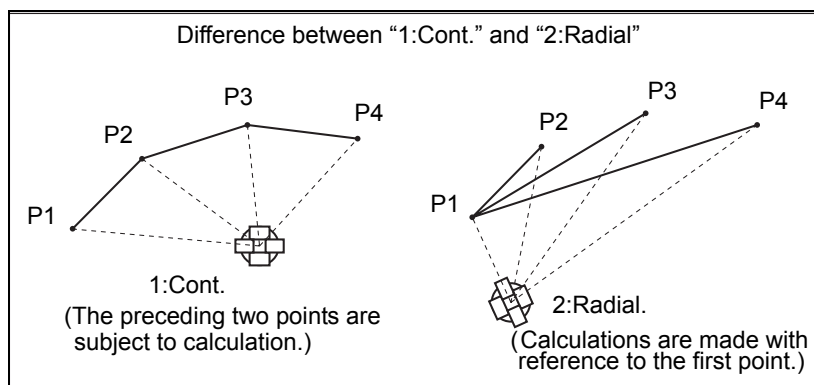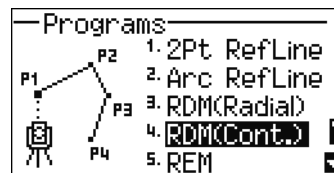

Measuring remote elevation

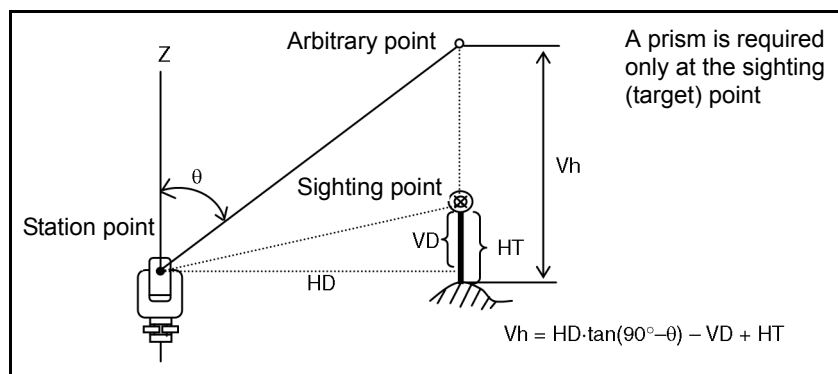

1. To enter the Remote Elevation Measurement function, press **[5]** or select **REM** in the Programs menu.
2. Enter the height of target.

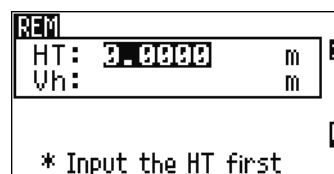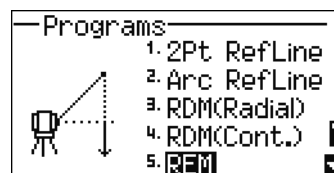

3. Sight the target point and press [MSR1] or [MSR2].

REM	
HT:	1.7746m
Vh:	m
* Sight a point and Press [MSR]	


4. Loosen the vertical clamp and then turn the telescope to aim at an arbitrary point.

The difference in elevation (Vh) appears.

REM	
HT:	1.7746m
Vh:	2.0753m
* Press [ENT] to update Height of Target	

You can use an REM measurement to update the height of target. Take a measurement to the prism, sight the bottom of the prism pole and then press [ENT].

Measuring distance and offset values on the vertical plane

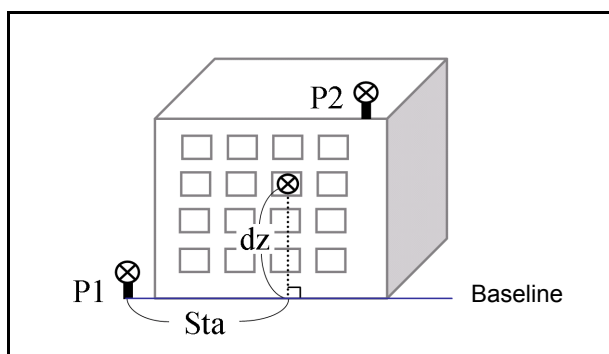

1. To enter the 2-Pt Reference Plane function, press [6] or select U-Plane in the Programs menu.

Programs	
1. P1	6. U-Plane
2. P2	7. S-Plane

2. Enter two points to define the plane.
 - To enter the point by direct measurement, press the MsrPT softkey.

Input Plane P1	
P1:	
P2:	
MsrPT	List Stack
HA:	147°29'11"
VA:	90°27'48"
SD:	m
HT:	1.5555 m
* Sight PT & Press [MSR]	
HT	

When you press the MsrPT softkey, a temporary observation screen appears.

3. Press [MSR1] or [MSR2]. The Record PT screen appears.

4. Enter a value in the PT and CD fields. Press **[ENT]**.

N:	567.3080
E:	-121.1467
Z:	0.5800
PT:	56
CD:	CURB
List Stack	

5. Enter the second point on the vertical plane.
Press **[ENT]**.

Input Plane P2	
P1:	56
P2:	
MsrPT List Stack	

Once the plane is defined, the calculated Sta and dZ values are updated as you move the telescope. No distance measurement is required.

Sta Horizontal distance from P1 to the target point along the baseline
dZ Vertical distance from P1 to the target point

V-PLN 1/3	
Sta:	55.2618m
dZ:	-3.0477m
* Sta: Distance from P1 along the P1-P2 Line	

Using **[DSP]** to switch between display screens

Press **[DSP]** to switch between the plane display screens. The following screens are available:

PLN1

Sta
dZ

PLN2

X
Y
Z

PLN3

HA
VA

Every time you press **[DSP]**, the next screen appears. If you press **[DSP]** in the last screen (PLN3), the PLN1 screen appears.

To record the point, press **[ENT]** on any screen (V-PLN1/3 to V-PLN3/3).

Enter PT and CD and then press **[ENT]**.

HA:	40°29'11"
VA:	89°07'46"
SD:	79.4028m
PT:	70
CD:	KERB
List Stack	


Sample records

CO, Vertical Ref Plane Pt1:516-A1 Pt2:530


CO, Sta=68.021 dz=17.459

SS, 30123-A48, 1.5480, 16.4020, 40.4720, 89.0730, 14:22:47,


Measuring distance and offset values on the slope

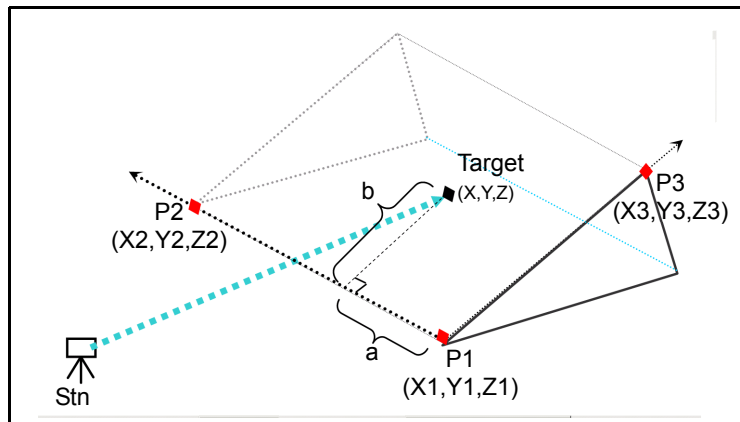


1. To enter the 3-Pt Reference Plane function, press **7** or select **S-Plane** in the Programs menu.

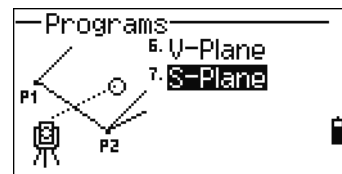

2. Enter three points to define the slope plane. To enter the point by direct measurement, press the **MsrPT** softkey.

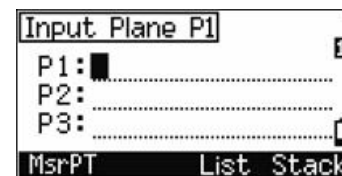


If you press **ENT** in a blank field, an input screen for temporary coordinates appears. These coordinates will not be stored.

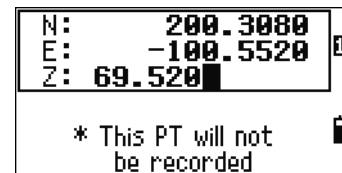

When you have entered the temporary coordinates, **<Keyed-in XYZ>** appears instead of the PT name.




If the plane is defined by two points (by selecting **2Pt**), the vertical plane is the same as the plane used in the V-Pln function, but the indicating factors are Sta and dZ, not a and b. For more information, see [Measuring distance and offset values on the vertical plane, page 83](#).

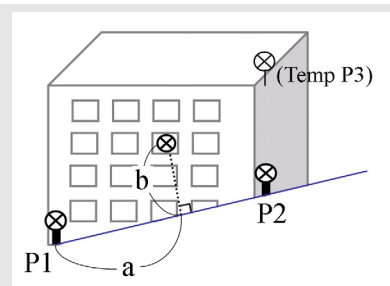


Once the plane is defined, the calculated a and b values are updated as you move the telescope. No distance measurement is required.

- a Distance between P1 and the point that is perpendicular to the target point along the P1-P2 line
- b Length of the perpendicular line from the target point to the P1-P2 line

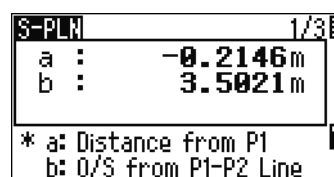

Using **[DSP]** to switch between display screens


Press **[DSP]** to switch between the plane display screens. The following screens are available:

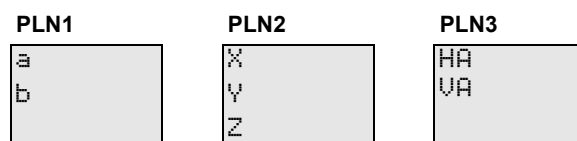

Every time you press **[DSP]**, the next screen appears. If you press **[DSP]** in the last screen (PLN3), the PLN1 screen appears.

To record the point, press **[ENT]** on any screen (S-PLN1/3 to S-PLN3/3).

Enter PT and CD and then press **[ENT]**.

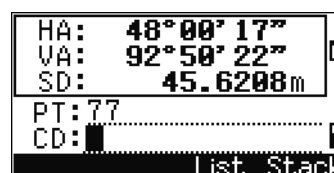

Sample records

CO,3ptPlane P1:1062 P2:2902 P3:1547

CO,a=31.497 b=14.239

SS,30123-A49,1.6110,0.0000,234.3210,86.0955,16:07:18,

Recording Measurement Data

Recording data from any observation screen

To record points on observation screens, press **[ENT]**.

PT defaults to the last recorded PT + 1.


You can enter the PT name from the point list or the point stack. For more information, see [Entering a point from the point list, page 47](#), and [Entering a point from the stack, page 47](#).

You can also use the code list or the code stack. For more information, see [Entering a code from the code list, page 48](#), and [Entering a code from the stack, page 48](#).



To record the point, press **[ENT]** on the last field.


When recording sideshots, stakeout records, and control shots from the Rept function, you can choose to store raw data only, XYZ data only, or both. For more information, see [Recording, page 120](#).

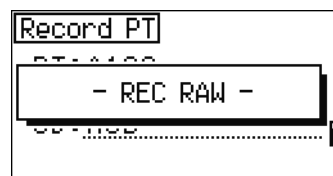

If HA or VA is moved after you take a measurement but before you press **[ENT]**, the angle recorded is the angle shown when **[ENT]** is pressed.

In an angle-only record, SD is always recorded as 0.0000.


If the point name that you want to record already exists in the job, an error message appears. Depending on the type of existing record, you can overwrite the old record with the new data. For more information, see [Recording Data, page 187](#).

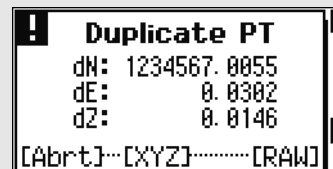

Hold down **[ENT]** for one second to record the measurement as a CP record.


Outputting data to the COM port

If you press **[ENT]** while the **[COM]** icon appears in an observation screen, a line of data is output to the COM port.

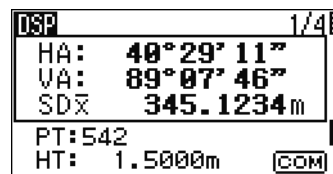

Note – If **[COM]** appears, data is **not** stored to the job when you press **[ENT]**.

The format of the output data is defined by the setting of the Ext.Comm field in **MENU > Settings > Comm**. For more information, see [Communications, page 118](#).

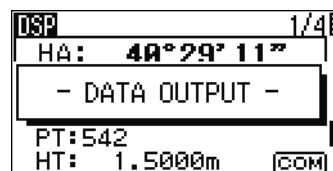

To output data on the COM port when you press **[ENT]**, set the Data Rec field in **MENU > Settings > Rec to COM**. For more information, see [Recording, page 120](#).



Sample output records through COM port

When the Ext.Comm field is set to **NIKON**:

TR PN: PT8 SD:000066626 HA:003856010 VA:008048500 HT:0000061757

(TR PN: point name SD HA VA HT; when ACK is returned, PN is incremented.)

When the Ext.Comm field is set to **SET**:


0006662 0804806 0394324 97

(SD VA HA Chk-SUM)


Measuring Offsets

Measuring taped offsets



1. To enter the taped offset function, press **[F1]** or select **Tape** in the Offset menu.

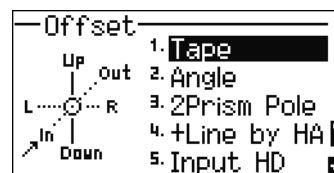


If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

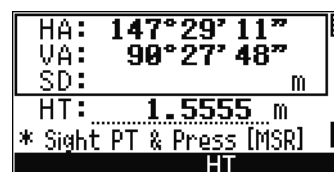

2. Sight the target and then press **[MSR1]** or **[MSR2]**.
3. Enter offset distances from the measured point. Use **[↑]** or **[↓]** to move to the appropriate offset field.

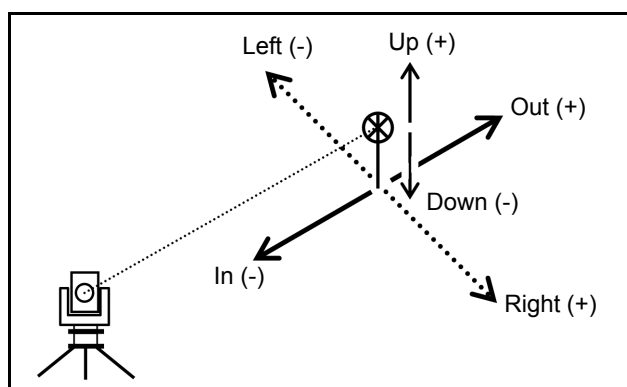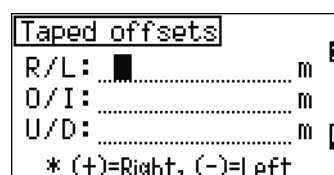


You can enter any combination of taped offset distances to specify the point.

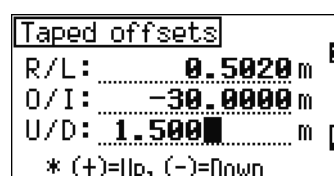

4. To go to the recording PT screen, press **[ENT]** in the last field.

The calculated coordinates are shown.

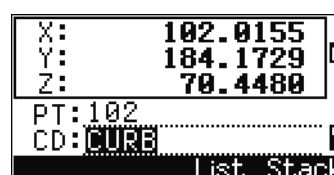


5. Enter a PT (and CD) value.
6. Press **[ENT]** to record the point.


Raw data is also recalculated, based on the taped offset value.

Measuring angle offsets


1. To enter the angle offset function, press **[2]** or select **Angle** in the Offset menu.

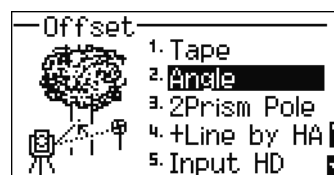

If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

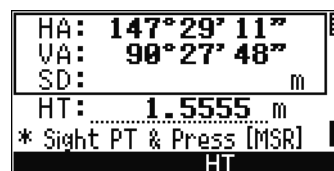

2. Sight the target and then press **[MSR1]** or **[MSR2]**.
3. To take the angle offset, rotate the alidade and telescope. The measured distance (HD) remains unchanged.
4. To record the offset point, press **[ENT]** or the **OK** softkey.

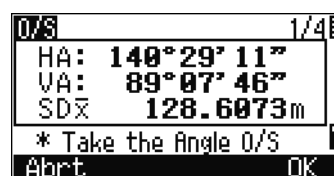

The XYZ data is also recalculated, based on the new angle.


You can record an angle offset in the Basic Measurement Screen (BMS). After taking a distance measurement, rotate the alidade and/or telescope. Then press **[ENT]** to record the measured distance with the updated angle value. If you use this method, the dimension of the angle offset is not stored as a CO record. To store the CO record, use the O/S function.

Two-prism pole


1. To enter the two-prism pole function, press **[3]** or select **2Prism Pole** in the Offset menu.



2. Sight the first prism and then press **[MSR1]** or **[MSR2]**.

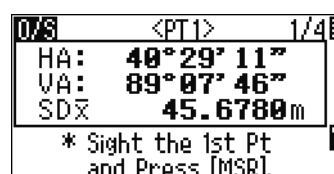

3. Sight the second prism and then press **[MSR1]** or **[MSR2]**.

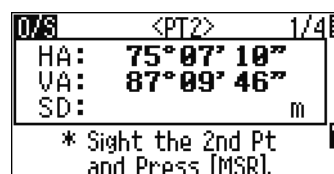

4. Enter the distance between the second prism and the target point. Alternatively, if you do not need QA information, you can leave the distance between the first and the second prism blank.
5. If you do enter a P1-P2 distance, the QA screen appears. Compare the entered value and the measured distance to check the accuracy of the observation.
6. To record the point, press **[ENT]** or the **OK** softkey.

Input Target	
P1-P2:	0.5000 m
P2-Tgt:	0.2500 m
* P1-P2 can be left blank.	

P1-P2 Dist	
Input:	0.5000 m
Measure:	0.4982 m
Redo	OK

Sample records

SS,14,0.0000,38.9200,271.0350,89.2630,11:04:15,DITCH


CO,2Prism O/S: P1-P2= 0.5090(0.5060) P2-Tgt= 0.5020

In this sample data, 0.5090 is the measured value. 0.5060 is the entered value.

Extending a line by horizontal angle offset

1. To enter the line extension (by HA) function, press **[4]** or select **+Line by HA** in the Offset menu.
2. Sight the first prism (or target) and press **[MSR1]** or **[MSR2]**.


The display moves to the next screen.

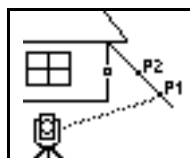

Offset	
1. Tape	
2. Angle	
3. 2Prism Pole	
4. +Line by HA	
5. Input HD	


0/8	<PT1>	1/4
HA: 40°29'11"		
VA: 89°07'46"		
SD: 45.6780 m		
* Sight the 1st Pt and Press [MSR].		

3. Sight the second prism (or target) and then press **[MSR1]** or **[MSR2]**.

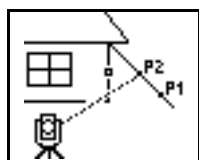

0/8	<PT2>	1/4
HA: 75°07'10"		
VA: 87°09'46"		
SD: m		
* Sight the 2nd Pt and Press [MSR].		

4. Sight the alternative place on the same vertical line as the required target point.

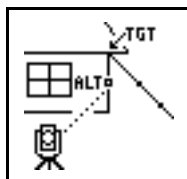

0/8	<ALT>	1/4
HA:	52°46'09"	
VA:	87°09'46"	
SD:		m
* Take a HA offset and Press [ENT]		

5. To calculate the coordinates and the raw data of the target point, press [ENT].
6. To record the point, enter a PT (and CD) value and then press [ENT]. The height of target is fixed to 0.0000 for the offset point.

HA:	40°29'11"
VA:	89°07'46"
SD:	79.4028m
PT:	70
CD:	KERB
List Stack	

Sample records

SS, 40, 0.0000, 48.3304, 169.20370, 82.02470, 10:52:37
 CO, PT1, 0.0000, 48.3020, 169.19165, 83.58565
 CO, PT2, 0.0000, 48.3155, 168.54250, 85.42440
 CO, O/S MSR:40 0.0000 0.0000 169.20370 87.02340



The calculated point (TGT) is stored as a SS record.

Measurements to the first and second target (P1 and P2) are stored as comment records (PT1 and PT2). The last record records the angle measurement to the ALT (vertically offset point from the actual target point).



Entering a horizontal distance after an angle-only shot

This function is useful when the instrument is very close to the point and it is difficult to take a measurement using the EDM.

1. To enter the Input HD function, press **[5]** or select **Input HD** in the Offset menu.

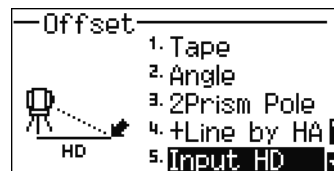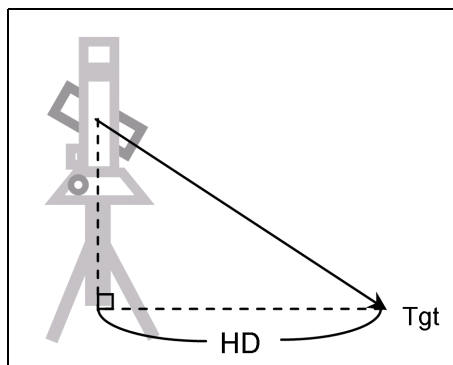

2. Turn the telescope in the direction of the point that you want to store.
3. Enter the HD. Usually this is the taped distance from the instrument point.
4. Enter a PT (and CD) value and then press **[ENT]**.
The target point is calculated and recorded as an SS record.

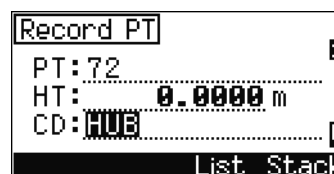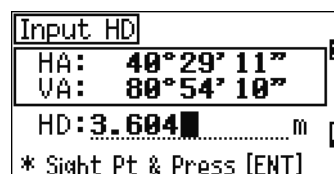


Sample records


SS,158,0.0000,77.0518,62.08380,108.06510,11:51:48,
CO, Input HD:76.1243

Calculating a corner point

1. To enter the corner point function, press **[6]** or select **Corner** in the Offset menu.
2. Take a distance measurement to the first prism (or target) on the wall. Press **[MSR1]** or **[MSR2]**.

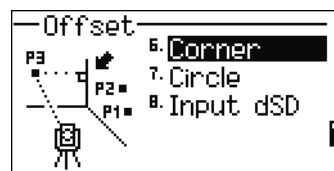


3. Sight a second point on the same wall with the first point measurement. Press [MSR1] or [MSR2].

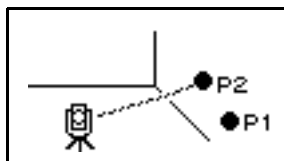

0/8	<PT1>	1/4
HA:	48°29'11"	
VA:	89°07'46"	
SD:	45.6780m	
* Sight the 1st Pt and Press [MSR].		

4. Sight the first point on the second wall. Press [MSR1] or [MSR2].

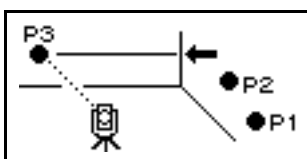


0/8	<PT2>	1/4
HA:	75°07'10"	
VA:	87°09'46"	
SD:	m	
* Sight the 2nd Pt and Press [MSR].		

5. If the two walls are at right angles, press the Calc softkey to calculate the corner point by three points.

0/8	<PT3>	1/4
HA:	94°01'32"	
VA:	87°09'46"	
SD:	m	
* Sight the 3rd Pt and Press [MSR].		

6. If you take a measurement to a fourth point, the corner point can be calculated as the intersection of two walls (P1-P2 and P3-P4). The default elevation is given by P4.

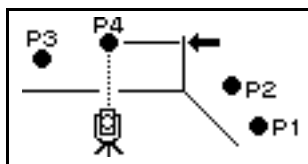

0/8	<PT4>	1/4
HA:	128°50'37"	
VA:	87°09'46"	
SD:	m	
MSR1 MSR2 DSP Calc		

7. Enter a PT (and CD) value. The height of target (HT) defaults to the value used in the last measurement.
8. To record the corner point, press [ENT].

Record PT		
PT:	A102	
HT:	1.7026 m	
CD:	HUB	
		List Stack

Sample records

SS, 58, 0.0000, 48.3304, 169.19165, 82.02470, 10:52:37, FLOOR2

CO, PT1, 1.0080, 48.3020, 169.19165, 83.58565

CO, PT2, 1.0080, 48.3155, 128.54250, 85.42440


CO, O/S MSR:40 0.0000 0.0000 169.20370 87.02340

The calculated corner point is stored as an SS record.


The next three or four comment records are measured points. For example:
CO, Point name (fixed to PT1, PT2 etc.), HT, SD, HA, VA.

Measuring circle offsets


1. To enter the circle center calculation function, press **7** or select **Circle** in the Offset menu.

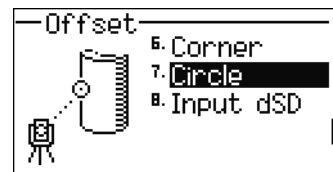

If you have not taken a measurement to the circle before entering this function, a temporary measurement screen appears.


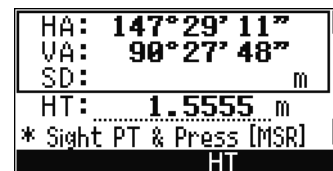


2. Sight any point on the surface of the circle and then press **MSR1** or **MSR2**.

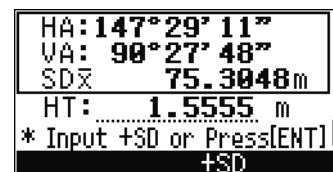

If you use a prism attached to the surface of the circle for the distance measurement, press the **+SD** softkey to eliminate the offset error (from the attached point to the measured surface of the prism) before you press **ENT**.



3. Sight one edge of the circle and then press **ENT**.

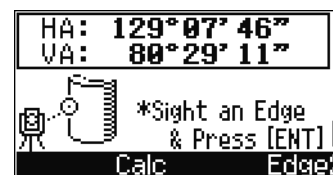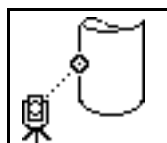

If you have taken a distance measurement to the center of the circle, press the **Calc** softkey to calculate the offset using one edge angle observation.


4. Sight the other edge of the circle and then press **ENT**.

The instrument calculates and records the center of the circle.

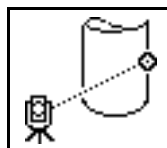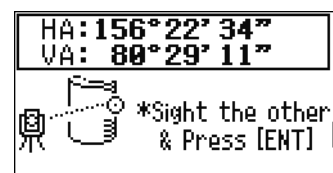

It also calculates the coordinates of the center point and the radius of the circle.

5. To record the point, press **ENT** or the **OK** softkey.

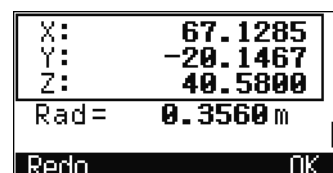

Sample records

SS,71,1.5000,37.0518,32.08380,81.06510,11:51:48,
 CO, PT1, 0.0000, 0.0000,47.05350, 83.58560
 CO, PT2, 0.0000, 0.0000, 29.53010, 83.58560
 CO,O/S MSR:71 1.5555 36.5418 38.28360 81.06510
 CO,Radius of circle 0.356
 CO,Input +SD:0.0020

The calculated point (center of the circle) is stored as an SS record.


The following one or two comment records are angle-measured points. For example:

CO, Point name (fixed to PT1/ PT2), HT(0.0000), SD(0.0000), HA, VA.


If you press the +SD softkey before you sight Edge1, the input value is recorded at the end.

Extending the slope distance


1. To enter the function for extending the slope distance, press **[8]** or select **Input dSD** in the Offset menu.

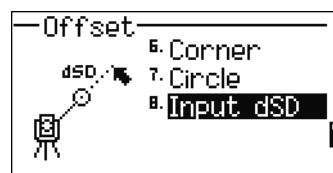

If you have not taken a distance measurement before entering this function, a temporary measurement screen appears.

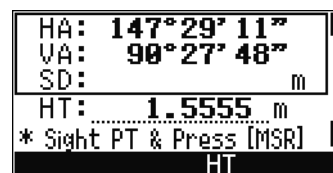

2. Enter the slope distance that you need to add or subtract. You can enter any value from -99.990 through +99.990 m (-328.000 through +328.000 ft).
3. To record the point, press **[ENT]**.

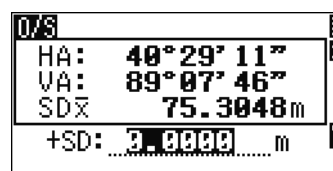**Sample records**

SS,83,1.5000,77.0518,62.08380,81.06510,11:51:48,
 CO,O/S MSR:83 1.5555 76.5518 62.08380 81.06510

Menu Key

In this chapter:

- [Introduction](#)
- [Job Manager](#)
- [Cogo](#)
- [Settings](#)
- [Data](#)
- [Communication](#)
- [1sec-Keys](#)
- [Calibration](#)
- [Time](#)
- [Removable Memory \(External Memory\)](#)

Introduction

Use the MENU screen to access important functions and settings.

To display the MENU screen, press the **[MENU]** key.



Job Manager

Use the job manager to open, create, delete, and manage jobs. To open the Job Manager, press **[1]** or select **JOB** on the MENU screen.

If there are jobs stored on the instrument, the job list appears, showing all the stored jobs. The newest job appears at the top of the list.

If there are no jobs stored, the Create Job screen appears. See [Creating a new job](#), page 99.



Opening an existing job

The job list shows all the jobs stored on the instrument, in descending date order.

The following symbols may be used to provide extra information about jobs:






Symbol	Meaning
*	Current job.
@	Control job.
!	Some of the job settings are different from the current job.

Press **[↑]** or **[↓]** to move up or down the job list. Press **[ENT]** to open the highlighted job.

When you open a job, all job settings are automatically changed to match those used in the open job.

Creating a new job

1. Press the **Cre**at softkey in the job list.
2. Enter a job name of up to eight characters. Press **[ENT]**.
3. Do one of the following:
 - To check the job settings, press the **Sett** softkey.
 - To create a new job using the current job settings, press **[ENT]** or the **OK** softkey.

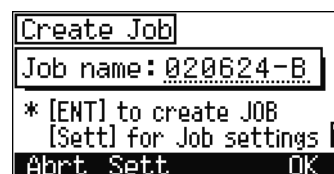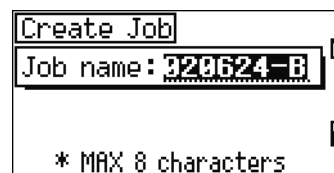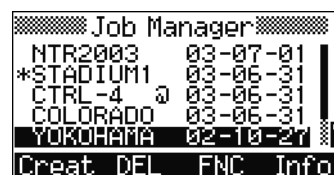


Job settings


The following parameters are set when a job is created, and cannot be changed. This ensures that the data in a job is correctly stored in the database, and that all necessary corrections are applied when you store each record.

Scale factor 0.999600 to 1.000400
 T-P correction ON/OFF
 Sea Level ON/OFF
 C&R correction ON/OFF


Angle unit DEG/GON/MIL
 Distance unit Metre/US-Ft/I-Ft
 Temp unit °C/°F
 Press unit hPa/mmHg/inHg

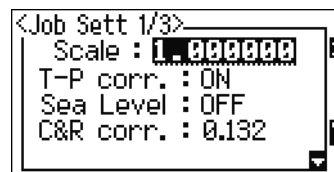

If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.

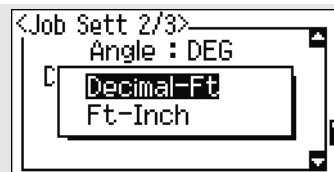

VA zero Zenith/Horizon/Compass
 AZ zero North/South
 Order NEZ/ENZ
 HA Azimuth/0 to BS

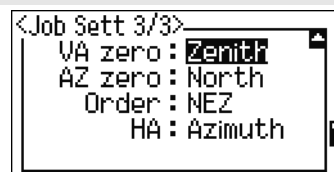

To move between fields, press **[↑]** or **[↓]**. Alternatively, to move to the next field, press **[ENT]**.

To change the setting in the selected field, press $\leftarrow$ or $\rightarrow$.

To confirm the job settings and create the job, press $\boxed{\text{ENT}}$ in the last field (HA).

These settings are separate from other temporary settings.

Deleting a job



CAUTION – There is no undelete function in the Job Manager. Before you press $\boxed{\text{ENT}}$ or select $\boxed{\text{DEL}}$, make sure that the selected job is the one that you want to delete.

1. In the job list, highlight the job that you want to delete.

```

Job Manager
NTR2003 03-07-01
*STADIUM1 03-06-31
CTRL-4 03-06-31
COLORADO 03-06-31
YOKOHAMA 02-10-27
Creat DEL FNC Info
  
```

2. Press the $\boxed{\text{DEL}}$ softkey. A confirmation screen appears.

```

Delete JOB
Job name: YOKOHAMA
* Are you sure?
Abrt DEL
  
```

3. Do one of the following:

- To delete the selected job, press $\boxed{\text{ENT}}$ or the $\boxed{\text{DEL}}$ softkey.
- To cancel the deletion and return to the previous screen, press $\boxed{\text{ESC}}$ or the $\boxed{\text{Abt}}$ softkey.

After you delete a job, the display returns to the job list.

```

Delete JOB
YOKOHAMA
- Deleting Job -
  
```


Setting the control job

If you search for a point when a control job is specified, and the system cannot find the point in the current job, the control job is also searched. If the point is found in the control job, it is copied to the current job as a UP record.

A control job has the same format as a standard job. You can open and modify it like any other job, and you can use it to record any measured data.


To set the control job:

1. Highlight the job that you want to use.
2. Press the **FNC** softkey. The FNC screen appears.
3. Press **1**. The Control Job screen appears.
4. Do one of the following:
 - To set the selected job as the control job, press **ENT** or the **Yes** softkey.
 - To cancel the process, press **ESC** or the **No** softkey.

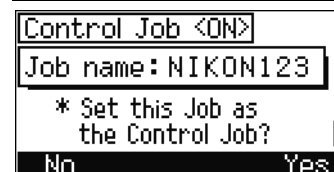

If a control job is already assigned, the newly assigned control job replaces it as the control job.

To clear the control job selected, highlight the current control job in the job list, press the **FNC** softkey and then press **1**. In the Control Job <OFF> screen press **ENT** or the **Yes** softkey to confirm.

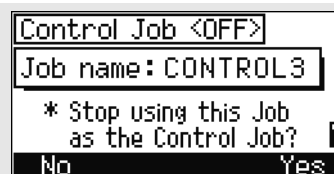

Displaying job Information

To display job information, highlight the job name and then press the **Info** softkey.

The Information screen shows the number of records in the job, the free space, and the date when the job was created. Free space indicates how many points can be stored in the job.

To return to the job list, press any key.




Importing a job

To import a job from the CompactFlash card or USB memory stick to the instrument:

1. In the job list press the FNC softkey. The FNC screen appears.




2. Press [2] or press [v] to move the highlight to Import Job (MEM->Inst.) and then press [ENT]. The CF Card (Job) screen appears. This screen displays the job list from the detachable memory.

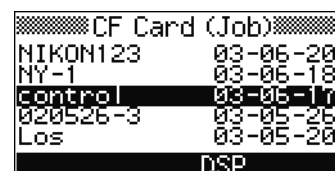

If both a CompactFlash card and a USB memory stick are inserted in the instrument, only the content on the USB memory stick will be displayed.


Note – To change the way in which the list is ordered (job name or created date), select the DSP softkey.

3. Press [v] to move the cursor to the job that you want to copy and press [ENT].
4. Verify the job name and then select the YES softkey to copy the job to the instrument. If the job contains a lot of records, the process may take a long time. A progress bar appears.

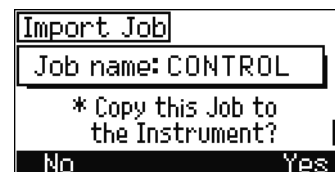

Select NO to cancel the process.

5. When the job has been copied, do one of the following:
 - To start working on the job immediately, select Yes.
 - To return to the menu screen, select Abt.

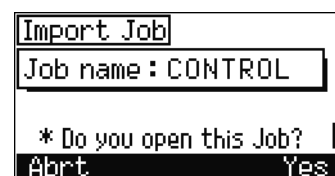

Exporting a job

If you want to keep a job file for future use, you can export the job file to a CompactFlash card or a USB memory stick.

To export a job:

1. Highlight the job that you want to export to the external memory device.



2. Press the FNC softkey. The FNC screen appears.




3. Press $\boxed{3}$ or press $\boxed{v}$ to highlight Export Job (Inst.-> MEM) and then press $\boxed{ENT}$. The Export Job screen appears.
4. Verify the job name and then select the YES softkey to export the job to the memory storage device. If the job contains many records, the process may take a long time. A progress bar appears.



Select $\boxed{No}$ to cancel the process.

Do NOT remove the external memory device (CF card or USB memory stick) while the progress bar is displayed.


5. When the job export is complete, the Delete JOB screen appears. Do one of the following:
 - To delete the job, select DEL.
 - To cancel the process, select Abt.

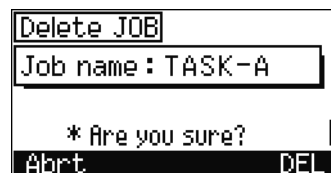

Cogo

Use the Cogo menu to perform coordinate geometry (COGO) calculations. You can access this menu at any time from any observation or PT input screen.

To open the Cogo menu, press [2] or select **Cogo** on the MENU screen.

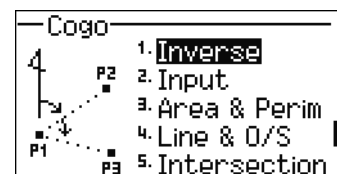

Calculating angle and distance between two coordinates



To open the Inverse menu, press [1] or select **Inverse** in the Cogo menu.

PT-PT inverse

PT-PT calculates the distance and the angle between two input points.


To calculate a PT-PT inverse:

1. Press [1] or select **PT-PT** in the Inverse menu.
2. Enter the first point number or name. Press [ENT].

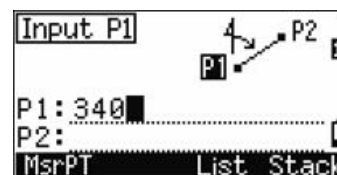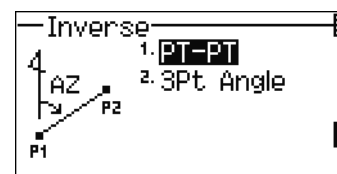



If you press [ENT] without entering a point name, a coordinate input screen appears, and you can enter coordinates. These coordinates are **not** stored to the database. If you want to store the point, specify a new point name.

3. Enter the second point number/name and press [ENT]. The **MsrPT** softkey allows you to shoot the point on the spot to use it in the calculation.

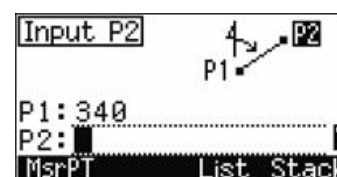

The azimuth, horizontal distance, and vertical distance from the first point to the second point are displayed.

4. Do one of the following:
 - To return to the PT input screen, press [ESC].
 - To return to the COGO menu, press [ENT].

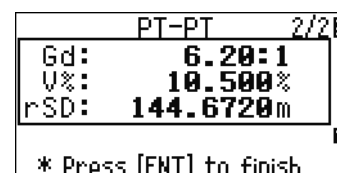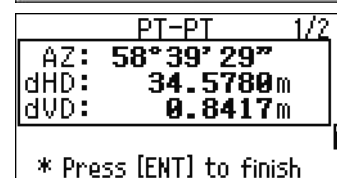

- To change the contents of the result screen, press [DSP].





GD Grade (HD/VD)
 V% 100/GD
 rSD Slope distance PT1 to PT2

3Pt angle

The 3Pt Angle function calculates the angle between two lines defined by three points.


To calculate a 3Pt angle:

1. Press [2] or select 3Pt Angle in the Inverse menu.
 P1 is the base point. Two lines are to be defined by P2 and P3, both from P1.
2. Enter the point name, or use the MsrPT softkey to take a measurement to the point.
3. Enter the second point (P2) to define the baseline (P1-P2). The angle (dHA) is measured from the baseline.
4. Enter the third point (P3) to define the second line (P1-P3).

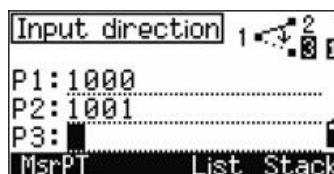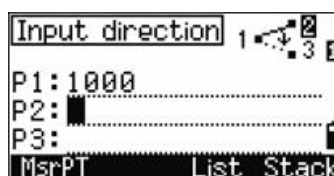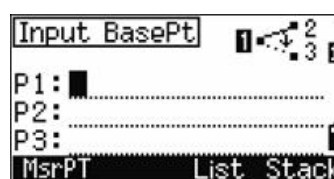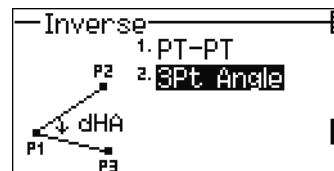


When you press the MsrPT softkey, a temporary measuring screen appears. Sight the target and press [MSR1] or [MSR2] to take a measurement.

After the measurement, a recording point screen appears. To store the measured point, enter the PT, HT, and CD values and press [ENT]. To use the point without recording it, press [ESC].

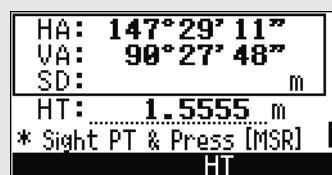

When you have entered three points, the instrument calculates the angle and distances.

5. Do one of the following:
 - To return to the Inverse menu, press [ENT].
 - To return to the Input BasePt screen, press [ESC].

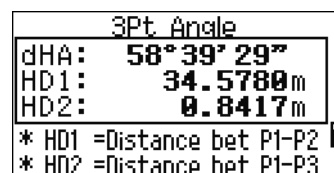

Calculating and manually inputting coordinates

To enter the Input menu, press **[2]** or select **Input** in the Cogo menu. There are three functions in this menu for recording new coordinate points.

Azimuth+HD input

To calculate a coordinate by an angle and distance input from the base point (P1), press **[1]** or select **AZ+HD** in the Input menu.

Enter the base point (P1). Enter the point name then and press **[ENT]**.






Enter the azimuth, horizontal distance, and vertical distance. Then press **[ENT]**.

To enter $123^{\circ}45'45''$, type 123.4545 and then press **[ENT]**.

If you do not enter a value in the dVD field, the value 0.0000 is used.

A recording point screen with the calculated coordinates appears. PT defaults to the last recorded PT + 1.


Press **[ENT]** to store the point.

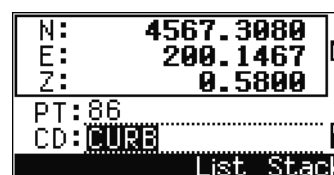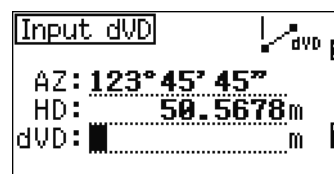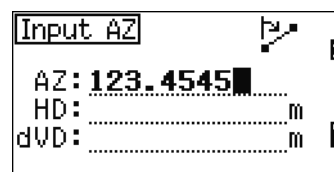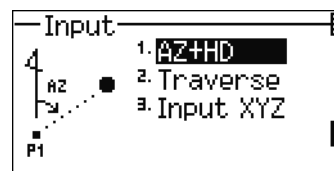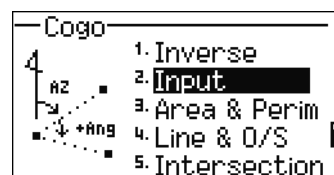

Traverse

To open the Traverse (2Pt Angle) function, press **[2]** or select **Traverse** in the Input menu.

Traverse function calculates a new point based on the two defined points and the angle, horizontal and vertical distances from the line that is defined by those two points.

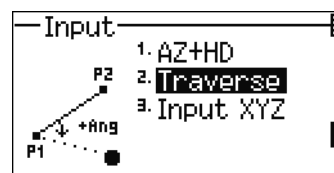

To enter P1 and P2, enter point names or take measurements to targets.

Enter the plus-minus angle, horizontal distance, and vertical distance from the baseline defined by P1-P2.

If you do not enter a value in the dVD field, the value 0.0000 is used.

When you press **[ENT]** in the dVD field, a new point is calculated. The PT name defaults to the last recorded PT + 1.

To record the new point and return to the point input screen, press **[ENT]**.

P1 (base PT) defaults to the previously recorded PT. P2 defaults to the previous P1.

To continuously calculate a new point, enter +Ang, HD, and dVD from the previous bearing line. This is a convenient way to enter Traverse points.

Entering coordinates

To manually enter the XYZ coordinates, press **[3]** or select **Input XYZ** in the Input menu.

The PT name defaults to the last recorded PT + 1.

Enter the coordinates using the numeric keys. To move to the next field, press **[ENT]** or **[V]** in a field

To store the point as an MP record and return to the point input screen, press **[ENT]** in the Z field. The default PT is incremented to the next value.

You can record NE, NEZ, or Z-only data to the database.

Calculating area and perimeter

To calculate an area or perimeter, press **[3]** or select **Area & Perim** in the Cogo menu.




To take a measurement, enter the first point and then press **[ENT]**, or press the **MsrPT** softkey.

In the upper right corner of the screen, a counter indicates how many points you have entered.

To input point numbers consecutively, use the **Fr/To** softkey. For more information, see [Advanced feature: Entering a range of points](#), page 109.

If you enter a new point name, you can enter new coordinates and record the point. If you do not want to record the point, press **[ENT]** without entering a value in the PT field. An XY coordinate input screen appears.


Continue to enter points until you have defined all the points in the lot. Then press **[v]** to calculate the area and perimeter.

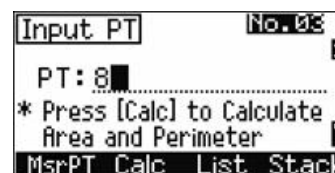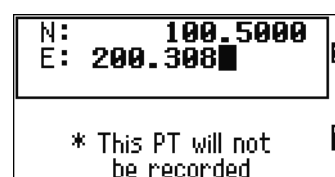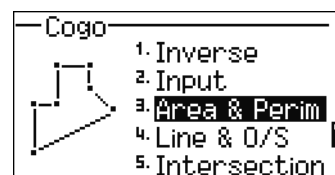

The first and last points that you enter are joined to close the area.
You must enter the points in the order in which they define the lot.
You can enter up to 99 points.


Do one of the following:

- Select the **END** softkey or **[ENT]** to display the confirmation screen for storing the result. A confirmation screen appears.
- Select the **Cont.** softkey or **[ESC]** to return to the Input PT screen to input a new point.

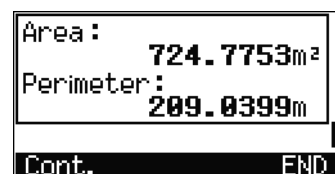

In the confirmation screen, do one of the following:

- To save the calculated values as an area (AR) record, select the **Yes** softkey or press **[ENT]** to open the Input Area name screen.
- To return to the Input PT menu without recording the results, select the **No** softkey.
- To cancel the process, press **[ESC]**.

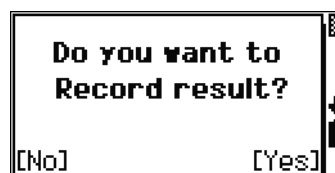

If you chose to store the area, enter a name to identify the area and then press **[ENT]**.

When you download data in Nikon RAW format, area (AR) records are output as comment (CO) records.

Advanced feature: Entering a range of points

To quickly enter a sequential range of points, use the range input function. To access this function, press the **Fr/To** softkey in the No. 01 or No. 02 input screens.

Enter the start point name in the Fr field and the end point name in the To field. You can include letters and hyphens in the point names, but the last character must be numeric.

Press **[ENT]** in the To field to start searching for matching points. The counter shows the number of matching points found.

When the search is complete, you are returned to the Input PT screen.

Press the **Calc** softkey to calculate the area and perimeter, or enter point names in the PT field.


Press **[ESC]** to return to the Input PT screen with the preceding point name.

Calculating coordinates from line and offset

To enter the Line & offset function, press **[4]** or select **Line & O/S** in the Cogo menu.

Enter the base point (P1).

Specify the azimuth bearing. To do this, enter a value in the AZ or P2 field. P2 is a second point on the line.

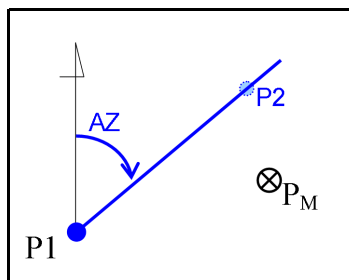

Enter the horizontal distance along the baseline (Sta), the horizontal distance perpendicular to the line (O/S), and the vertical distance (dVD).


Input P1	
P1:	P10
AZ:	
P2:	
MsrPT	List Stack

Input AZ or P2	
P1:	P10
AZ:	
P2:	

Line & Offset	
Sta:	50.5500 m
O/S:	7.2500 m
dVD:	
* dVD based on P1-Z	

A negative value in the Sta field means the opposite direction along the defined bearing line.

A negative value in the O/S field is for the left-hand side of the bearing line.

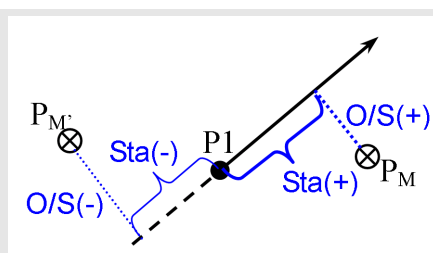


To calculate the coordinates of the point (PM), press **[ENT]** in the dVD field. You can change the Z coordinate here.

X:	4567.3080
Y:	200.1467
Z:	0.5800
PT:	86
CD:	CURE

To record the point, press **[ENT]** in the CD field.

X:	4567.3080
Y:	200.1467
Z:	
PT:	86
CD:	CURE
List Stack	

The coordinates are stored as a CC record. Line definition information and Sta, O/S, and dVD values are stored in comment (CO) records.

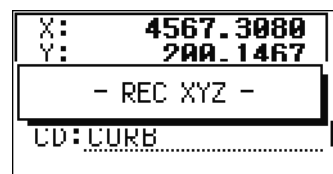





Calculating coordinates using intersection functions

To enter the Intersection menu, press **[3]** or select **Intersection** in the Cogo menu. There are four functions in this menu for calculating coordinates.

Calculating a bearing-bearing intersection

A bearing-bearing intersection is the intersection point of two lines.

1. To calculate a bearing-bearing intersection, press **[1]** or select **Brng-Brng** in the Intersection menu.
2. Enter the first point name and then press **[ENT]**. Alternatively, to measure directly to the point, press the **MsrPT** softkey.
3. Define the first line by azimuth.
4. To define the line by two points, press the **Pts** softkey. The **Fr** field defaults to the **P1** point, but you can change the selected point. In the **To** field, enter or measure to the second point.
For more information about the **O/S** softkey, see [Advanced feature: Entering angle and distance offsets, page 115](#).
5. Do one of the following:
 - To return to the previous screen, press **[ENT]**. The calculated value appears in the **AZ** field.
 - To go to the next screen, press **[ENT]**.

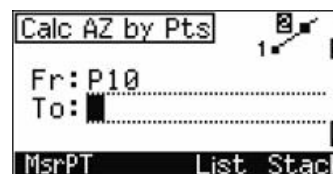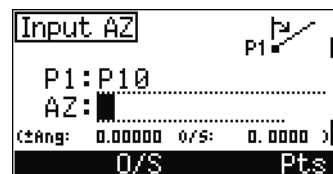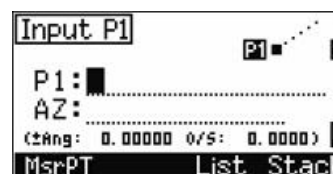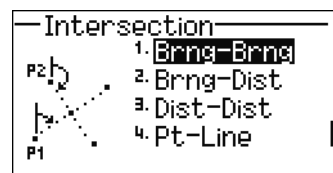

6. Define the second line by two points or by P2 and AZ.
7. To calculate the coordinates of the intersection point, press **ENT** in the AZ field.
The calculated coordinates are displayed. You can input a Z coordinate if necessary.
8. Enter a value in the PT field and in the CD field.
9. To record the point, press **ENT**.

Input AZ

P2: K52

AZ: 105.2648

(±Ang: 0.0000 0/S: 0.0000)

0/S Pts

X: 200.3080

Y: -64.2315

Z:

PT: 503

CD: CURB

Sample records

CO,Int BB P1:P10 AZ:330.54175-90.00000

CO, P2:408 AZ:100.0000+0.0000

CC,A123,,4567.3080,200.1467,-1.2056,POT

Calculating a bearing-distance intersection

1. Press **2** or select **Brng-Dist** in the Intersection menu.
Brng-Dist calculates the intersection point formed by one line and one distance (radius).
2. Enter a point on the line.
The line can be defined by two points or by a point and an azimuth.
3. Enter the second point (P2) as the center of the circle.
4. Enter the distance from P2.
 - To define the distance (HD) by two points, press the **Pt↔** softkey.
 - To calculate the coordinates of the intersection point, press **ENT** in the HD field.

Intersection

(P2) 1. Brng-Brng

2. Brng-Dist

3. Dist-Dist

4. Pt-Line

Input P1

P1: 4672

AZ:

(±Ang: 0.0000 0/S: 0.0000)

MsrPT List Stack

Input P2

P2:

HD: m

MsrPT List Stack

Input HD

P2: 71



HD: m

Pts

BRNG-DIST

Solution A X: 609.1207 Y: -57.0810

5. If there are two results, the first solution appears graphically relative to the P1-P2 line. To display the second solution, press $\leftarrow$ or $\rightarrow$.
6. To record the point, press $\boxed{\text{ENT}}$ when the required solution appears.
7. Enter a Z coordinate, if necessary.
8. To move to the PT and CD fields, press $\boxed{\text{ENT}}$.

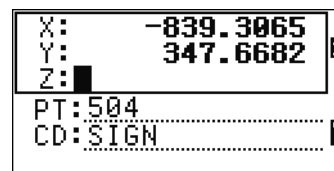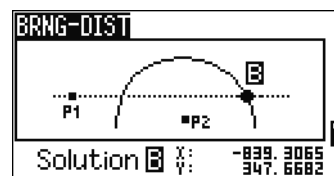

Sample records






CO,Int BD P1:4672 AZ:330.54175+0.00000

CO, P2:71 HD:100.0000

CC,504,, -839.3065,347.6682,,SIGN

Calculating a distance-distance intersection

1. Press $\boxed{3}$ or select Dist-Dist in the Intersection menu.
2. Enter the first point name and press $\boxed{\text{ENT}}$, or press the MsrPT softkey to measure directly to the point.
3. Enter the distance from P1 and press $\boxed{\text{ENT}}$.
4. To define the distance (HD) by two points, press the Pts softkey.
5. Enter P2 and the distance from P2 (HD).
6. To calculate the coordinates of the intersection point, press $\boxed{\text{ENT}}$ in the HD field.
7. Press $\leftarrow$ or $\rightarrow$ to display the second solution.
8. To record the point, press $\boxed{\text{ENT}}$ when the required solution appears.
9. Enter a Z coordinate, if necessary. Press $\boxed{\text{ENT}}$ to move to the PT and CD fields.

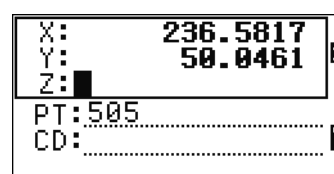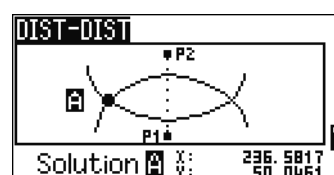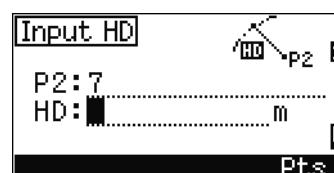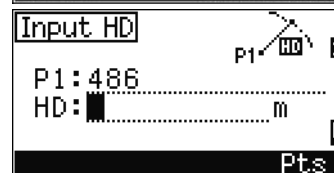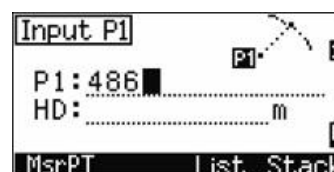

Sample records





CO,Int DD P1:486 HD:330.6020

CO, P2:7 HD:100.0000

CC,505,,236.5817,50.0461,0.0000,

Calculating a point-line intersection

1. Press **[4]** or select **Pt-Line** in the Intersection menu.
2. Enter the first point name and then press **[ENT]**, or press the **MsrPT** softkey to measure directly to the point.
3. Enter the azimuth, or press the **Pt≡** softkey to enter another point name on the line.
4. Enter the perpendicular point to the line, or press the **MsrPT** softkey to take a measurement to the point.
5. To calculate the coordinates of the intersection point, press **[ENT]**.
If P1 and P2 are 3D points, the Z coordinate of the perpendicular point is calculated relative to the P1-P2 slope.
6. Enter PT and CD then press **[ENT]** to record the point.

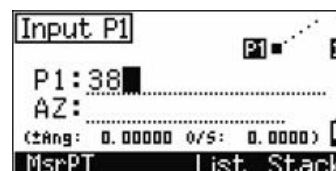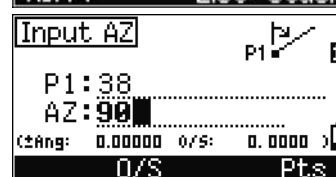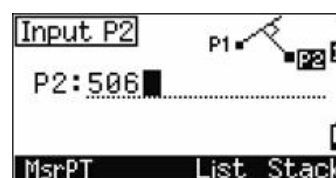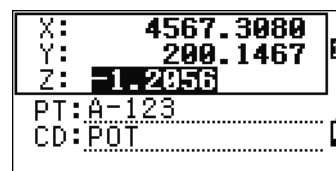



Sample records

CO,Int PtLine P1:38 AZ:90.00000+0.00000

CO, P2:506

CC,A-123,,4567.3080,200.1467,-1.2056,POT

Advanced feature: Entering angle and distance offsets

To display the offset input screen, press the O/S softkey.

Input AZ


P1: 38

AZ: 90.0000

(±Ang: 0.0000 O/S: 0.0000)

O/S Pts

In the Ang field, enter a positive value to rotate the line clockwise. Enter a negative value to rotate the line counterclockwise.

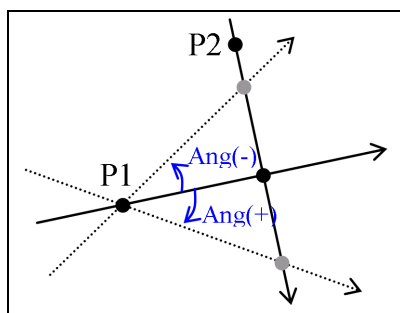


Input AZ

Offsets

±Ang: []

O/S: []

In the O/S field, enter a positive value to specify an offset to the right. Enter a negative value to specify an offset to the left.

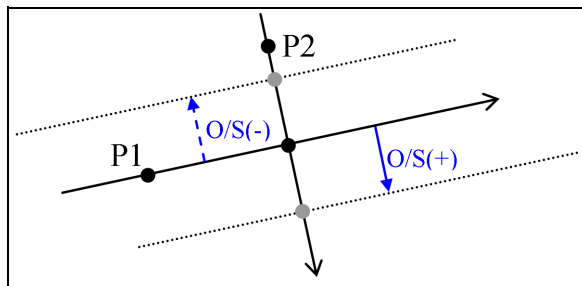

Settings

To display the Settings menu, press [2] or select Settings on the MENU screen.

Use this menu to configure the initial job settings.

Settings

1. Angle	6. Stakeout
2. Distance	7. Unit
3. Coord.	8. Rec
4. PwrSave	9. Others
5. Comm.	

Some job settings, specified in the following sections, cannot be changed once a job is created. If any of these settings are changed while a job is open, a confirmation screen appears, asking you to create a new job with the new settings, or to work with those settings without recording any data. For more information, see [Settings, page 188](#).

Job Settings will be changed


* Close the current Job?

[Abt] [OK]

Angle

To open the Angle menu, press [1] or select **Angle** in the Settings menu.

VA zero Zenith / Horizon / Compass

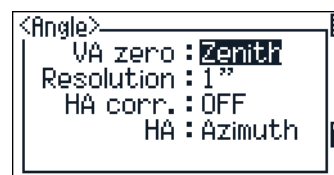

The VA zero job setting cannot be changed once a job is created.

Resolution 1"/5"/10" or 0.2 mgon/1 mgon/2 mgon
HA corr OFF/ON

When this field is set to ON, ACH and Trunnion axis compensation is applied to horizontal angle readings.

HA 0 to BS/Azimuth


The HA job setting cannot be changed once a job is created.

When this field is set to Azimuth, the horizontal angle (HA) that appears and recorded is in Azimuth value.
When this field is set to 0 to BS, HA is in HA zero to BS value.

Distance

To open the Distance menu, press [2] or select **Distance** in the Settings menu.

Scale Numeric value between 0.999600 and 1.000400
T-P corr ON / OFF
Sea Level ON / OFF
C&R corr OFF / 0.132 / 0.200

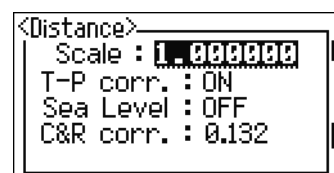

The Scale, T-P corr., Sea Level, and C&R corr. job settings cannot be changed once a job is created.

Temperature and Pressure corrections

SD Slope dist. (before adj.)
SD' Slope dist. (after adj.)
K Compensation coefficient
P Pressure (hPa)
t Temperature (°C)

$$K = 275 - \frac{106 \times P \times \left(\frac{10000.0}{13.5951 \times 980.665} \right)}{273 + T}$$

$$SD' = \left(1 + \frac{K}{1000000} \right) \times SD$$


Sea Level correction

HD	Horizontal dist. (before adj.)
HD'	Horizontal dist. (after adj.)
Z _{STN}	Instrument-Z
R _e	6370 km

$$HD' = \frac{HD \times R_e}{R_e + Z_{STN}}$$

Curvature and Refraction correction

Because the surface of the earth is curved, the vertical difference (VD and Z) at the measurement point, as referenced to the horizontal plane, inevitably includes some error. This error is called **curvature error**. Also, because the density of the air surrounding the earth decreases with altitude, light is refracted at different rates at different altitudes. The error caused by this change in refraction is called **refraction error**.

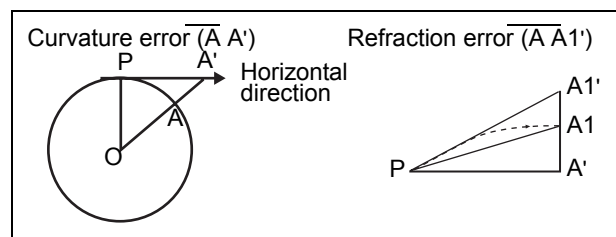

HD	Horizontal dist. (before adj.)
HD'	Horizontal dist. (after adj.)
VD	Vertical dist. (before adj.)
VD'	Vertical dist. (after adj.)
SD	Slope dist.
VA	Vertical angle
R _e	6370 km
k	C&R constant (0.132 or 0.200)


$$HD' = HD - \frac{SD^2 \sin(2VA)}{2R_e} \left(1 - \frac{k}{2}\right)$$

$$VD' = VD + \frac{HD^2}{2R_e} (1 - k)$$

Coordinate

To open the Coordinate menu, press [3] or select **Coord.** in the Settings menu.

Order	NEZ / ENZ
Lable	XYZ / YXZ / NEZ(ENZ)
AZ	North / South

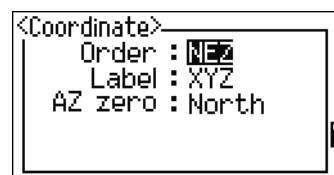


The Order and AZ job settings cannot be changed once a job is created.

Power saving

To open the Power Save menu, press [4] or select **Pwr Save** in the Settings menu.


Main Unit	OFF / 5min / 10min / 30min
EDM Unit	OFF/AtOnce/0.1min/0.5min/3min/10min
Sleep	OFF/1min/3min/5min

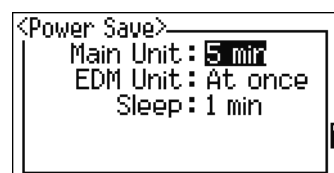

Communications

To open the Communication menu, press [5] or select **Comm.** in the Settings menu.


Ext.Comm	NIKON / SET
Baud	1200 / 2400 / 4800 / 9600 / 19200 / 38400 bps
Length	7 / 8
Parity	EVEN / ODD / NONE
Stop bit	1 / 2

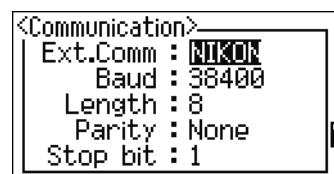

Stakeout


Press [6] or select **Stakeout** in the Settings menu to open the Stakeout menu.

Add PT	Integer between 1 and 999,999
--------	-------------------------------

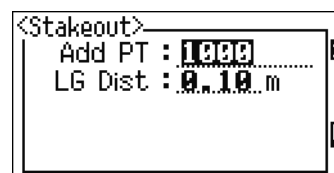

This field sets the default point number to record observed data in stakeout.

LG Dist	0 to 9.99 m (32.8 ft)
---------	-----------------------

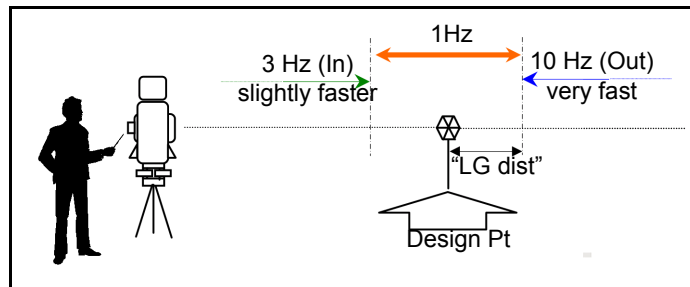


If SIGNAL-LOW is detected at the instrument, the Lumi-guide flashes very slowly (0.5 Hz).

The LG distance guide provides the rodman with approximate In/Out information to the design point in Stakeout, by changing the speed at which the Lumi-guide indicator flashes.

Unit

To open the Unit menu, press **[7]** or select **Unit** in the Settings menu.

Angle DEG (Degree) / GON /
 MIL (Mil6400)
Distance Meter / US-Ft / I-F

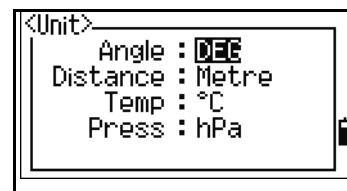

If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.



Temp °C (Celsius) °F (Fahrenheit)
Press hPa/mmHg/inHg

The Angle, Distance, Temp, and Press job settings cannot be changed once a job is created.

Recording

To open the Rec menu, press **[8]** or select **Rec** in the Settings menu.

Store DB RAW / XYZ / RAW+XYZ

This setting determines whether raw and/or coordinate data is stored when you record SS, CP, or SO records in the Basic Measurement Screen (BMS) or Stakeout screen

Rec LG ON/OFF

If you set this field to ON, when you record a point from the BMS, the Lumi-guide is turned on for two seconds.

Data Rec Internal / COM

Set this field to COM to output data on the COM port when you press **[ENT]** in the BMS or a Stakeout screen. The data is not stored to the job file. For more information, see [Outputting data to the COM port, page 87](#).



Others settings


To open the Others menu, press **[9]** or select **Other** in the Settings menu.

XYZ disp Fast / Norm / Slow / +ENT


Defines speed to move to the next screen after showing XYZ of the input PT

2nd Unit None / Meter / US-Ft / I-Ft

When the Secondary unit is set to a unit, an extra display screen is available in the BMS, stakeout observation screens, and 2-pt reference line screens. The extra screen shows the HD, VD, and SD in the secondary unit

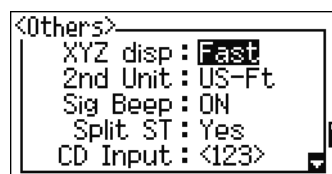

If you select US-Ft or I-Ft, an additional settings screen appears. Use this screen to specify whether to display values in Decimal-Ft or Ft-Inch.

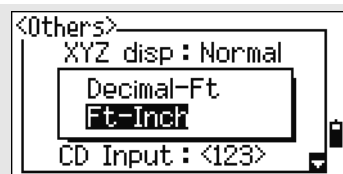


Sig Beep ON / OFF

Split ST No / Yes

Select Yes to separate the point numbers of station points from other record type point numbers

If you set the Split ST field to Yes, an additional setting screen appears. Use this screen to specify the starting ST number.

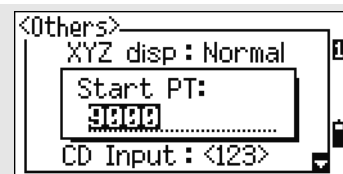

CD Input	ABC/123
	Sets the default input mode when a CD field appears.
Owner's Detail	Up to 20 characters
	Enter your name or the name of your company. If you enter a value in this field, it appears at start-up



Tip – To provide easier configuration for common regional settings, you can quickly configure the Nikon total station to a pre-set combination of default regional settings. For more information, see [Changing Regional Configuration Pre-sets, page 30](#).



Tip – The Nikon total station supports up to 3 languages on the instrument. For more information on changing the language settings, see [page 29](#).

Data

Use the Data menu to view or edit records. To display the Data menu, press **[4]** on the MENU screen.



Viewing records

You can view data at any time, even in an observation screen or while entering points.


Viewing raw data

To show the raw data records in a list, press **[1]** on the Data menu screen.

When you first view the raw data, the last four raw records in the current job are displayed. Use **[^]** or **[v]** to scroll through the records.

To see detailed information for the selected records, press **[ENT]**.

To return to the record list, press **[ESC]**.

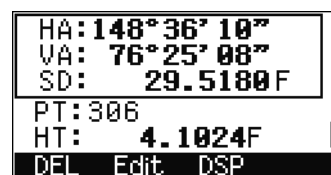

SS, CP, F1, F2 records

Raw SS, CP, F1, and F2 records contain PT, HT, CD, HA, VA, and SD fields.

SS records are sideshots (topo shots). All shots from the Basic Measurement Screen (BMS) are stored as SS records.

CP records are shots taken in the Angle or Repeat menus, or in the BMS. For more information, see [Recording a foresight point after repeat angle measurement, page 56](#), and [Recording data from any observation screen, page 86](#).

F1 and F2 records are Face-1 and Face-2 measurements.

When the Store DB setting is set to RAW+XYZ, press **[DSP]** to switch between the first screen (showing HA, VA, SD, PT, and HT) and the second screen (showing X, Y, Z, PT, and CD).

Coordinates are not available in F1 or F2 records.

When you take more than one measurement to the same point and choose to overwrite the XYZ data, the old raw record becomes raw data only. As a result, only one SS(RAW) record keeps its corresponding SS(XYZ) record. Other SS(RAW) records to the same point no longer have coordinates available.

ST records

ST (station) records contain ST, HI, BS, and AZ fields.

Press **[DSP]** to switch between the first screen (showing ST, HI, BS, and AZ) and the second screen (showing X, Y, Z, PT, and CD).

When you assign a new ST point name in MENU > Stn Setup > Quick, the coordinates of the station is recorded as (0, 0, 0).

SO records

SO records are stakeout shots. These are shots recorded in stakeout functions.


When the Store DB setting is set to RAW+XYZ, press **[DSP]** to switch between the first screen (showing HA, VA, SD, PT, and HT), the second screen (showing X, Y, Z, PT, and CD), and the third screen (showing dX, dY, dZ, PT, and CD).

The dX, dY, and dZ fields store the difference between the stakeout shot's actual position and its planned position. These fields are downloaded as comment records in Nikon RAW format.


CO records

A CO record is a comment added to the job from the system.

For example, when you change the Stn-Z using the Remote Benchmark function, or you reset the horizontal angle using the BSCheck function, the system writes a comment record.

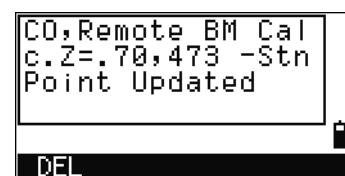

When you input a Stn-XYZ by Base-XYZ function, the recorded station appears as a comment record.

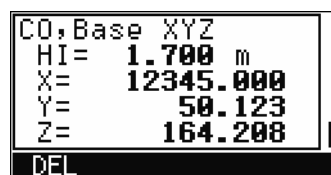

CO, Base XYZ
 HI= 1.700 m
 X= 12345.000
 Y= 50.123
 Z= 164.208
 DEL

SY records

When you complete a station setup, an SY record is stored. This record contains the Temperature, Pressure, and Prism Constant values.




CO,
 Temp: 58°F
 Press: 29.9 inHg
 Prism: 0 mm
 DEL

RM records


When you record measurements in RDM (Cont) or RDM (Rad), they are labeled as RM records.

Each RM record consists of two screens.

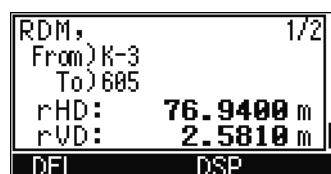

RDM, 1/2
 From: K-3
 To: 605
 rHD: 76.9400 m
 rVD: 2.5810 m
 DEL DSP

Press **[DSP]** to switch between the first screen (showing From, To, rHD, and rVD) and the second screen (showing rAZ, rSD, rV%, and rGD).

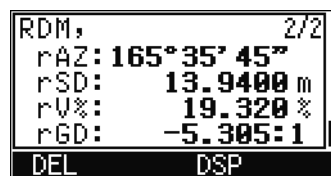


RDM, 2/2
 rAZ: 165°35'45"
 rSD: 13.9400 m
 rV%: 19.320%
 rGD: -5.305:1
 DEL DSP

When you download data in Nikon RAW format, RM records are output as comment (CO) records.

AR records

An AR record stores an area and perimeter calculation.

When you download data in Nikon RAW format, AR records are output as comment (CO) records.

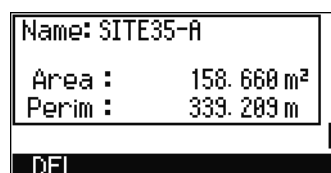

Name: SITE35-A
 Area: 158.660 m²
 Perim: 339.209 m
 DEL

View coordinate data

When you press **[2]** or select **XYZ data** in the Data menu, coordinate data appears in a list, with the newest record at the bottom of the screen. Use **[↑]** or **[↓]** to scroll through the records. Use **[←]** or **[→]** to move up or down one page.



XYZ
 MP, 54, KERB
 UP, 2001
 UP, 2002
 UP, 2003, MANHOLE
 UP, 2004
 DEL Edit Srch Input

Press **[ENT]** to see more detailed information about the selected record.

N:	-501.3846
E:	-200.1467
Z:	29.5180
PT:	2004
CD:	
DEL	Edit

The header (XYZ, YXZ, NEZ, or ENZ) depends on the Coord. Label setting in **MENU > Settings > Coord.** For more information, see [Coordinate, page 118](#).

UP, MP, CC, and RE records

All coordinate records contain PT, CD, X, Y, and Z fields.

UP records are uploaded point coordinates. MP records are manually input point coordinates. CC records are points calculated in Cogo, and RE records are points calculated in Resection.

When the Store data setting is set to RAW+XYZ or to XYZ, shots in the BMS (SS records), in various O/S functions (SS records), in 2Pt-RefLine and Arc-RefLine in PRG (SS records) and in some Stakeout functions (SO records) store coordinate records as well. The format of the data is the same as other coordinate records.

View records by station

To view records by station, press **[3]** or select **ST->SS/SO/CP** in the Data menu.

Data	
1.	RAW data
2.	XYZ data
3.	ST->SS/SO/CP
4.	PT name List
5.	Code List

A list of all stations appears.

Use **[^]** or **[v]** to highlight the station name that you want to view. Use **[<]** or **[>]** to move up or down one page.

Station	
ST, 9000	
ST, 9001	
ST, 9002	
ST, 3500	
ST, 3501	
DEL	Edit Srch

To view detailed information about the selected station, press **[ENT]**.

ST: 3501
HI: 1.8433m
BS: 3500
AZ: 0°00'00"
* [ENT] to view SS/SO/CP
DEL Edit DSP

To display all the observation data from the selected station in chronological order, press **[ENT]** again.

Observation	
SS, 1,	
CP, 2, CT	
SS, 3,	
SS, 4,	
SO, 1005,	
DEL	Edit Srch

Detailed data is as for raw data. For detailed information about each point type and format, see [Viewing raw data, page 121](#).

Deleting records

Deleting raw records

In the RAW screen, use $\uparrow$ or $\downarrow$ to highlight the record that you want to delete. Then press the DEL softkey.




A confirmation screen appears. To delete the selected record, press ENT or the Yes softkey.



If the Store DB setting is set to Both, the system also deletes the corresponding coordinate data when you delete an SS, SO, or CP record.

You can also delete raw data by pressing the DEL softkey in the detailed display screen for the record.

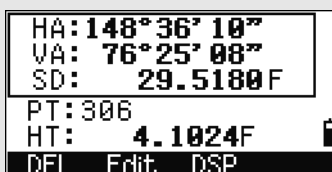

Deleting coordinate records


In the XYZ screen, use $\uparrow$ or $\downarrow$ to highlight the record that you want to delete. Then press the DEL softkey.




A confirmation screen appears.

To delete the selected record, press ENT or the Yes softkey.


To cancel the deletion of data, press ESC or the No softkey.

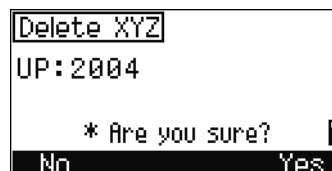

You can also delete coordinate data by pressing the DEL softkey in the detailed display screen for the record.

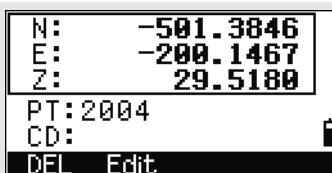

If the record that you want to delete is referred by an ST record, a confirmation message appears.

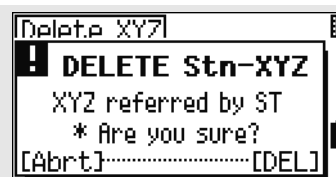


Deleting station records

In the Station screen, use **[A]** or **[V]** to highlight the record that you want to delete. Then press the **DEL** softkey.




A confirmation screen appears.

Press **[ENT]** or the **Yes** softkey to delete the selected record.

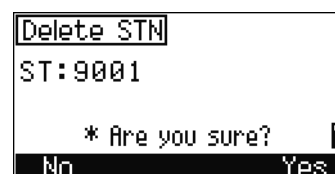


A reconfirmation screen appears. Press the **DEL** softkey to confirm deletion.

There is no undelete function on the instrument. Before you press the **DEL** softkey, make sure that you have selected the correct station record. You cannot press **[ENT]** in this screen.

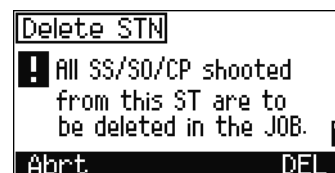

All observations from the station that you selected are deleted.

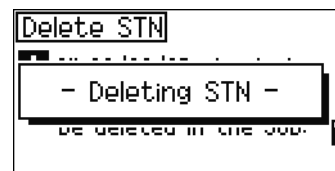

When you delete a ST record in the raw data view or the station data view, all the observation data from the station is also deleted.



Editing records

For any point record, you can edit the point name (PT), feature code (CD), height of target (HT), height of instrument (HI), backsight point (BS), and backsight azimuth (AZ).

You cannot edit the CD field for SO, F1, or F2 records.
You cannot edit the HA, VA, or SD values.


Editing raw records

1. Do one of the following:
 - In the RAW screen, highlight the record that you want to edit. Then press the **Edit** softkey.
 - In the detailed data screen, press the **Edit** softkey.
2. Use **▲** or **▼** to highlight a field. Then modify the value in the selected field.

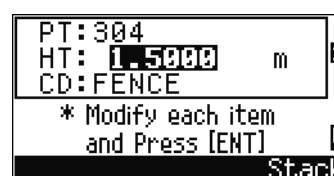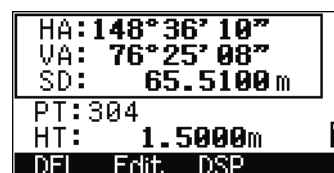

When you change the HT of an SS, SO, or CP measurement record, its Z coordinate is recalculated.

3. When you press **[ENT]** on the last line of the edit screen, a confirmation screen appears.
4. Do one of the following:
 - To accept the changes and return to the data view screen, press **[ENT]** or the **Yes** softkey.
 - To return to the edit screen, press **[ESC]** or the **No** softkey.


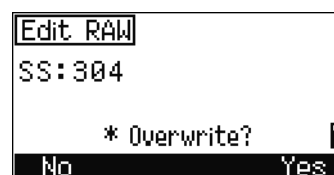


Editing coordinate records


You can edit PT, CD, and coordinate values in coordinate records.

You cannot edit the coordinate record for the current station.


1. Do one of the following:
 - In the XYZ screen, use $\uparrow$ or $\downarrow$ to highlight the record that you want to edit. Then press the **Edit** softkey.
 - In the detailed data screen, press the **Edit** softkey.
2. Use $\uparrow$ or $\downarrow$ to highlight a field. Then modify the value in the selected field.
3. To finish editing, press **ENT** in the CD field.

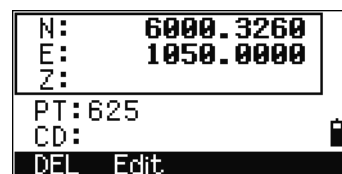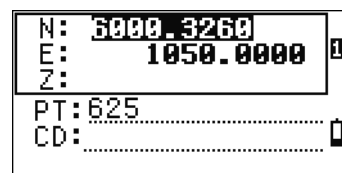A confirmation screen appears.

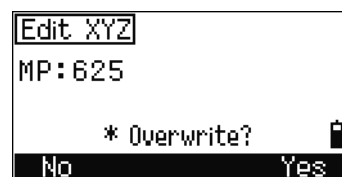

4. Do one of the following:
 - To accept the changes and return to the data view screen, press **ENT** or the **Yes** softkey.
 - To go back to the edit screen, press **ESC** or the **No** softkey.

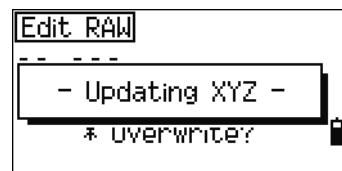

Editing station records

Note – The system will not recalculate measurements if you change the station record. All coordinate and raw data observed from an edited station record must be recalculated in your postprocessing software.

In the RAW screen, use $\uparrow$ or $\downarrow$ to highlight the station record that you want to edit. Then press the **Edit** softkey.



You can edit any field in the ST record, but the instrument does not recalculate any measurements from this station.

Press **[ENT]** in the AZ field to confirm the change.

If you change the ST or HI values, the coordinates of observation points are not recalculated. A comment record is stored to record the change. The following example shows a comment record for a changed HI value:

CO,HI changed at ST:9012 Old HI= 1.3456m

If you change the BS or AZ values, raw records are not recalculated. A comment record is stored to record the change.

Searching records

You can search for records by their type, point name, code, or by any combination of these values.

Searching raw records

In the RAW screen, press the **Srch** softkey to access the raw data search function.

To find a point by name, enter the name in the PT field and press **[ENT]** twice.

You can use the asterisk (*) as a wildcard. For example, when you enter 30* in the PT field, the search matches the points named 300, 301, 302, 3000A2, and 3010.

To search by point type, move to the Type field and use **[←]** or **[→]** to change the selected point type. The options are ALL, ST, SS, SO, CP, CO, CO(SY), and CO(RDM).

If you selected ST, SO, F1, or F2 in the Type field, you do not have to enter a value in the CD field. Press **[ENT]** in the PT field to start the search.

If you selected CO, CO(SY), or CO(RDM) in the Type field, you cannot enter a value in the PT or CD fields. Press **[ENT]** in the Type field to start the search.

If more than one point matches the search criteria, the matching points are displayed in a list.

Use $\uparrow$ or $\downarrow$ to highlight the point you want to use. Then press ENT to select it.

Detailed data for the selected record appears. Press the DSP softkey to change the fields shown.

Press ESC to return to the list.

```
SS, A57, FENCE
SS, 500, FENCE1
SS, 627, FENCE5
UP, 700, FENCE2
```

```
HA: 148°36'10"
VA: 76°25'08"
SD: 29.5180F
PT: A57
HT: 4.1024F
DEL Edit DSP
```

If no point matches the specified criteria, an error screen appears. Press any key to return to the data screen.

```
Search RAW
! PT Not Found
* Press any key
```

Searching coordinate records

In the XYZ screen, press the SRCH softkey to access the XYZ data search function.

```
XYZ
MP, 54, KERB
UP, 2001,
UP, 2002,
UP, 2003, MANHOLE
UP, 2004,
DEL Edit Srch Input
```

To find a coordinate by name, enter the name in the PT field and press ENT twice.

```
Search XYZ
Type: ALL
PT:
CD:
List Stack
```

You can use the asterisk (*) as a wildcard. For example, when you enter 500* in the PT field, the search matches the points named 500, 500-1, 500-A, and 5000.

```
Search XYZ
Type: MP
PT: 500*
CD:
List Stack
```

To search by point type, move to the Type field and use $\leftarrow$ or $\rightarrow$ to change the selected point type. The options are ALL, MP, UP, CC, and RE.

```
Search XYZ
Type: MP
PT:
CD:
```

If more than one point matches the search criteria, the matching points are displayed in a list.

Use $\uparrow$ or $\downarrow$ to highlight the point you want to use. Press ENT to select it.

Detailed data for the selected record appears. Press the DSP softkey to change the fields shown.

Press ESC to return to the list.

```

UP, 500, FENCE
UP, 500-1
UP, 500-2, MANHOLE
UP, 500-3
UP, 5000
UP, 5001, POLE
UP, 5002
  
```

```

X: 2000.2060
Y: 5000.0064
Z:
PT: 500
CD: FENCE
DEL Edit
  
```

If no point matches the specified criteria, an error screen appears. Press any key to return to the data screen.

```

Search XYZ
! PT Not Found
* Press any key
  
```

Entering coordinates

In the XYZ screen, press the Input softkey to display a new input point screen.

```

XYZ
UP, 2000, KERB
UP, 2001
UP, 2002
UP, 2003, MANHOLE
UP, 2004
DEL Edit Srch Input
  
```

The PT field defaults to the last recorded PT + 1, but you can change the value shown.

Enter the PT and CD and then press ENT to enter coordinates.

```

N:
E:
Z:
PT: 2005
CD:
  
```

Use the numeric keys to enter the coordinates. Press ENT or $\downarrow$ in each field to move to the next field.

When you press ENT in the CD field, the point is stored as an MP record.

```

N: 1407.3080
E: -200.1467
Z: 30.5800
PT: 2005
CD:
  
```

Once you record a point, the next point input screen is shown with the updated default PT.

```

N: 1407.3080
E: -200.1467
Z: 30.5800
PT: 2006
CD:
  
```

You can record NE, NEZ, or Z-only data to the database.

Point name list and code list

The instrument stores two list files: a list of PT names and a list of CD names. The structure and functionality of these files is the same.

- The **PT name list** is useful if you have to handle more than one patterns of point names in the field. For example, you may need to use points named 1, 2, 3 ..., as well as points named A1, A2, A3
- The **code list** is a prepared list of feature codes. You can use it to store your own codes.

Press **[4]** or select **PT name List** in the Data menu to open the point name list.

Press **[5]** or select **Code list** to open the code list.

The point or code names and layers are shown in alphabetic order. Use the four softkeys to customize the list.



You can store up to 254 points, codes, or layers in each list.

Each list entry can be up to 16 characters long.


You can use the first character search to find a point, code, or layer in the list. In the list screen, enter the first character of the name you want to find to jump to that part of the list. For more information, see [Advanced feature: Searching for a code by using the first character, page 49](#).

Deleting points, codes, or layers


In the point or code list, use **[^]** or **[v]** to highlight the item you want to delete. Then press the **DEL** softkey.



A confirmation screen appears. Press **[ENT]** or the **Yes** softkey to delete the item.

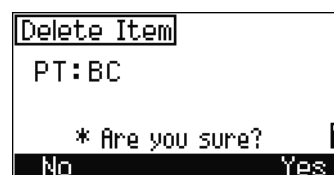

Press **[ESC]** or the **No** softkey to cancel the deletion.

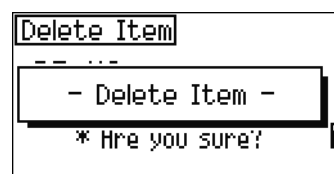


To delete a whole layer, highlight the layer name in the list and press the **DEL** softkey. All codes and layers in the selected layer are deleted.




Editing an item in the point list or code list

Use **▲** or **▼** to highlight the item that you want to edit. Then press the **Edit** softkey.

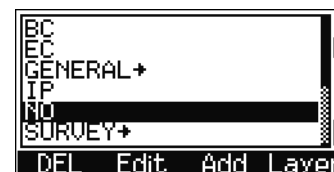


An editing screen appears. For points, the Edit Item screen appears. It contains only the PT field. For codes, the Edit Code screen appears, containing the CD field and the REC field.

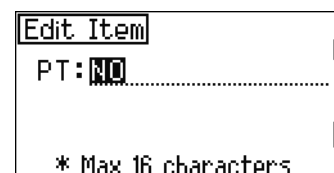



Edit the text shown and then press **ENT**.

A confirmation screen appears. Press **ENT** or the **Yes** softkey to accept the changes and update the list.

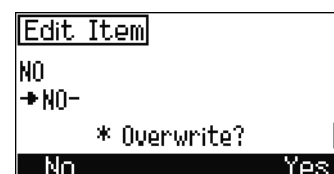

Edit code list

- The Edit Code screen has two fields. The CD field contains the text that appears in the list screen. The REC field is optional. It contains the text that is stored in the job. If you leave the REC field blank, the value in the CD field is used.
- You can use the REC field to use familiar words or codes on the screen, but store a numeric code in the job. For example, if you set the CD field to MANHOLE and the REC field to 1155, the text MANHOLE appears on the screen, but the code 1155 is stored.

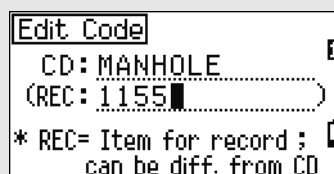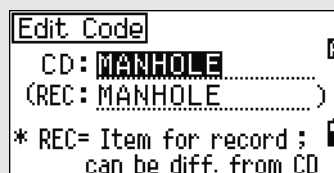

If you press the **Edit** softkey when a layer name appears, only the Lyr field appears. To save changes to the layer name, press **ENT** in the Lyr field.




Adding a point name

In the point list, press the **Add** softkey to add a new point name to the current layer.



Enter a new point name and then press **ENT**.

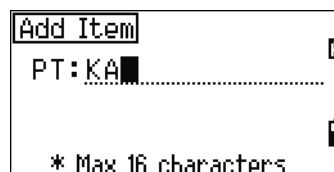

The point name is added to the current layer and the list is updated.




Adding a code


In the code list, press the **Add** softkey to add a new feature code to the current layer.



Enter the feature code in the CD field. Press **MODE** to change between alphabetic and numeric input mode.

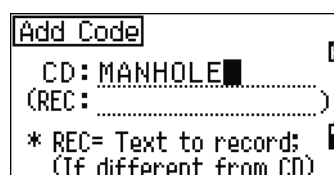

You can use the REC field to define a numeric identifier for each feature code. This is optional: If there is a value in the REC field, this value is stored. If you leave the REC field blank, the CD value is stored.

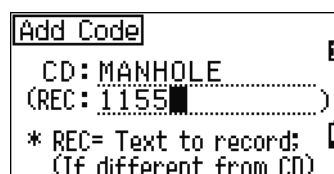


Press **ENT** to add the new code and update the code list.



Adding a layer

1. In the point or code list, press the **Layer** softkey.
2. Enter the name of the new layer.
3. To change between alphabetic and numeric input mode, press **[MODE]**. To store the new layer, press **[ENT]**.

The new layer is added to the list in alphabetic order.

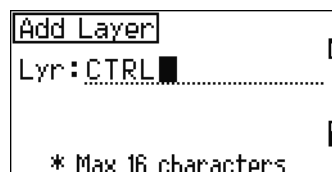


Communication

Use the Communication menu to download or upload data. To display the Communication menu, press **[5]** or select **Comm.** on the MENU screen.



Downloading data


To go to the download settings screen, press **[1]** or select **Download** in the Communication menu.

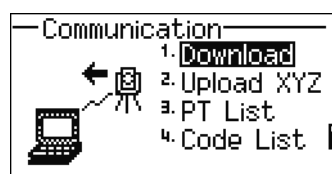


Format NIKON / SDR2x / SDR33
Data Raw / Coordinate



To display the total number of records that will be downloaded, press **[ENT]** in the Data field.

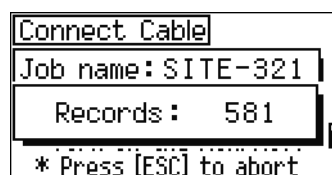


As each record in the current job is output from the instrument (downloaded), the current line number is updated.

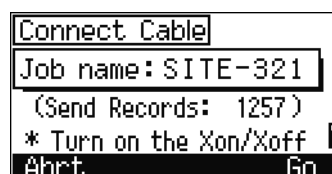


After downloading is completed, you can choose to delete the current job.

To delete the current job, press **[4]**. To return to the Basic Measurement Screen (BMS), press **[ESC]** or the **Abt** softkey.

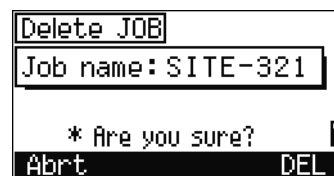


Uploading coordinate data

To upload coordinate data from a computer, press **[2]** or select **Upload XYZ** in the Communication menu.

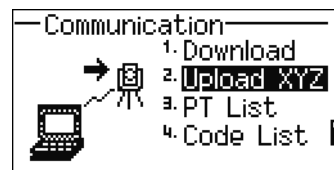

The default data format appears. To change the order of data fields, press the **Edit** softkey. For more information, see [Advanced feature: Editing the data order for upload, page 137](#).

Otherwise, just press **[ENT]**.

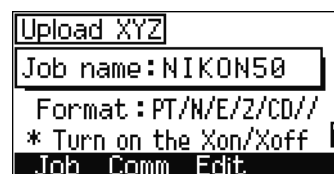

Press the **Job** softkey to go to the Job Manager screen. For more information, see [Job Manager, page 98](#).


To change the communication settings, press the **Comm** softkey and then select **Serial** or **CF/USB** in the I/O port field. The port settings must match the settings used by the terminal software on the computer.



Use an RS-232C cable to connect the instrument to the computer.

The Free space field shows the number of points that can be stored.

Press **[ENT]** to put the instrument in receive mode. Then use the Send Text File command in the terminal program on the computer to start sending data.

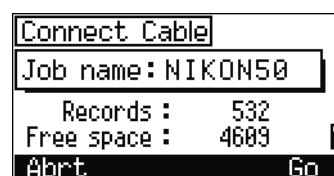

In the terminal program, set flow control to Xon/Xoff.

As each point is received by the instrument, the value in the Records field is incremented.

```

Connect Cable
Job name: NIKON50
Records: 581
* Press [ESC] to abort
  
```

If you press **[ESC]** during data upload, the upload is cancelled and the display returns to the Communication menu. Records that were received before you pressed **[ESC]** are stored in the job.

The system truncates any code that is longer than 16 characters.

Duplicate points

If the existing point is a UP, CC, or MP record, and it is not referred to by any ST or BS, it is automatically overwritten by the uploaded point. No error message appears.

Advanced feature: Editing the data order for upload

1. To open the Data Fields screen, press the **Edit** softkey.
2. To move between the fields, press **[←]** or **[→]**.
3. To change the selected item in a field, use the **[↑]** and **[↓]** softkeys. The options are PT, N, E, Z, CD, or blank.
4. To save your changes and return to the previous screen, press the **Save** softkey.

```

Connect Cable
Job name: SITE-321
(Send Records: 1257)
* Turn on the Xon/Xoff
Abrt      Go
  
```

```

Data Fields
PT N E Z CD
* [←]/[→] to move cursor
  [↑]/[↓] to change items
  [←] [→] Save
  
```

For example, if your original data is as follows:

1, UB, 30.000, 20.000, L1

and you set the data fields to PT N E CD, then the uploaded data is:

PT=1, N=30.000, E=20.000, CD=L1

Uploading coordinates without points

You can upload data without points. If you do not include a point in the format definition, each line of data is automatically assigned the next available point number. To help you to select points in the field, make sure that you store an identifier in the CD field.

The data format cannot include duplicate items. Use PT, N, E, Z and CD once each in the data format. To skip some items in your original file, set the corresponding field to blank.

Uploading a point name list or code list

When you upload a code list, it always replaces the existing code list on the instrument.

To upload a point name list by cable, press **[3]** or select **PT List** in the Communication menu.

To upload a code list, press **[4]** or select **Code List**.



Connect the RS-232C cable.

Start a terminal program on the computer.

To put the instrument into receive mode, press **[ENT]** or the **OK** softkey.

The counter is updated as each line in the list is stored.


You can store up to 254 codes or point names.

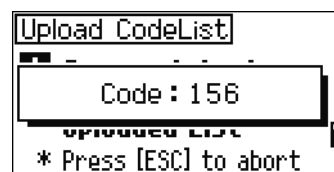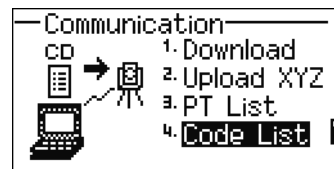

If a code or point name is longer than 16 characters, it is truncated.


1sec-Keys

Use the 1sec-Keys menu to configure the settings for the one-second keys, **[MSR]**, **[DSP]**, **[USR]**, **[S-O]**, and **[DAT]**. To access this menu, press **[6]** or select **1sec-Keys** in the MENU screen.

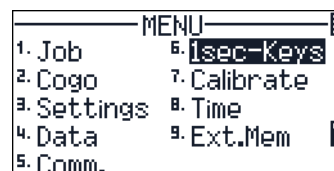


[MSR] key settings

To change settings for the **[MSR1]** and **[MSR2]** keys, press **[1]** or select **[MSR]** in the 1sec-Keys menu.

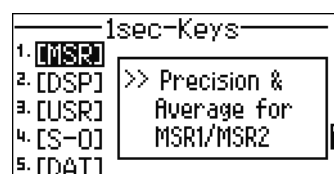


There are two **[MSR]** keys:

- To change the settings for the **[MSR1]** key, press **[1]** or select **MSR1**.
- To change the settings for the **[MSR2]** key, press **[2]** or select **MSR2**.

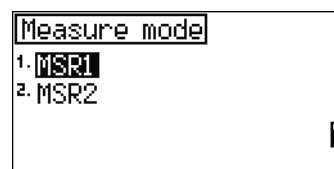

Each **[MSR]** key has five settings.


In the Const and AVE fields, use the numeric keys to enter values. In the other fields, use **[<]** or **[>]** to change the settings.

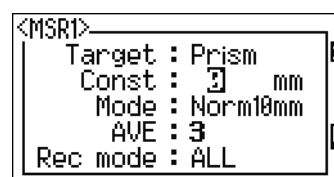

Tip – You can also access the settings screen by holding down **[MSR1]** or **[MSR2]** for one second.


[DSP] key settings

To change the display items in the BMS and in Stakeout observation screens, press **[2]** or select **[DSP]** in the 1sec-Keys menu.

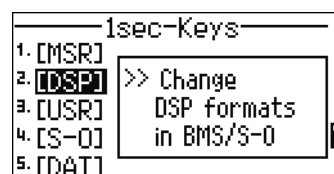

To move the cursor, use **[<]**, **[>]**, **[^]**, or **[v]**. To change the display item, press either the **[G]** softkey or the **[H]** softkey.


To save the changes, press **[ENT]** at the last line of **<DSP>** or press the **Save** softkey.

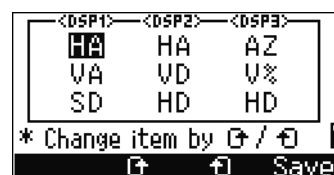

Tip – You can also access the DSP settings screen by holding down **[DSP]** for one second.


[USR] key settings

To change the functions that are assigned to the **[USR1]** and **[USR2]** keys, press **[3]** or select **[USR]** in the 1sec-Keys menu.

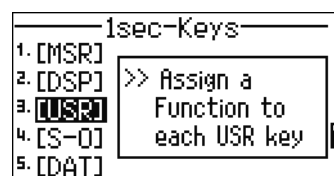


There are two **[USR]** keys. The function that is assigned to each key appears beside the key name.

- To change the settings for the **[USR1]** key, press **[1]** or select **USR1**.
- To change the settings for the **[USR2]** key, press **[2]** or select **USR2**.

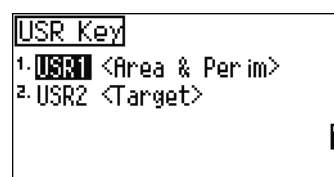


In the Select Functions screen, the asterisk (*) indicates the function that is currently assigned to the key.

To highlight a function, use **[^]** or **[v]**. To assign that function to the selected **[USR]** key, press **[ENT]**.

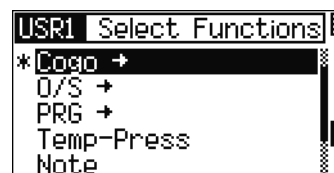


[S-O] key settings


To enter the Stakeout settings screen, press [4] or select [S-O] in the 1sec-Keys menu.

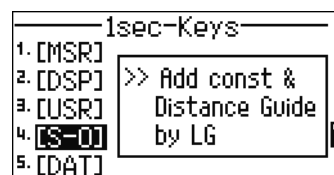

There are two Stakeout settings. For more information, see [Stakeout, page 118](#).

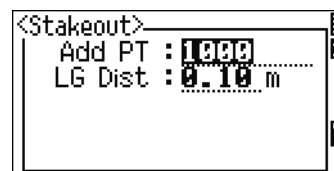
**[DAT] key settings**

1. To change the settings for the [DAT] key, press [5] or select [DAT] in the 1sec-Keys menu.

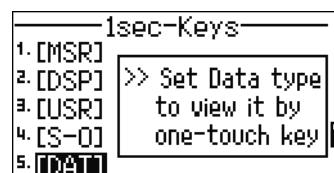


The asterisk (*) indicates the currently selected view format.

2. To move the cursor, use [^] or [v].
3. To change the format displayed by [DAT], press [ENT].

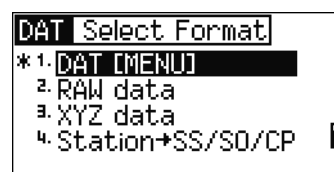**Calibration**

Use the Calibration screen to calibrate the instrument. To open the Calibration screen, press [7] or select **Calibrat.** on the MENU screen.


For more information, see [Adjusting, page 148](#).

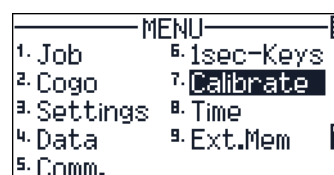

Time

Use the Date & Time screen to set the current date, time, and timezone for your area.


1. To open the Date & Time screen, press **[8]** or select **Time** on the MENU screen.

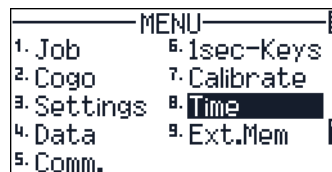

The current date and time settings are displayed.

2. Enter the date in Year-Month-Day format. For example, to change the date to June 18, 2002, press

[2][0][0][2][ENT][6][ENT][1][8][ENT].

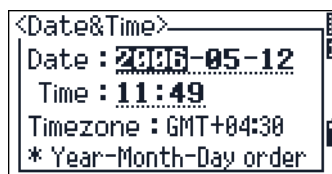


If the highlighted part of the field (for example, the year) is already correct, you can just press **[ENT]** to use the current value. For example, if the date is already set to June 24, 2002, and you want to change the date to June 18, 2002, press **[ENT][ENT][1][8][ENT]**.

3. To move to the Time field, press **[v]** or **[ENT]** in the Date field.

4. Enter the time in 24-hour format. For example, to set the time to 4:35 PM, press

[1][6][ENT][3][5][ENT].

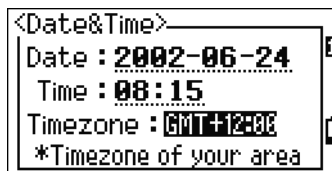

5. To move to the Timezone field, press **[v]** or **[ENT]** in the Time field.
6. Use **[>]** or **[<]** arrow key to select the required timezone.
7. Do one of the following:
 - To finish setting the date and time, press **[ENT]** in the Timezone field.
 - To cancel the input, press **[ESC]**.

The time-zone is derived from the operating system. You must set the time zone properly before using the system. If you do not do this, the time that is recorded in the removable memory (CF card and USB memory) will be different from the time shown on the instrument.

The time stamp of the Job file on the removable memory (CF card and USB memory) is controlled by the timezone (GMT).

Removable Memory (External Memory)

The removable memory (external memory) shows the list of all the job files that were recorded on the CompactFlash card or the USB memory stick.





If both an CompactFlash card and an USB memory stick are inserted in the instrument, only the content on the USB memory stick will be displayed.

The job files and other files that are shown in the list are recorded in the following folders on the removable memory device (CF card or USB memory):

- Job files are stored in \NTTS\JOBS
- Other files are stored in \NTTS

Displaying the external memory files

1. Press **[9]** or select **Ext. Mem** on the MENU screen. The CF Card (Job) screen appears. This screen shows all the job files that are currently on the removable device.
2. To view other files, select the **File** softkey to change the list.
To return to the CF Card (Job) screen, select the **Job** softkey.

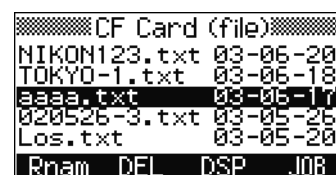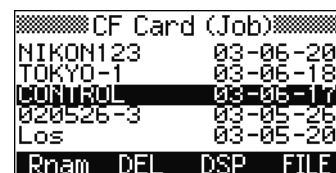


Note – When you have imported the file from the CF card to the instrument, you can open the job on the instrument.

Renaming a job or file on the removable memory

Do one of the following:

- Rename a job file from the CF Card (Job) screen.
- Rename a file from the CF Card (file) screen.

1. Press **[V]** or **[A]** to highlight the job or file that you want to rename.
2. Press the **Rnam** softkey. The Change Name screen appears showing the current name of the job or file.
3. Enter a new name and then press **[ENT]**.

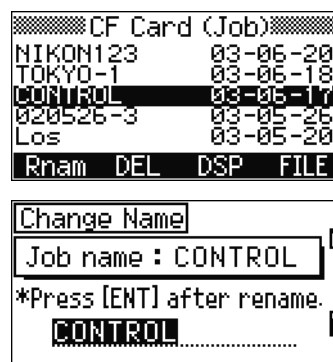

A **job name** may not be longer than 8 characters. A **file name** may not be longer than 12 characters—this includes the file extension.

You can not use a period in a job or file name.

Deleting a job of file from the removable memory



CAUTION – There is no undelete function in the External Memory. Before you select **DEL**, make sure that the selected job is the one that you want to delete.

1. Press **[V]** or **[A]** to highlight the job or file that you want to delete.
2. Press the **DEL** softkey. A confirmation screen appears.
3. Do one of the following:
 - To delete the selected job, the **DEL** softkey.
 - To cancel the deletion and return to the previous screen, press **[ESC]** or the **Abt** softkey.




After you delete a job, the display returns to the job list.

In the Delete screen you cannot press **[Ent]**. You must verify the file name and then press the **DEL** softkey.

Coping a job from the removable device


You can copy a job that is on the removable device to the instrument.

1. Press ∇ or $\wedge$ to highlight the job or file that you want to copy.

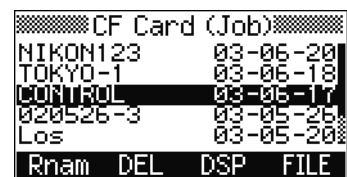

CF Card (Job)	
NIKON123	03-06-20
TOKYO-1	03-06-18
CONTROL	03-06-17
020526-3	03-05-26
Los	03-05-20
Rnam	DEL DSP FILE

2. Press **MENU** and then press **1**.

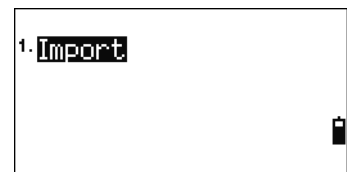

Changing the list view of files on the removable memory

CF Card (Job) screen

Press the **DSP** softkey to view the list in alphabetical order or in date order.

CF Card (File) screen

Press the **DSP** softkey to view the list in alphabetical order, in date order, or by file extension.

Checking and Adjustment

In this chapter:

- [Checking and Adjusting the Plate Level](#)
- [Checking and Adjusting the Circular Level](#)
- [Checking and Adjusting the Optical Plummet](#)
- [Zero Point Errors of Vertical Scale and Horizontal Angle Corrections](#)
- [Checking the Instrument Constant](#)


Checking and Adjusting the Plate Level

The axis of the plate level vial must be at right angles to the vertical axis of the instrument.


To check and adjust the plate level:

1. Set up the instrument on the tripod.
2. Follow the leveling procedures described in [Leveling, page 17](#).
3. Rotate the alidade 180°.
4. Check whether the bubble is in the center of the vial.
5. If the bubble is not in the center of the vial, adjust the plate level:

- a. Using the adjusting pin supplied, rotate the plate level's adjustment screw until the bubble has moved half of the distance back to the center.

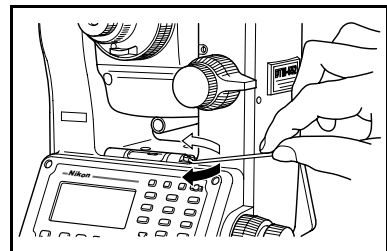


- b. Using leveling screw A, move the bubble into the center of the vial.
- c. Repeat from [Step 4](#).

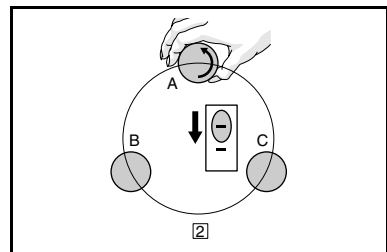

Checking and Adjusting the Circular Level

Once you have checked and adjusted the plate level, check the circular level.

If the bubble is not in the center of the level, use the adjusting pin to rotate the three adjustment screws until the bubble is centered.

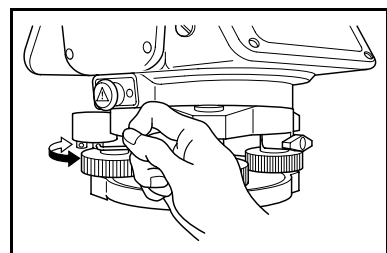


Checking and Adjusting the Optical Plummet

The optical axis of the plummet must be aligned with the vertical axis of the instrument.

To check and adjust the optical plummet:


1. Place the instrument on the tripod. You do not have to level the instrument.
2. Place a thick sheet of paper marked with an X on the ground below the instrument.

While you are looking through the optical plummet, adjust the leveling screws until the image of the X is in the center of the reticle mark ☉.

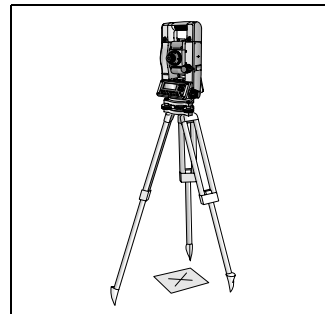


3. Rotate the alidade 180°.

If the marked image is in the same position in the center of the reticle mark, no adjustment is required

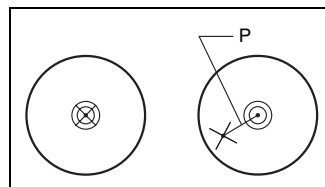

4. If the image is not in the same position, adjust the optical plummet:
 - a. Use the supplied hexagonal wrench to turn the adjustment screws until the image of the X is in Position P. Position P is the center point of the line connecting the X and the center of the reticle mark ☉.
 - b. Repeat from [Step 2](#).

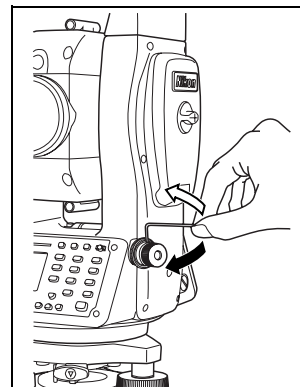

Zero Point Errors of Vertical Scale and Horizontal Angle Corrections

Checking

1. Set up the instrument on the tripod.
2. Follow the leveling procedures described in [Leveling, page 17](#).
3. Flip the telescope to the Face-1 position.
4. Sight a target that is within 45° of the horizontal plane.
5. Read the vertical angle from the VA1 field in the Basic Measurement Screen (BMS).
6. Rotate the instrument 180° and then flip the telescope to the Face-2 position.
7. Read the vertical angle from the VA2 field.
8. Add the two vertical angles together, $VA1 + VA2$.
 - No adjustment is required if the zero reference for vertical angles (VA zero setting) is set to Zenith, and $VA1 + VA2$ equals 360° .
 - No adjustment is required if the zero reference for vertical angles (VA zero setting) is set to Horizon, and $VA1 + VA2$ is either 180° or 540° .
 - An adjustment is required if $VA1 + VA2$ is not one of the values listed above.


Note – The difference between the vertical angle reading the relevant angle (either 360° for Zenith, or 180° or 540° for Horizon) is called the **altitude constant**.

Adjusting

There are two steps in the calibration program. Usually you only complete the first step that is described below, because the trunnion axis is finely adjusted mechanically.

To make a major adjustment to the trunnion axis error compensation, however, you can complete the second step that is described below and make three sets of observations.

To set the parameters for trunnion axis error compensation, establish two targets at a horizontal distance of at least 30 m from the instrument. The first target should be placed on the horizontal plane and the second should be more than 30° above the horizontal plane. Before you set the trunnion axis compensation value, you must complete three sets of F1/F2 observations to these two points. Even if you complete the second step, the instrument cannot store a trunnion axis error compensation of more than $30''$. If the error is more than $30''$, the instrument needs a mechanical check.

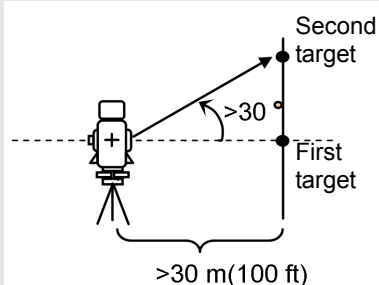

To enter the calibration screen, press **[MENU]** and **[7]**.




First step


1. Take an F1 measurement to a target on the horizon. Press **[ENT]**.

The vertical angle is shown in the
V0 dir= Horiz setting.


VA1	Face-1 vertical angle (tilt-off value)
HA1	Face-1 horizontal angle (tilt-off value)
X1	Face-1 X axis tilt value
Y1	Face-1 Y axis tilt value

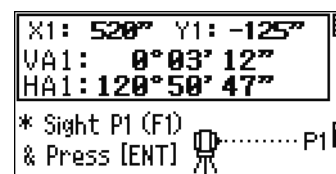

If you sight a target that has a VA of more than
3°, a warning message flashes on the third line.

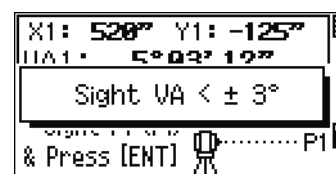


When you have taken the measurement, the
message on the bottom line changes from DO
NOT TOUCH! to Turn to F2.

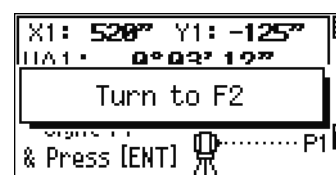


2. Take an F2 measurement to the same target.
Press **[ENT]**.

VA2	Face-2 vertical angle (tilt-off value)
HA2	Face-2 horizontal angle (tilt-off value)
X2	Face-2 X axis tilt value
Y2	Face-2 Y axis tilt value

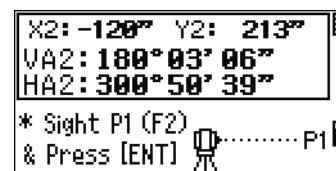


When the observation on F2 is completed, four
parameters are displayed.

3. Do one of the following:
 - To return to the first observation screen, press **[ESC]** or the Redo softkey.
 - To set parameters on the instrument, press **[ENT]** or the OK softkey.

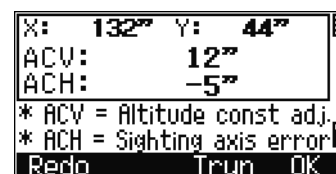

4. To go to the second step (trunnion axis compensation), press the **Trun** softkey.


If the HA corr. setting is set to OFF, the ACH parameter is not applied to horizontal angle readings. If this setting is set to ON, both of the ACH and trunnion-axis parameters are applied to HA. If you do not complete the second step, the trunnion-axis parameter remains set to zero, and only the ACH parameter is applied. For more information, see [Angle, page 116](#). If ACV, ACH, X, or Y is out of range, OVER appears. Press any key to return to the first observation screen.

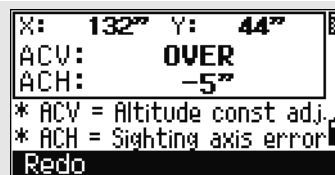

X: 132" Y: 44"
ACV: OVER
ACH: -5"
* ACV = Altitude const adj.
* ACH = Sighting axis error
Redo

Second step


1. Sight the second target that is placed more than 30 degrees above the horizontal plane.
2. Press **[ENT]** to take angle measurements in the following order:
 - Face-2 to P2
 - Face-1 to P2
 - Face-1 to P1 (Horizontal)
 - Face-2 to P1 (Horizontal)
 - Face-2 to P2
 - Face-1 to P2
 - Face-1 to P1 (Horizontal)
 - Face-2 to P1 (Horizontal)
 - Face-2 to P2
 - Face-1 to P2

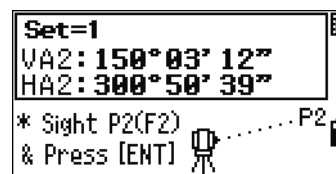

Set=1
VA2: 150°03'12"
HA2: 300°50'39"
* Sight P2(F2)
& Press [ENT]




Set=1
VA2: 150°03'12"
Turn to F1
* Sight P2(F2)
& Press [ENT]

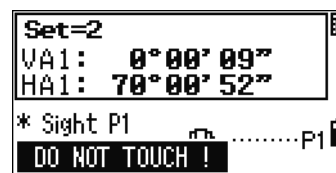


Set=2
VA1: 0°00'09"
HA1: 70°00'52"
* Sight P1
DO NOT TOUCH!

The tolerance in angle reading to each direction is 10". To maintain the accuracy of the instrument, you must take shots with extreme care. If the dHA to the same direction is more than 10", an error message appears, and you must remeasure all three sets of points.

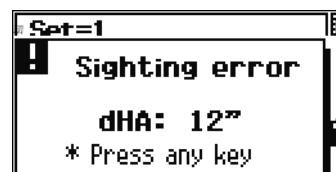


Set=1
! Sighting error
dHA: 12"
* Press any key

After three sets of F1/F2 observations, the instrument calculates the trunnion axis parameter and the updated ACH (the average of each set).

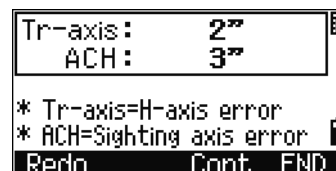


Tr-axis: 2"
ACH: 3"
* Tr-axis=H-axis error
* ACH=Sighting axis error
Redo Cont END

3. Do one of the following:
 - To return to the measurement screen for the first set of F1 measurements, press **[ESC]** or the **Redo** softkey.
 - To go to the next set of observations for a more accurate result, press the **Cont** softkey. You can record up to ten sets.
 - To store the parameter and return to the BMS, press **[ENT]** or the **END** softkey.
4. If HA corr. is set to OFF when you finish updating the trunnion axis parameter, a message appears. The message asks if you want to change the setting. To change the setting, press the **Yes** softkey.

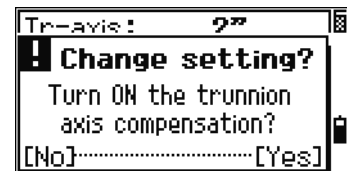

Trunnion axis compensation

The trunnion axis error is reported when the vertical axis and the trunnion axis (horizontal axis) are not perpendicular to each other. The sighting axis error is from the sighting and the trunnion axes. These two errors can be compensated by applying the Tr-axis and ACH parameters on this instrument to horizontal angle readings.

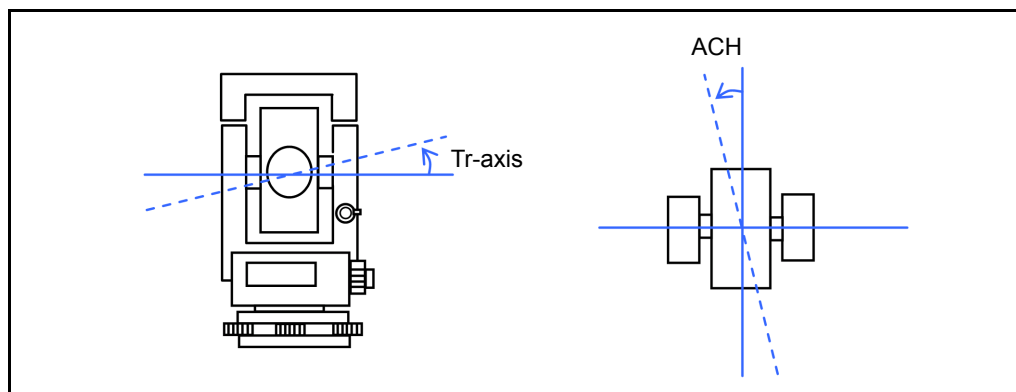


Because the amount of compensation changes according to the vertical angle, when compensation is enabled there is a slight movement in horizontal angle even if you clamp the tangent screw.

Checking the Instrument Constant

The instrument constant is a numerical value used to automatically correct for the displacement between the mechanical and electrical centers when measuring distances. The instrument constant is set by the manufacturer before the instrument is shipped. However, to ensure the highest operational accuracy, Nikon recommends that you check the instrument constant several times a year.

To check the instrument constant, you can either compare a correctly measured base line with the distance measured by the EDM, or follow the procedure below.

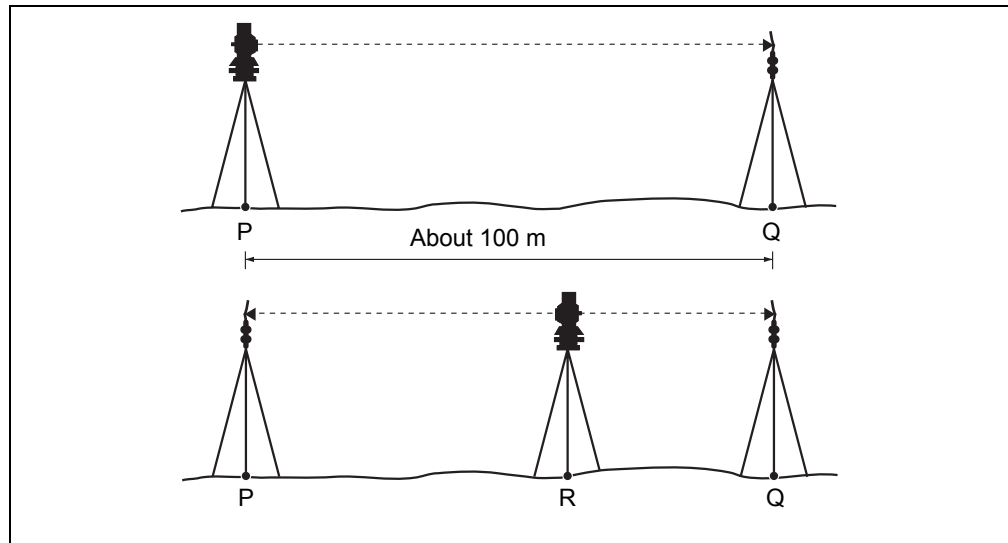

To check the instrument constant:

1. Set up the instrument at Point P, in as flat an area as possible.
2. Set up a reflector prism at Point Q, 100 m away from Point P. Make sure that you take the prism constant into account.
3. Measure the distance between Point P and Point Q (PQ).
4. Install a reflector prism on the tripod at Point P.
5. Set up another tripod at Point R, on the line between Point P and Point Q.
6. Transfer the NPL-632 instrument to the tripod at Point R.
7. Measure the distance from Point R to Point P (RP), and from Point R to Point Q (RQ).
8. Compare the value of PQ to the value $RP + RQ$. The difference should be within the specified range of error for the instrument ($\pm 3 \text{ mm} + 2 \text{ ppm} \times \text{distance}$).
9. At 100 m distance, the error range is $\pm 3.2 \text{ mm}$. If the error is out of range, contact your dealer.
10. Move the NPL-632 to other points on the line between Point P and Point Q.

11. Repeat [Step 5](#) through [Step 10](#) several times.
12. Calculate the average of all the values of RP, and the average of all the values of RQ.
13. Compare the value of PQ to averaged RP + averaged RQ. The difference should be within the specified range of error for the instrument ($\pm 3 \text{ mm} + 2 \text{ ppm} \times \text{distance}$).

At 100 m distance, the error range is $\pm 3.2 \text{ mm}$. If the error is out of range, contact your dealer.

Specifications

In this chapter:

- [Main Body](#)
- [Standard Components](#)
- [External Device Connector](#)

Main Body

Telescope

Tube length	153 mm (6.02 in.)
Magnification	26×
Effective diameter of objective	40 mm (1.57 in.) EDM 50 mm (1.97 in.)
Image	Erect
Field of view	1°30' 2.6 m at 100 m (2.6 ft at 100 ft)
Resolving power	3.0"
Focusing distance	1.6 m to infinity (62.9 in. to infinity)
Reticle illumination	3-level variable

EDM

Measurement range with no haze, visibility over 40 km (25 miles)	
Prism mode	
Reflector sheet (5 cm x 5 cm)	300 m (984 ft)
Mini-prism	3,000 m (9,800 ft)
Standard prism (1 P)	5,000 m (16,400 ft)
Reflectorless mode	
Reference target	210 m (700 ft)

Note –

- The target should not be exposed to the direct sunlight.
- "Reference target" refers to a white, highly reflective material.
- For measurements at short ranges, approximately 1.6 m to 5 m (5.2ft to 16.4ft) to the mini-prism, or 1.6 m to 10 m (5.2 ft to 33 ft) to the standard prism, it is recommended that you use a Nikon original prism to maintain the accuracy.

Dual-axis tilt sensor

Method	Liquid-electric detection
Compensation range	±3'

Angle measurement

Reading system	Photoelectric incremental encoder Diametrical detection for H/V circles
Circle diameter (reading)	88 mm (3.46 in.) (79 mm (3.11 in.))
Minimum display increment	
360°	1" / 5" / 10"
400G	0.2 mgon / 1 mgon / 2 mgon
MIL6400	0.0005 MIL / 0.02 MIL / 0.05 MIL
DIN18723 accuracy	2"/0.5 mgon

Precision

Precise mode	
Prism	± (3 + 2 ppm x D) mm ¹ at -10 °C through +40 °C (+14 °F through +104 °F) ± (3 + 3 ppm x D) mm ¹ at -20 °C through -10 °C; +40 °C through +50 °C (-4 °F through +14 °F; +104 °F through 122 °F)
Reflectorless	± (5 + 2 ppm x D) mm at -10 °C through +40 °C (+14 °F through +104 °F) ± (5 + 3 ppm x D) mm at -20 °C through -10 °C; +40 °C through +50 °C (-4 °F through +14 °F; +104 °F through 122 °F)
Normal mode	
Prism	± (10 + 5 ppm x D) mm
Reflectorless	± (10 + 5 ppm x D) mm

¹These precisions apply to measurements of 5 m(16 ft) or more to a reflector sheet and 10 m(33 ft) or more to a mini or standard prism. For measurements at shorter distances than these, the precision is ± 5 mm.

Measurement intervals

Precise mode	1.3 sec. (initial 2 sec.)
Normal mode	0.5 sec. (initial 1.6 sec.)
Least count	
Precise mode	0.1 mm (0.0005 ft.), switchable to 1 mm (0.002 ft)
Normal mode	1 mm (0.002 ft), switchable to 10 mm (0.02 ft)
Prism offset correction	–999 mm to +999 mm (1 mm step)

Lumi-guide

Light source	High luminescence LED
Operational distance	At least 100 m (330 ft)
Positioning accuracy	6 cm at 100 m (2.4 in. at 330 ft) (approx.)
Beam spread	About 1.5° 2.6 m at 100 m point (8.5 ft at 330 ft point)

Clamps/tangent screws

Type	2 speed, coaxial tangent/clamp knobs
Range	±4°

Tribrach

Type	Detachable
-------------	------------

Level vial sensitivity

Plate level vial	30"/2 mm
Circular level vial	10"/2 mm

Optical plummet

Image	Erect
Magnification	3×
Field of view	5°
Focusing range	0.5 m (1.6 ft) to infinity

Display and keypad

Display type	Graphical LCD
Resolution	128 × 64
Display illumination	Backlight
Keys	25
Supplied on	Face-1 and face-2

Connections in the base of instrument

Communications	
Type	RS-232C
Maximum baud rate	38400 bps asynchronous
External power supply input voltage	7.2 V through 11 V DC

Battery pack BC-80

Output voltage	7.2 V DC rechargeable
Continuous operation time	6 hours (angle/distance measurements)

Environmental performance

Operating temperature range	−20 °C through +50 °C (−4 °F through +122 °F)
Storage temperature range	−25 °C through +60 °C (−13 °F through +140 °F)

Dimensions

Main unit	173 mm W × 168 mm D × 365 mm H
Carrying case	470 mm W × 384 mm D × 231 mm H

Weight

Main unit	5.1 kg (11.24 lbs), approx.
Battery BC-80	0.6 kg (1.32 lbs), approx.
Carrying case	4.0 kg (8.82 lbs), approx.
Charger	0.30 kg (0.66 lbs)


CompactFlash card

CompactFlash card slot	Type I / Type II x 1
------------------------	----------------------

USB Connecters

Note – The instrument complies with USB version 1.1.

USB connector for PC	1
USB memory stick connector	1

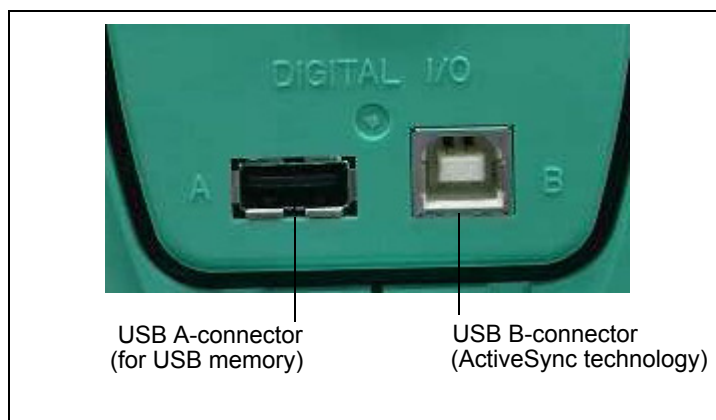

Note – Depending on the USB memory model, it may take longer (30 seconds or more) for the instrument to recognize the USB memory. After you have inserted the USB memory stick into the slot, Nikon recommends that you wait a while before you start importing or exporting data from/to the memory stick.

Note – Some USB memory sticks may not respond to the instrument properly. Nikon recommends that you use the performance-confirmed models. Please consult your dealer for details.

Standard Components

- NPL-632 main body
- Battery pack BC-80
- Universal charger and its input code and adapters
- CompactFlash card (128 MB)
- Tool set
- Objective lens cap
- Vinyl cover

- *Field Station NPL-632 Instruction Manual* (this document)
- Carrying case
- Shoulder strap

External Device Connector



CAUTION – Except for the connection shown in [Figure 8.1](#) on [page 164](#), use of this connector is at your own risk.



CAUTION – Use only the male connectors specified below. Using other connectors will damage the instrument.



CAUTION – Use only the pin connections shown below. Using other connections will damage the instrument.


This connector can be used to connect to an external power source or to communicate with an external device.

Before using the external device connector, make sure that the external device meets the specifications below.

Input voltage	7.2 V to 11 V DC
System	RS-232C
Signal level	±9 V standard
Maximum baud rate	38400 bps asynchronous
Compatible male connector	Hirose HR10A-7P-6P or HR10-7P-6P

The external device connector is a Hirose HR 10A-7R-6S female connector. The pinouts for connecting it to an external device connector are shown below:

Pin	Signal	Description
1	RxD	Receive data (Input)
2	TxD	Send data (Output)
3	+	Power
5	–	Ground
4, 6		No connection

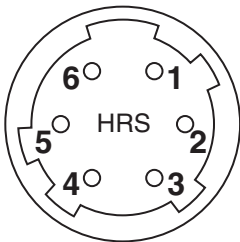

To connect to an external power source, supply power to Pin 3 (power terminal) and Pin 5 (ground terminal) on the instrument. The instrument will use the external power source even if the carrying handle battery BC-80 is attached.



CAUTION – Make sure that the power supplied is within the rated input range (7.2 V to 11 V, 1 A maximum). Power supplied outside this range will damage the instrument.

To communicate with an external device, connect the RS-232C signal from the external device to Pin 1 (input terminal) and to Pin 2 (output terminal) on the instrument.

Cap the data output/external power input connector securely while not in use. The instrument is not watertight if the cap is not attached or not attached securely, and when the data output/external power input connector is in use.

The instrument can be damaged by static electricity from the human body discharged through the data output/external power input connector. Before handling the instrument, touch any other conductive material once to remove static electricity.

System Diagrams

In this chapter:

- [System Components](#)

System Components

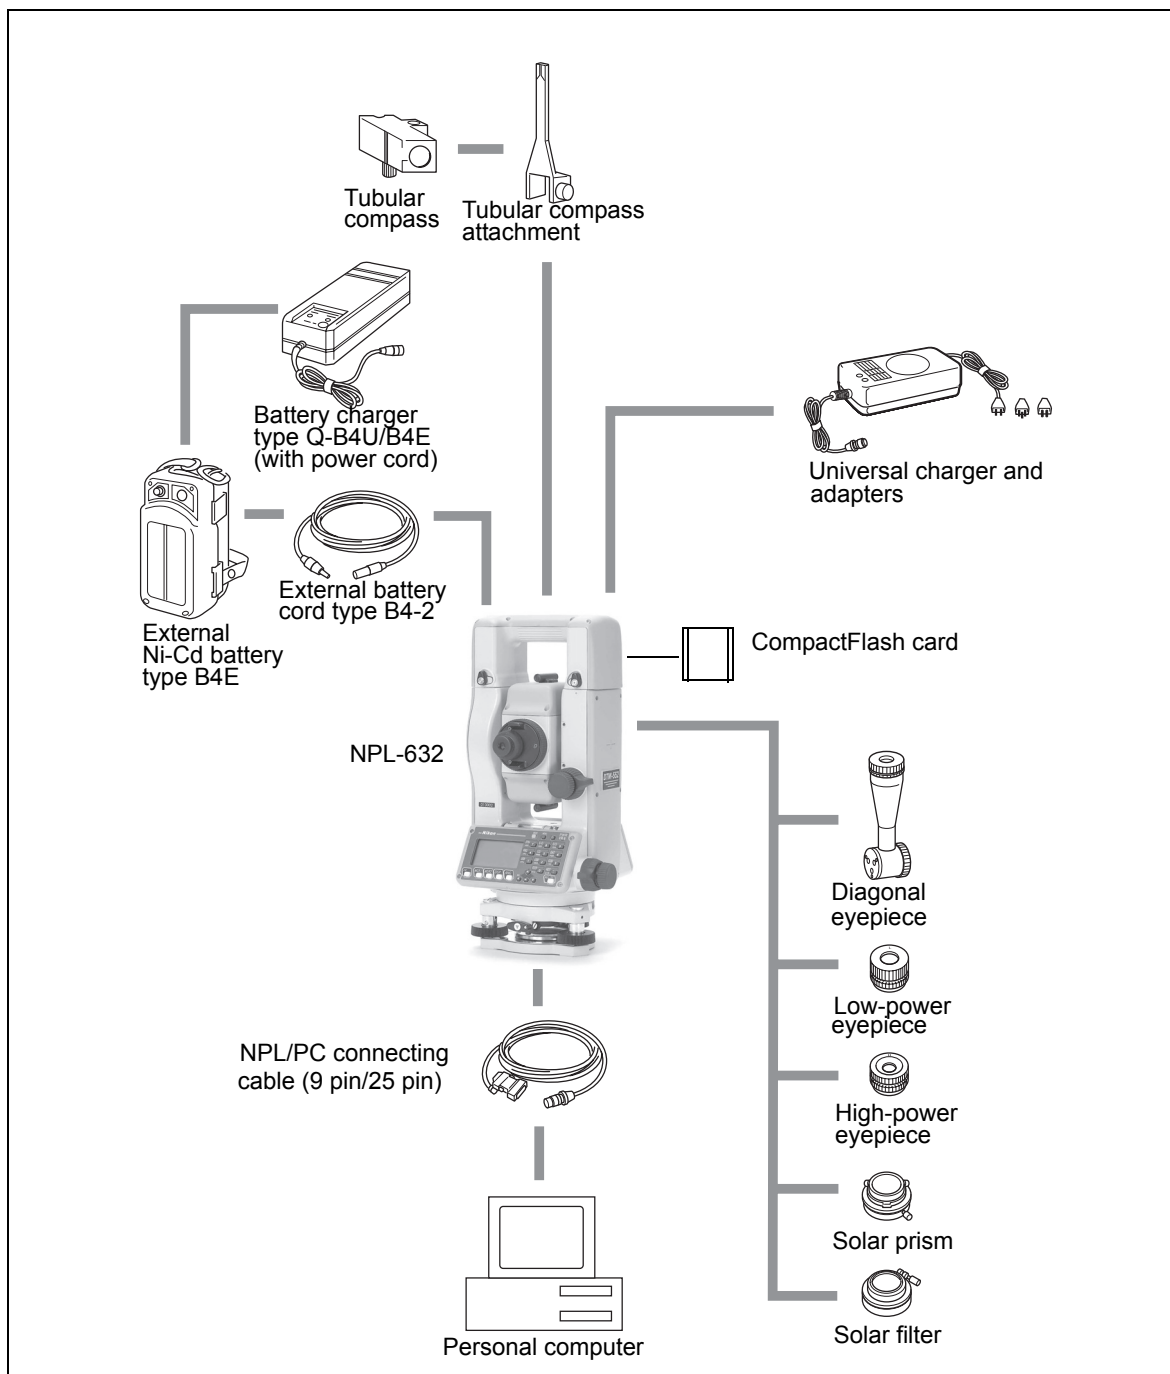


Figure 8.1 Measurement side

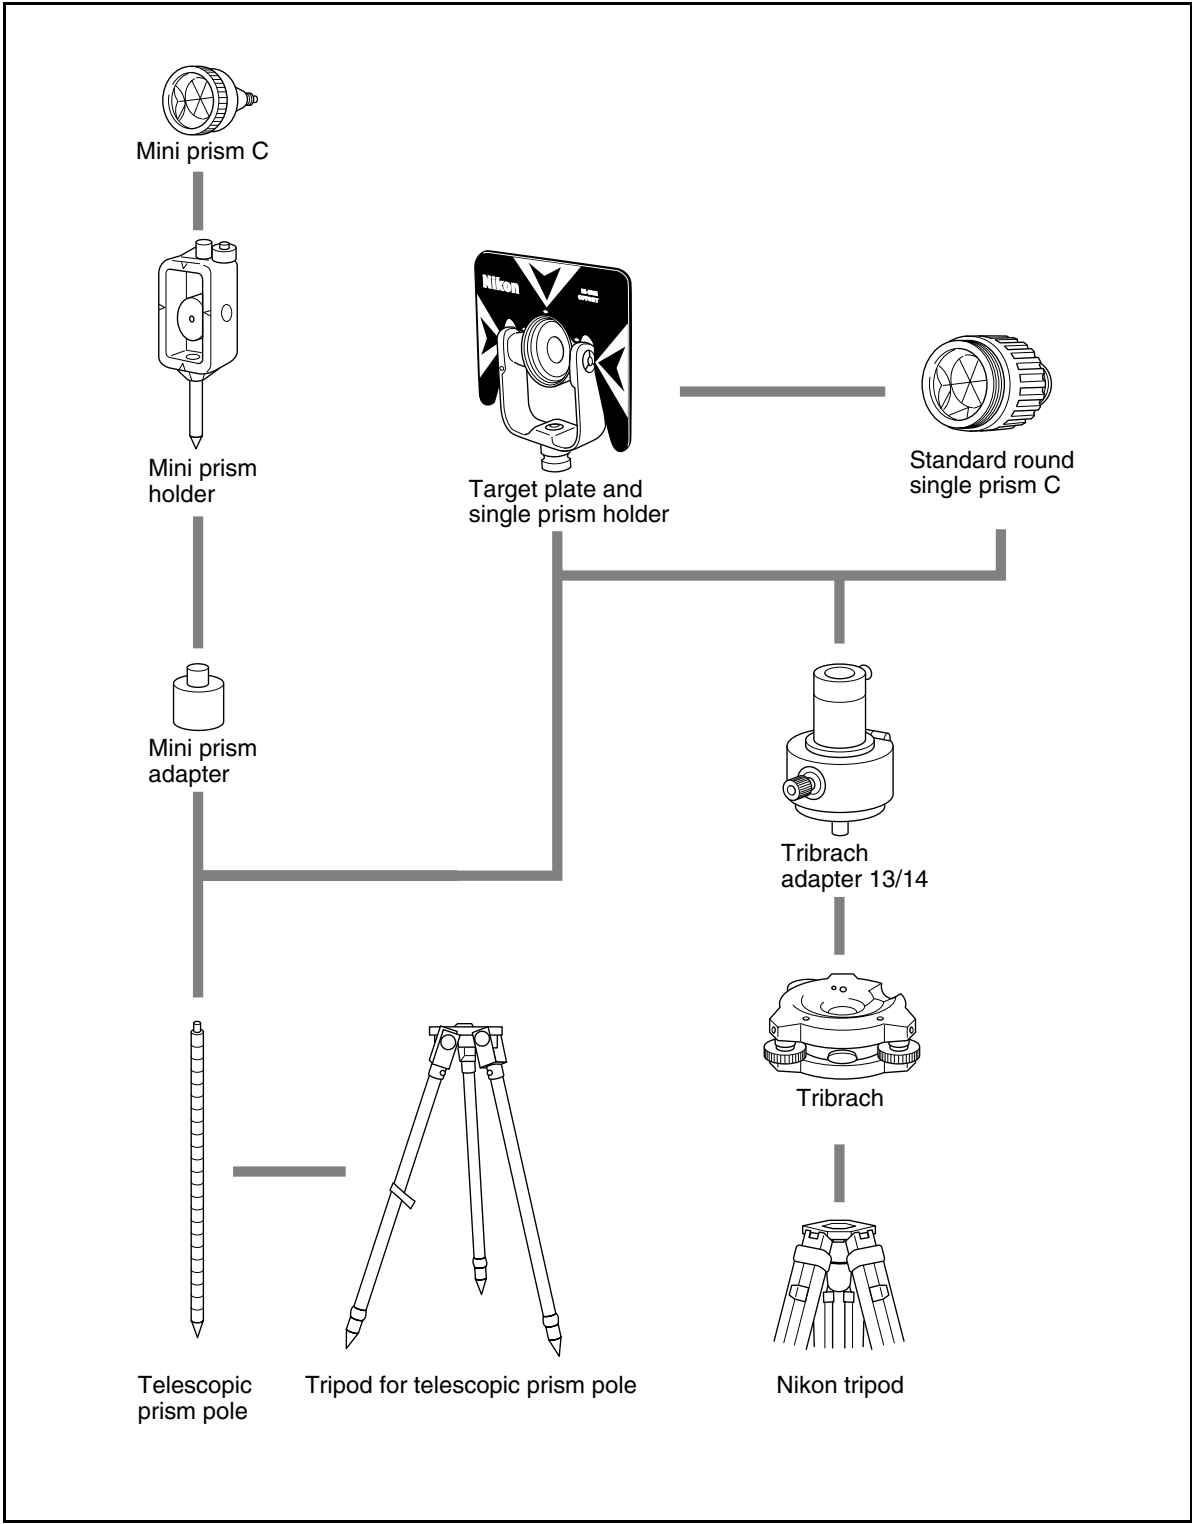


Figure 8.2 Prism reflector side

Communications


In this chapter:

- [Uploading Coordinate Data](#)
- [Uploading Point Lists and Code Lists](#)
- [Downloading Data](#)

Uploading Coordinate Data

Settings

To configure the transmission speed and other settings, go to MENU > Settings > Comm. For more information, see [Communications, page 118](#).

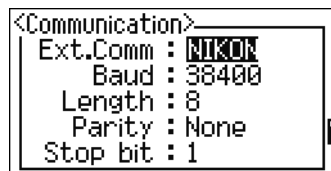

Record format

You can upload coordinate records in the following formats:

PT	,	X	,	Y	,	Z	,	CD
----	---	---	---	---	---	---	---	----

PT		X		Y		Z		CD
----	--	---	--	---	--	---	--	----

PT	,	X	,	Y	,	Z
----	---	---	---	---	---	---

PT		X		Y		Z
----	--	---	--	---	--	---

PT	,	X	,	Y	,		CD
----	---	---	---	---	---	--	----

PT		X		Y		CD
----	--	---	--	---	--	----

PT	,	X	,	Y	,	
----	---	---	---	---	---	--

PT	,	X	,	Y	,
----	---	---	---	---	---

PT	,			Z	,	CD
----	---	--	--	---	---	----

PT	,			Z
----	---	--	--	---

The record formats shown above use the following codes:

Code	Description	Length
PT	Point number	Up to 16 digits
X	Actual X coordinate	Variable length
Y	Actual Y coordinate	Variable length
Z	Actual Z coordinate	Variable length
CD	Feature code	Up to 16 characters

Data example

20100,6606.165,1639.383,30.762,RKBSS
20104,1165611.6800,116401.4200,00032.8080
20105 5967.677 1102.343 34.353 MANHOLE
20106 4567.889 2340.665 33.444 PT1
20107 5967.677 1102.343 34.353
20109,4657.778,2335.667,,PT2
20111,4657.778,2335.667
20113 4657.778 2335.667
20115,,,34.353,MANHOLE
20117,,,33.444

Uploading Point Lists and Code Lists

Settings

To configure the transmission speed and other settings, go to MENU > Settings > Comm. For more information, see [Communications, page 118](#).

```
<Communication>
Ext.Comm : NIKON
Baud : 38400
Length : 8
Parity : None
Stop bit : 1
```

File format

PT lists and code lists use the same record format. Use the filenames POINT.LST for a PT list, and CODE.LST for a code list.

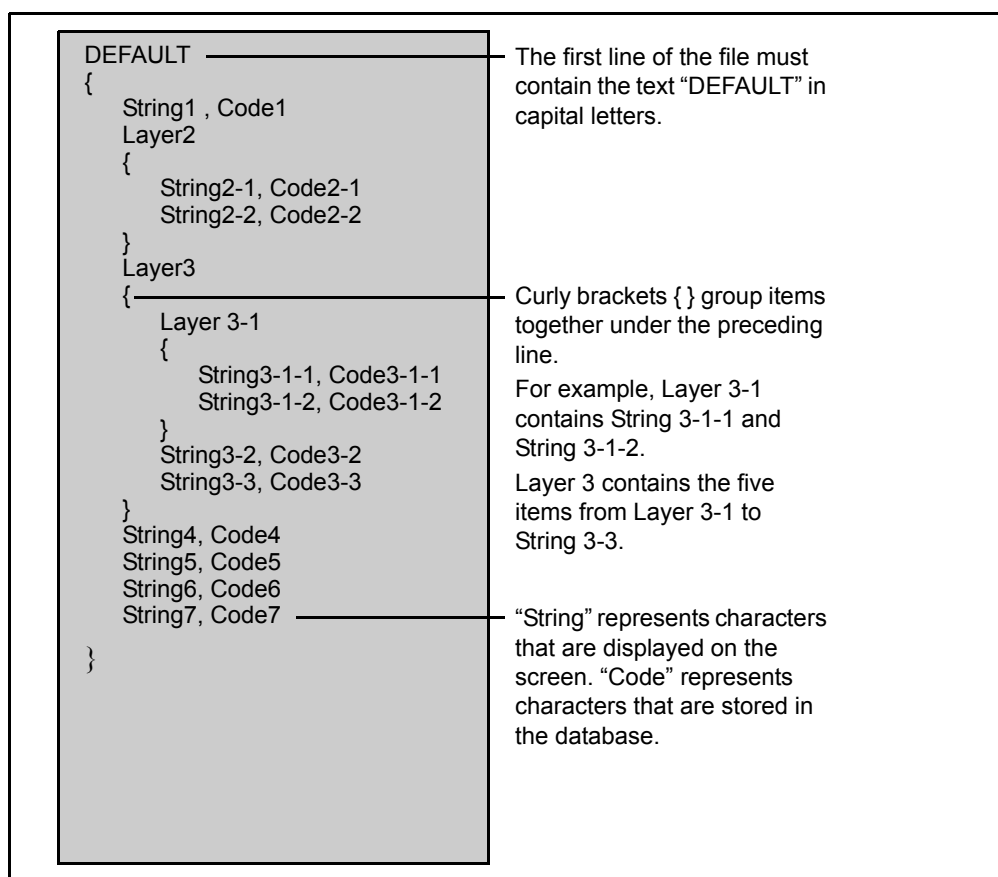


Figure 9.1 Record format for PT lists and code lists


Data example

```
DEFAULT
{
    "STRUCTURES"
    {
        "TREE", "S0001"
        "FENCE", "S0002"
        "MAIL BOX", "S0003"
        "FLOWER BED", "S0004"
    }
    "ROADS"
    {
        "MANHOLE", "R0001"
        "CENTER LINE"
        {
            "WHITE", "R002-W"
            "YELLOW", "R002-Y"
        }
        "SIDEWALK", "R0003"
        "CROSSING", "R0004"
        "BRIDGE", "R0005"
        "SIGNAL", "R0006"
        "HIGHWAY STAR", "R0007"
    }
    "RAILWAY"
    {
        "CROSSING", "RW001"
        "STATION", "RW002"
        "SIGNAL", "RW003"
        "BRIDGE", "RW004"
        "TUNNEL", "RW005"
    }
}
```

Downloading Data

Settings

To configure the transmission speed and other settings, go to **MENU > Settings > Comm.** For more information, see [Communications, page 118](#).

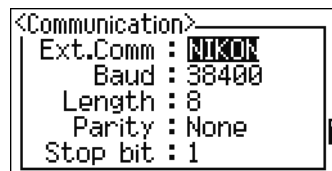

Nikon raw record formats

Coordinate records

type	,	pt	,	(pt id)	,	northing	,	easting	,	elevation	,	code
------	---	----	---	---------	---	----------	---	---------	---	-----------	---	------

type	One of the following codes:
UP	Uploaded point
MP	Manually input point
CC	Calculated coordinate
RE	Resection point
pt	Point number
(pt id)	(Point ID)
northing	Northing of the coordinate
easting	Easting of the coordinate
elevation	Elevation of the coordinate
code	Feature code

Station records

ST	,	stnpt	,	(stnid)	,	bspt	,	(bs id)	,	hi	,	bsazim	,	bsha
-----------	---	-------	---	---------	---	------	---	---------	---	----	---	--------	---	------

ST	Station record identifier (fixed text)
stnpt	Station point number
(stn id)	(Station ID)
bspt	Backsight point number
(bs id)	(Backsight ID)
hi	Height of instrument
bsazim	Backsight azimuth
bsha	Backsight horizontal angle

Control point records

CP	,	pt	,	(pt id)	,	ht	,	sd	,	ha	,	va	,	time	,	code
-----------	---	----	---	---------	---	----	---	----	---	----	---	----	---	------	---	------

CP	Control point record identifier (fixed text)
pt	Point number
(pt id)	(Point ID)
ht	Height of target
sd	Slope distance
ha	Horizontal angle
va	Vertical angle
time	24-hour time stamp
code	Feature code

Sideshot records

SS	,	pt	,	ht	,	sd	,	ha	,	va	,	time	,	code
-----------	---	----	---	----	---	----	---	----	---	----	---	------	---	------

SS	Sideshot record identifier (fixed text)
pt	Point number
ht	Height of target
sd	Slope distance
ha	Horizontal angle
va	Vertical angle
time	24-hour time stamp
code	Feature code

Stakeout records

SO	,	pt	,	(sopt)	,	ht	,	sd	,	ha	,	va	,	time	,
----	---	----	---	--------	---	----	---	----	---	----	---	----	---	------	---

SO	Stakeout record identifier (fixed text)
pt	Recorded point number
(sopt)	(Original number of point staked)
ht	Height of target
sd	Slope distance
ha	Horizontal angle
va	Vertical angle
time	24-hour time stamp

F1/F2 records

face	,	pt	,	ht	,	sd	,	ha	,	va	,	time
------	---	----	---	----	---	----	---	----	---	----	---	------

face	One of the following: F1 Shot taken using Face-1 (fixed text) F2 Shot taken using Face-2 (fixed text)
pt	Point number
ht	Height of target
sd	Slope distance
ha	Horizontal angle
va	Vertical angle
time	24-hour time stamp

Comment/note records

CO	,	text
----	---	------

CO	Comment record identifier (fixed text)
text	Comment text

SDR2x and SDR33 record formats

Header record

00NM	ver	0000	datetime	ang	dist	press	temp	coord	1
------	-----	------	----------	-----	------	-------	------	-------	---

1–4	00NM	Header record identifier (fixed text)							
5–20	ver	SDR download version. One of the following: SDR20V03-05 SDR2x SDR33V04-01 SDR33							
21–24	0000	Not used							
25–40	datetime	Download date and time (in hours and minutes)							
41	ang	Angle units. One of the following: 1 Degrees 2 Gons 4 Mils							
42	dist	Distance units. One of the following: 1 Meters 2 Feet							
43	press	Pressure units. One of the following: 1 mm Hg 2 In. Hg 3 hPa							
44	temp	Temperature units. One of the following: 1 Celsius 2 Fahrenheit							
45	coord	Coordinate order. One of the following: 1 NEZ 2 ENZ							
46	1	Not used							

Instrument record

01KI1	instr	serNo	Instr	serNo	1	zero VA	0.000	0.000	0.000
-------	-------	-------	-------	-------	---	---------	-------	-------	-------

1–5	01KI1	Instrument record identifier (fixed text)							
6–21, 28–43	instr	Instrument make and model							
22–27, 44–49	serNo	Instrument serial number							
50	1	Not used							
51	zero VA	The reference point for vertical angles. One of the following: 1 Zenith 2 Horizon							
52–61,	0.000	Not used							
62–71,	0.000	Not used							
72–81,	0.000	Not used							

Station details record

02KI	stnpt	northing	easting	elevation	hi	desc
1–4	02KI	Station details record identifier (fixed text)				
5–8 (2x), 5–20 (33)	stnpt	Station point number				
9–18 (2x), 21–36 (33)	northing	Northing of station				
19–28 (2x), 37–52 (33)	easting	Easting of station				
29–38 (2x), 53–68 (33)	elevation	Elevation of station				
39–48 (2x), 69–84 (33)	hi	Height of instrument				
49–64 (2x), 85–100 (33)	desc	Station description				

Target details record

03NM	ht	
1–4	03NM	Target details record identifier (fixed text)
5–14 (2x), 5–20 (33)	ht	Height of target

Backsight bearing details record

07KI	stnpt	bspt	bsazim	ha
1–4	07KI	Backsight bearing details record identifier (fixed text)		
5–8 (2x), 5–20 (33)	stnpt	Station point number		
9–12 (2x), 21–36 (33)	bspt	Backsight point number		
13–22 (2x), 37–52 (33)	bsazim	Backsight azimuth		
23–32 (2x), 53–68 (33)	ha	Horizontal angle		

Coordinates record

08KI	pt	northing	easting	elevation	desc
------	----	----------	---------	-----------	------

1–4	08KI				Coordinates record identifier (fixed text)
5–8 (2x), 5–20 (33)	pt				Point number
9–18 (2x), 21–36 (33)	northing				Northing of the coordinate
19–28 (2x), 37–52 (33)	easting				Easting of the coordinate
29–38 (2x), 53–68 (33)	elevation				Elevation of the coordinate
39–54 (2x), 69–84 (33)	desc				Feature code

Observation record

09MC	stnpt	pt	sd	va	ha	desc
------	-------	----	----	----	----	------

1–4	09MC					Observation record identifier (fixed text)
5–8 (2x), 5–20 (33)	stnpt					Station point number
9–12 (2x), 21–36 (33)	pt					Observed point number
13–22 (2x), 37–52 (33)	sd					Slope distance
23–32 (2x), 53–68 (33)	va					Vertical angle
33–42 (2x), 69–84 (33)	ha					Horizontal angle
43–58 (2x), 85–100 (33)	desc					Feature code

Job identifier record

10NM	jobid	1	incZ	T&Pcorr	C&Rcorr	refcon	sealev
------	-------	---	------	---------	---------	--------	--------

1–4 **10NM** Job identifier record ID (fixed text)

5–8 (2x), jobid Job name/title

5–20 (33)

The following fields occur only in SDR33 format.

21 **1** Point ID length option

22 incZ 2D or 3D coordinates. One of the following:

1 2D

2 3D

23 T&Pcorr Atmospheric correction. One of the following:

1 Off

2 On

24 C&Rcorr Curvature and refraction correction. One of the following:

1 Off

2 On

25 refcon Refraction constant. One of the following:

1 0.132

2 0.200

26 sealev Sea level correction. One of the following:

1 Off

2 On

Note record

13NM	note
------	------

1–4 **13NM** Note record ID (fixed text)

5–64 note Note text

Data examples

Nikon raw data format

CO,Nikon RAW data format V2.00
 CO,B: EXAMPLE5
 CO,Description: SAMPLE DATA OF DOWNLOAD
 CO,Client: NIKON
 CO,Comments: YOKOHAMA PLANT
 CO, Downloaded 26-MAY-2006 18:56:10
 CO,Software: Pre-installed software version: 1.20
 CO,Instrument: Nikon NPL-632
 CO,Dist Units: Metres
 CO,Angle Units: DDDMMSS
 CO,Zero azimuth: North
 CO,Zero VA: Zenith
 CO,Coord Order: NEZ
 CO,HA Raw data: Azimuth
 CO,Tilt Correction: VA:ON HA:ON
 CO, EXAMPLE5 <JOB> Created 22-MAY-2006 07:09:21
 MC,1,,100.000,200.000,10.000,
 CO,Temp:20C Press:760mmHg Prism:0 22-MAY-2006 07:11:34
 ST,1,,,,1.400,55.4500,55.4500
 F1,,,,0.0000,90.0000,8:27:58
 SS,3,1.200,330.706,326.027,20.320,07:13:46,SIGN
 SS,4,1.250,379.193,300.847,29.084,07:14:24,TREE
 SS,5,1.218,363.344,328.032,30.105,07:14:57,TREE R
 SO,1003,,1.240,331.220,326.783,19.998,07:18:17,

Nikon coordinate data format

1,100.0000,200.0000,10.0000,
 2,200.0000,300.0000,20.0000,
 3,116.9239,216.9140,11.8425,TRAIN PLATFORM
 4,126.6967,206.2596,11.2539,RAMP
 11,100.0045,199.9958,10.0000,
 13,116.9203,216.9113,11.7157,
 14,126.6955,206.2579,10.9908,
 21,100.0103,199.9958,10.0000,
 31,100.0013,200.0005,10.0000,
 41,100.0224,200.0331,9.9000,
 43,116.9263,216.9165,11.8016,CURB
 44,126.7042,206.2871,10.8193,DITCH
 45,116.9266,216.9160,11.8028,
 46,126.7046,206.2845,10.8213,CP POINT

SDR2x raw data format

00NMSDR20V03-05 000023-MAY-2006 18:39:111211
10NMTEST JOB
01K11 Nikon NPL63200000 Nikon NPL63200000012 0.000 0.000 0.000
13NMDownloaded 23-MAY-2006 18:39:22
13NMSftware: Pre-installed software version: 1.20
13NMInstrument: Nikon NPL-632
13NMDist Units: Metres
13NMAngle Units: Degrees
13NMZero azimuth: North
13NMZero VA: Horizon
13NMCoord Order: NEZ
13NMClient:
13NMDescription:
13NM P_509 <JOB> Created 23-MAY-2006 07:09:21
08KI0001100.000 200.000 10.000
08KI0002200.000 300.000 20.000
02KI0001100.000 200.000 10.000 0.100
07KI0001000245.0000 0.0000
13F100000002<null> <null> 0.0000
13F200000002<null> <null> 179.9639
13NMBS Check HA:359.3525 Reset to HA: 0.0000 07:21:41
13F10000000323.990 4.1694 0.0000
13F20000000323.990 175.8403 180.0028
03NM0.000
13F10001000323.990 4.1653 359.9833 MAIN PLATFORM
13F10001000427.445 2.4097 328.1958 RAMP
13NMStart of 2-Pt Resection
13F10000000427.445 2.4097 0.0000
13F10000000323.991 4.1542 31.8042
13F10000000427.430 1.8583 121.4306
13F10000000323.976 3.8625 153.2306
08KI0011100.005 199.996 10.000
02KI0011100.005 199.996 10.000 0.100
07KI0011000344.9980 0.0000

SDR2x coordinate data format

00NMSDR20V03-05 000023-MAY-2006 18:40:111211
 10NMTEST JOB
 01K11 Nikon NPL632000000 Nikon NPL63200000012 0.000 0.000 0.000
 13NMDownloaded 23-MAY-2006 18:40:06
 13NMSftware: Pre-installed software version: 1.20
 13NMInstrument: Nikon NPL-632
 13NMDist Units: Metres
 13NMAngle Units: Degrees
 13NMZero azimuth: North
 13NMZero VA: Horizon
 13NMProjection correction: OFF
 13NMC&R correction: OFF
 13NMSea level correction: OFF
 13NMCoord Order: NEZ
 13NMClient:
 13NMDescription:
 13NMTilt Correction: VA:OFFHA:OFF
 13NMP_0509 <JOB> Created 23-MAY-2006 07:09:21
 13NMPrism constant: 0
 08KI0001100.000 200.000 10.000
 08KI0002200.000 300.000 20.000
 13NMBacksight Check to Pt:2 HA:359.3525 07:21:39
 13NMBacksight Pt:2 Reset to HA: 0.0000 07:21:41
 08KI0003116.924 216.914 11.843 MAIN PLTFORM
 08KI0004126.697 206.260 11.254 RAMP
 13NMStart of 2-Pt Resection
 08KI0011100.005 199.996 10.000

Error Messages

In this chapter:

- [Angle](#)
- [Cogo](#)
- [Communications](#)
- [Data](#)
- [Job Manager](#)
- [Programs](#)
- [Recording Data](#)
- [Searching](#)
- [Settings](#)
- [Stakeout](#)
- [Station Setup](#)
- [Removable Memory Devices](#)
- [System Error](#)

Angle

STN Setup has to be in F1/F2

You selected ANG>F1/F2 without an F1/F2 measurement in Station Setup.

Press any key to return to the previous screen. Then go to Station Setup and take F1/F2 measurement to the BS.

Cogo

NO Result

The system was unable to calculate an area because points were not entered in the correct order.

Press any key to return to the Cogo menu. Then enter the points in the correct order.

Same Coordinate

The point or coordinate that you entered is identical to the previous input point.

Press any key to return to the point input screen. Then use a different point.

XY-coordinate is required

The input point does not have XY (NE) coordinates.

Press any key to return to the point input screen. Then enter a point that has X and Y coordinates.

Communications

If an error is detected during uploading of data, the instrument aborts the upload process and displays one of the following messages.

Check Data

There are errors in the uploaded data. The uploaded data contains errors, such as an alphabetic character in a coordinate field.

Press any key. Then check the specified line in the data.

DUPLICATE PT

The uploaded data contains a duplicate PT.

Press any key. Then check the specified point in the data.



CAUTION – If the existing point is a UP, CC, or MP record, and is not referred by ST or BS, then it will be overwritten by the uploaded record. No error message appears.

PT MAX20 chars

The uploaded data contains a PT with a name or number that is longer than 20 digits.

Press any key. Then check the specified line in the data.

XYZ OVERRANGE

The uploaded data contains a coordinate that is longer than 13 digits.

Press any key. Then check the specified line in the data.

Data

Can't Edit Current ST

You have tried to edit the current ST.

Note – You cannot edit the current ST. However, old ST records can be edited. No recalculation can be performed on the instrument.

Press any key to return to the code/layer name input screen.

Can't Edit ST/BS refer to this PT

You have tried to edit a coordinate that the current ST or BS refers to. You cannot change a coordinate if the current ST or BS refers to it.

Press any key to return to the Data view screen.

Can't Edit XYZ from measurement

You have tried to change the coordinates of an SO, SS, or CP record. You cannot change the coordinates of an SO, SS, or CP record.

Press any key to return to the previous screen.

DELETE Stn-XYZ

You have tried to delete a coordinate record that the current ST or BS refers to. You must confirm that you want to delete a coordinate record that the current ST or BS refers to.

To ...	Press ...
delete XYZ	the DEL softkey
return to the previous screen without deleting XYZ	ESC or the Abort softkey

Job Manager

Cannot Assign

You have tried to set the current job as the control file.

Press any key to return to the previous screen. Then select a different job.

Can't Create

There is no space available to create a job or record a point.

Press any key to return to the Job Manager. Then use the DEL softkey to delete old jobs.

Existing Job

You have entered an existing job name for a new job.

Press any key and then change the name for the new job.

MAX 32Jobs

You are trying to create a new job when the maximum number of jobs (32) is already stored.

Press any key to return to the Job Manager. Then use the DEL softkey to delete old jobs.

Programs

NO Stn Setup

You did not perform a station setup or BS check before entering the Programs function.

To ...	Press ...
go to the Stn Setup menu	2 or select Stn Setup
return to the BMS	ESC
go to the Programs menu	1 or select Continue



WARNING – Selecting Continue does *not* resume the last ST record. You should only use the Continue option if you are sure that the previous ST coordinates and the current HA orientation are correct. Otherwise, records in the Programs function may not be correct.

XY&Z coordinate are required

Three-dimensional coordinates are required in S-Plane function.

Press any key to return to the point input screen. Then enter a three-dimensional point.

Recording Data

DATA FULL

The data storage is full.

Press any key to return to the Basic Measurement Screen (BMS). Then:

To ...	Go to ...
delete unnecessary data	MENU > Data
delete jobs	MENU > Job

DUPLICATE PT

The input PT you are trying to record already exists in the current job. An existing coordinate record cannot be overwritten by measured data.

Press any key to return to the point input screen. Change PT.

Duplicate PT

The input PT you are trying to record already exists in the current job as an SS, SO, or CP record. An existing SS, SO, or CP record can be overwritten by measured data.

To ...	Press ...
return to the PT input screen	[ESC] or the Abt t softkey
record RAW data and update XYZ data	the XYZ softkey
record RAW data only	the RAW softkey

No Open Job

No job is open.

To ...	Press ...
open the job list, if there are existing jobs	[1] or select Select job
create a new job	[2] or select Create job
return to the previous screen	[ESC]

NO Stn Setup

There is no station record in the current job, or a station setup or BS check has not been done since the program was rebooted.

To ...	Press ...
continue recording	[1] or select Continue . If there is already an ST record in the job, the message CO, Use current orientation appears.
go to the Stn Setup menu	[2] or select STN Setup
return to the previous screen	[ESC]

OVER RANGE

You are trying to record a coordinate with more than 13 digits

Press any key to return to the previous screen. Then check the current ST coordinate.

Searching

PT Not Found

There is no point that matches the criteria you entered.

Press any key to return to the point input screen.

This message may appear in any function where the PT/CD is input, such as Station Setup or Stakeout.

Settings

Job Settings will be changed

You have changed one or more of the following job settings:

- VA zero or HA in the Angle screen (see [Angle, page 116](#))
- Scale, T-P, Sea Lvl, or C&R in the Distance screen (see [Distance, page 116](#))
- Coord or Az Zero in the Coordinates screen (see [Coordinate, page 118](#))
- Angle, Dist, Temp, or Press in the Unit screen (see [Unit, page 119](#))

To ...	Press ...
discard the changes to the job settings	[ESC] or the ABORT softkey. The current job remains open.
close the current job and save the changes to the job settings	[ENT] or the OK softkey

Note – To record a point using the new settings, create a new job using the new settings.

Stakeout

Input Error

The point name style used in the Fr field is not the same as the style used in the To field. For example, the Fr field style is 1, and the To field style is A200.

Press any key to return to the Fr/To input screen. Then re-enter the point name, using the same naming style in both fields.

NO Stn Setup

You did not perform a station setup or BS check before entering the Stakeout function.

To...	Press ...
go to the Stn Setup menu	2 or select Stn Setup
return to the Basic Measurement Screen (BMS)	ESC
go to the Stakeout menu	1 or select Continue



CAUTION – Selecting **Continue** does **not** resume the last ST record. You should only use the **Continue** option if you are sure that the previous ST coordinates and the current HA orientation are correct. Otherwise, records in the Stakeout function may not be correct.

Station Setup

Calc ST Failed Need additional PT

Calculating ST failed in resection. This message may appear after you have deleted a point the View shots screen.

Press any key to return to the PT input screen. Take another shot to calculate the ST coordinate.

Same Coordinate

The input PT or coordinate is identical to the current station in STN/1:Known, or the same coordinate or point name/number is found in Resection.

Press any key to return to the PT input screen. Then use a different PT.

Space LOW

There is not enough space to record a station when you start any of the Station Setup functions.

To ...	Press ...
return to the BMS	press ESC or the Abort softkey. Use the DEL softkey in Job Manager to delete old jobs.
continue	press ENT or the OK softkey. You may not be able to record the whole process.

XY-coordinate is required

The input point for ST/BS does not have N/E coordinates.

Press any key to return to the PT input screen. Then use a PT that has N/E coordinates.

Z-coordinate is required

The input point for Benchmark does not have a Z coordinate.

Press any key to return to the PT input screen. Then use a PT that has a Z coordinate.

Removable Memory Devices

These errors relate to the CompactFlash card and / or the USB memory stick.

MAX 32 Jobs

There were 32 jobs (the maximum number of jobs that can be stored on the instrument) on the instrument when you tried to copy (import) a job from the removable memory device.

Press **[ESC]** to return to the BMS screens. Press **[MENU]** and then press **[1]** to delete unnecessary job files.

No ext. memory

The system does not recognize the removable memory device in the slot.

Make sure that you insert the CF card or the USB memory stick properly in the slot.

No Job Found

No job files were found in the removable memory.

Make sure that the job files are stored in \NTTS\JOBS.

Memory shortage

There are too many files in the removable memory.

Insert the CF card or the USB memory stick into your office computer and then delete files stored in the \NTTS\JOBS folder. You can then insert the CF card or the USB memory stick into the instrument.

This file is not Job file

The file that was imported (copied) from the removable memory to the instrument was not the Job file.

Repeat the procedure to import the correct Job file from the removable memory.

Data full !

There is not enough free memory in the instrument for you to copy (import) the Job from the removable memory.

Press **[ESC]** to return to the BMS screen. Press **[MENU]** and then press **[1]** to delete unnecessary job files.

Exist same Job

A job with the same name already exists on the instrument when you tried to copy (import) the Job from the removable memory. A time stamp shows when the files were last updated.

Press the **Rname** softkey to copy the file using a different name.

To protect the data on the instrument, the system is designed not to allow data to be overwritten directly by external data. If you do not need an existing file on the instrument, first delete the file from the BMS screen, using **Menu** **1** and then copy (import) the file from the removable memory.

To overwrite You can overwrite data on the removable memory by pressing the **Over** softkey.

System Error

=SYSTEM ERROR=

The system has detected an internal error that is related to the lower-level system.

Press any key to turn the instrument off. The system will reboot when this error is reported. If you still have more points to shoot in the site, turn the instrument on and repeat the open a job and station setup procedures.

Data stored before this error will be kept safely in the Job file.

If the error appears frequently, please contact your dealer or Trimble Support and report the message that appears below the **=SYSTEM ERROR=** line.

